
AD-A165 425 REDUCING REPAIR TURN AROUND TIME OF DEPOT LEVEL REPAIRABLES AT NAVAL SHIPYARDS(U) NAVAL POSTGRADUATE SCHOOL MONTEREY CA J R RODWELL DEC 85 1/2 F/G 15/5 UNCLASSIFIED NŁ



MICROCOPY RESOLUTION TEST CHART NATIONAL BUREAU OF STANDARDS 1964 A

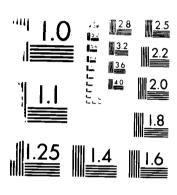

AD-A165 425

NAVAL POSTGRADUATE SCHOOL Monterey, California





THESIS

REDUCING REPAIR TURN AROUND TIME OF DEPOT LEVEL REPAIRABLES AT NAVAL SHIPYARDS

by

Joseph R. Rodwell, Jr.

December 1985

Thesis Advisor:

Alan W. McMasters

Approved for public release; distribution is unlimited.

ITIC FILE COPY

86 5 10 038

SECURITY CLASSIFICATION OF THIS PAGE	050007 000	INTERITATION DACE
	REPORT DOC	JMENTATION PAGE
1a. REPORT SECURITY CLASSIFICATION UNCLASSIFIED		1b. RESTRICTIVE MARKINGS
2a. SECURITY CLASSIFICATION AUTHORITY		3 DISTRIBUTION/AVAILABILITY OF REPORT Approved for public release;
2b. DECLASSIFICATION / DOWNGRADING S	CHEDULE	distribution is unlimited.
4 PERFORMING ORGANIZATION REPORT	NUMBER(S)	5. MONITORING ORGANIZATION REPORT NUMBER(\$)
6a. NAME OF PERFORMING ORGANIZATION		7a. NAME OF MONITORING ORGANIZATION
Naval Postgraduate Sch	ool (If applicable) 54	Naval Postgraduate School
6c. ADDRESS (City, State, and ZIP Code)		7b. ADDRESS (City, State, and ZIP Code)
Monterey, California 9	3943-5100	Monterey, California 93943-5100
8a. NAME OF FUNDING/SPONSORING ORGANIZATION	8b. OFFICE SYMBOL (If applicable)	9. PROCUREMENT INSTRUMENT IDENTIFICATION NUMBER
8c. ADDRESS (City, State, and ZIP Code)		10. SOURCE OF FUNDING NUMBERS
		PROGRAM PROJECT TASK WORK UNIT NO. ACCESSION NO.
11 TITLE (Include Security Classification) REDUCING REPAIR TURN AS SHIPYARDS 12 PERSONAL AUTHOR(S) ROdwell, Joseph R., Jr		EPOT LEVEL REPAIRABLES AT NAVAL
13a TYPE OF REPORT 13b. Master's Thesis FRO	TIME COVERED M TO TO	14. DATE OF REPORT (Year, Month, Day) 15 PAGE COUNT 1985 December 139
16 SUPPLEMENTARY NOTATION		
17 COSATI CODES		(Continue on reverse if necessary and identify by block number)
FIELD GROUP SUB-GROU	Navy ship	es, management, depot turnaround time, yards, Inventory Management
19 ABSTRACT (Continue on reverse if nec	essary and identify by bloc	number)
Depot Level Repairables (DI hauled by naval shipyards to exceed the Naval Supply Sys- to gather RTAT data on DLRs Point (DOP) repair process dures used by SPCC in prepairable cast on the shipyard repairable the management of repairable	Rs) managed by the been excessive. Meter command's goal and identify pote that will reduce Refing the workload process was also es in shipyards the Information Systems.	caused Repair Turn Around Time (RTAT) of Ships Parts Control Center (SPCC) and overany of the DLRs repaired by naval shipyards of 60 days. Four Navy Shipyards were visited atial improvements in the Designated Overhaul TAT. An analysis of the policies and proceforecase as well as the effects of the foreconducted. Recommendations are made to improve cough Command support and the use of an Automan (ARMIS). Recommendations are also offered

20 DISTRIBUTION/AVAILABILITY OF ABSTRACT

QUNCLASSIFIED/UNLIMITED SAME AS RPT. DTIC USERS

223 NAME OF RESPONSIBLE INDIVIDUAL

Alan W. McMasters

21. ABSTRACT SECURITY CLASSIFICATION

Unclassified

22b. TELEPHONE (Include Area Code) 22c OFFICE SYMBOL

(408) 646-2678

54Mg

Approved for public release; distribution is unlimited.

Reducing Repair Turn Around Time of Depot Level Repairables at Naval Shipyards

by

Joseph Robert Rodwell Jr.
Lieutenant Commander, United States Navy
B.S., University of South Carolina, 1972

Submitted in partial fulfillment of the requirements for the degree of

MASTER OF SCIENCE IN MANAGEMENT

from the

NAVAL POSTGRADUATE SCHOOL December 1985

Author:	Joseph R. Kodevell.
	Jøseph Robert Rodwell Jr.
Approved by:_	A. W. HcMasters, Thesis Advisor
	A. W. McMasters, Thesis Advisor
_	EM Carrick
_	P. M. Carrick, Second Reader
	Win Nom 1
_	W. R. Greer Jr., Chairman, Department of Administrative Science
_	K.T. Manhell.
	Reale T. Marchall, Dean of Information and Policy Sciences
	Dean of Information and Policy Sciences

ABSTRACT

This thesis examines the key issues that have caused Repair Turn Around Time (RTAT) of Depot Level Repairables (DLRs) managed by the Ships Parts Control Center (SPCC) overhauled by naval shipyards to be excessive. Many of the DLRs repaired by naval shipyards exceed the Naval Supply System Command's goal of 60 days. Four Navy shipyards were visited to gather RTAT data on DLRs and identify potential improvements in the Designated Overhaul Point (DOP) process that will reduce RTAT. An analysis of the policies and procedures used by SPCC in preparing workload forecast as well as the effects of the forecast on the snipyard repair process was also conducted. Recommendations are made to improve the management of repairables in shipyards through Command support and the use of an Automated Repairables Management Information System (ARMIS). Recommendations are also offered to improve piece part support used in the repair of DLRs.

TABLE OF CONTENTS

I.	INTE	ODUC	CTIO	N -	•	•	-	•	-	•	•	•	•	•	•	•	-	•	•	•	•	-	10
	A.	BACE	KGRO	UND	•		•	-	-	•		•	•	-	•	•	•	•	•	•	-	•	10
	B.	овј	ECTI	VES		•	•	•	•	•	•	•	•	•	•	•	•	•	•	•		•	11
	C.	METE	HODO	LOG	Y	•	•	•	•	•	•	•	•	•	•	•	•	•	•	-	-	•	11
	D.	CHAI	T ER	οu	TL	L N	E	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	12
II.	THE	REP	AIRA	BLE	s	Y	CLE	:		•	•	•	•	•	•	•	•	•	•	•	•	•	13
	A.	BACE	K GRO	םאט	•	-	•	•	•	•	•	-	•	-	•	•	•	•	•	•	•	•	13
	B.	DET	ERMI	NIN	G	RE:	PAI	R	RI	EQU	I	REM	EN	TS	5	AT	SI	?C(3	•	•	-	17
	C.	SHI	PYAR	D R	EPI	1	RAB	LI	ES	CY	(C)	LE	•	•	-	•	•	-	-	-	-	•	21
	D.	MAJO) F S	HI P	Y AF	R D	FU	NC	T	CON	is	•	•	•	•	•	•	•	-	•	•	•	27
		1.	Pro	duc	ti	ас	Co	nt	E	1		•	•	•	•	•	-	-	•	•	•	•	27
		2.	Fun	ds	Ada	i	nis	tr	at	ic	n	•	•	•	•	•		•	•	•	•	•	27
		3.	Pla	nni	ng	a	nd	E	sti	Lma	ıt:	ing	i	•	•	•	•	•	•	•	-	•	28
		4.	Sch	edu	li	ıg	•	•	•	•	•	•	•	•	•	-	•	-	•	•	•	•	29
		5.	Ind	uct	io	1	•	•	•		•	•	•	•	•	•	•	•	•	-	•	-	30
		6.	Rep	air	Iı	a :	Pro	C	es s	3	•	•	-	-	•		•	•	•	•	•	•	32
	E.	DOF	REP	ORT	ING	;	REQ	נט	ERI	EM E	en s	rs.		•	-		•		•	•		•	34
	F.	RTA	r pe	RFO	RM	N	CE	•	•	•	•	•	•		•	•		•		-	•	•	36
	G.	SUM	ARY	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	-	38
III.	ANA I	YSI	S OF	ТН	E	RΕ	PAI	R	ABI	LES	5 (CYC	LE	3	•	•			•	•	•	•	39
	A.	GENI	ERAL	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	39
	В•	INS	TITU	TIO	N A I		ISS	UI	S	•	•	-	•	•	•	•	•	•	-	•	•	•	41
		1.	RTA	T.	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	41
		2.	Wor	klo	ad	В	ack	10	og	•	•	•	•	•	•	•	•	•	•	•	•	•	42
	C.	DOP	ORG	ANI	ZAT	CI	ON	-	•	•	•	-	•	•	•	•	•	-	•	•	•	•	45
		1.	Gen	era	1	•	•	•	•	•	•	•	•	•	•	•	•	•	•	-	•	-	45
		2.	Pro	pos	ed	0:	rga	ni	Za	ıti	.01	n		-	•	•		•	•	•	•	•	46
	_																						

	E.	A D M	INI	ST	RAT	IVI	TI 3	ME	•	•	•	•		•	•	•	•	•	•	•	64				
		1.	Do	cui	nen	tai	ion	Ti	.me	•	•	•		•	•	•	•	•	•	•	64				
		2.	In	duc	cti	.on	Tim	e.	-	•	•	•		•	•	•	•	•	•	•	65				
		3.	In	d uc	cti	.on	Pro	ces	s	•	•	•		•	-	•	•	•	•	•	67				
	F.	PIE TIM					POR	T A	ND.	R F	PA •	IR	-IN	I-PI	300	ES	ss •	•	•	•	69				
		1.	Me	ası	uri	.ng	RIP	T.	•	•	•	•			•	•	•	•	•	•	69				
		2.	Pi	.ec	e P	art	s		•	•	•	•		•	•	•	•	•	•	•	70				
	G.	PRE	SER	VA:	ric	N,	PAC	KAG	I N	G A	ND	S	TOE	AG:	Ε	•	•	•	•	•	82				
	н.	AUT (AR) R	EP	AIR A	BLE		MA N					YSI •	EM	•	•		•	83				
	I.	SUM	MAR	X	•				•			•		•	•	•	•	•	•	•	88				
IV.	MKUZ	ARY	, C	ONO	CLU	SIC	NS	AND	RI	ECO	MM	EN:	DA 1	IO	N S	•	•		•	•	89				
	A.	SUM	MAR	¥	•					•					•	•	-	•	•	-	89				
	В.	CON	CLU	SI	ONS	A	iD R	ECC	OM M I	EN D	AT	ΙO	NS								90				
		1.					onal									•					90				
		2.	DO	P	ORG	AN :	IZAT	ION			•								•	•	92				
		3.					ore									_	•	•	_		92				
		4 -					TIV			-		_		_	_	_	_	_	_		93				
		5.				_	Tim	_			-	_	_		•	_	_	_	•	_	94				
		ő.					s a												•	•	•				
			(R	IP:	Γ)	•	• •	• •	•	•	•	•	• •	•	•	•	•	•	•	_	94				
		7.	Pr	ese	er v	ati	on,	Pa	cka	agi	.ng	a	nd	St	ora	ge	9	•	•	•	96				
A PP END I	x A:	S	PCC	: WC	ORK	LOZ	D F	ORM	ıs	•	•	•		•	•	•	•	•	•	•	97				
APPENDI	х в:	R	RC	FU	NCT	IOI	NAL	FLO) W	CHA	RT	s		•	•	•	•	•	•	1	02				
A PP ENDI	X C:	L	ONG	В	EAC	: н	ISY	MRP	S 5	ST	EM	D	ESC	RI	PTI	ON	ī	•	•	1	06				
APPENDI	X D:	L	OCA	L S	1 R	FU	CTI	ONA	LI	DE S	CR	ΙP	TIC	N	•	•	•	•	•	1	19				
APP ENDI	X E:	F	U NC	TIC	O N A	LI	ESC	RIF	TI	ИС	OF	A	RM.	S	•	•	•	-	-	1	24	-		1	_
APP ENDI	X F:	S	AMP	LE	AR	MIS	S RE	POR	TS	A N	D	FO	RM S	5 .	•	•	•	•	•	1	28	4		<u>y</u>	
A PP E ND I	X G:		R MI S I I				ARE	AND	TI	·	NI •	NG •	c c	ST	•	•	•	•	•	1	33	1	·	ō —	
LIST OF	REF	ERE	NCE	S	•	•	•		•	•	•	•		•	•	•	•	•	•	1	35				٠.

Availability Codes

Avail and/or Spucial

Dist

INITIAL DISTRIBUTION LIST	1.	3	ľ		7
---------------------------	----	---	---	--	---

PARTICULAR DESCRIPTION OF THE PROPERTY DESCRIPTION OF THE PROPERTY OF THE PROP

LIST OF TABLES

I	7H WORKLOAD BACKLOG IN UNITS 43
II	HISTORY OF RTAT BY COG. FOR NSY LONG BEACH 54
III	REPAIR TURN AROUND TIME 55
IA	DOP ADMINISTRATIVE TIMES 66
V	NON-AUICMATED DOP REPAIR IN PROCESS TIME 70
V T	AUTOMATED DOP REPAIR IN PROCESS TIME

TANGESTAND MANAGESTAND CONTRACTOR OF THE STANDARD MANAGESTAND CONTRACTOR OF THE STANDARD CONTRACTOR OF

LIST OF FIGURES

2.1	Non-Aviation Component Repair Process	•	•	16
2.2	Flowchart of SPCC's Workload Forecasting Model	•	-	20
2.3	B08 Cyclic Process	•	•	22
2.4	Processing High Priority Repair Requirements .	•	-	23
2.5	Processing Interim Repair Request	•	•	24
2.6	Automated Customer Order Acceptance Record	•	-	26
2.7	Sample Log Sheet	•	-	29
2.8	Sample Work Estimate Sheet	•	•	31
2.9	Sample Work Control Document	•	-	33
2.10	Depot RTAT Segments	•	-	37
3.1	SPCC Backlog Computations Sample	•	•	44
3.2	NAVSEA approved Repairables Management Office .	•	-	48
3.3	Long Beach NSY RMO and RRC Organization	•	•	49
3.4	Electronic / Electrical RRC	•	•	51
3.5	Mechanical RRC	•	•	52
3.6	Shop Marning Requirements Sample Report	•	-	56
3.7	Consolidated Stock Status Report	•	•	62
3.8	SPCC Repair Workload Forecast	•	-	63
3.9	Elements of Administrative Time	•	•	65
3.10	DOP Requisition Process	•	-	7 9
3.11	DOP Receipt Process	•	-	80
3.12	Requisition and Receipt Times	•	-	81
3.13	RMO, RRC, CODS and SYMIS Interface		•	86

ACKNOW LEDGEMENTS

To Mr. Dave Greemore, NAVSEA 0715, whose financial backing and support made this thesis possible.

To the shipyard Production Controllers for their candid comments which provided the basis for much of this thesis and to Mr. Carolis Crespo and Mr. Mike Beliveau of SPCC for their assistance in explaining the workload forecasting process.

A special thanks to Mr. Ed Lovelace, RRC supervisor (retired), for his technical assistance and advice.

Finally, to my wife Joan, for her support and assistance.

I. INTRODUCTION

A. BACKGROUND

This thesis will examine each step in the organic depot (naval shipyard) repair cycle to determine if the repair turn around time (RTAT) of Depot Level Repairables (DLRs) managed by the Navy's Ships Parts Control Center (SPCC) can be reduced.

RTAT as used in this thesis refers to the period of time from receipt of a funding document from SPCC to the time the depot level repairable is returned to the supporting stock point in "A" condition. Although the current 90 day RTAT standard set forth by the Chief of Naval Material (CNM) in the Navy Repairables Management Manual is possible, most Navy shipyards (NSYs) are not organized to support this time frame. With increasing procurement lead times for many of the DLRs repaired by these DOPs it is imperative the Navy wanage repair of scarce DLRs more effectively. In general, if the RTAT can be reduced from 90 to 60 days it will have the same effect as increasing DLR assets in the repair pipe line by 33 percent.

During the early 1980's the Naval Audit Service reviewed the repairables programs of several naval shipyards. The following excerpts highlight some of the problems that have historically caused RTAT at naval shipyards to be excessive.

- NAVSHIPYD does not have a Repairables Management organization with central authority and responsibility. [Ref. 1: p. 1].
- 2 Fixed priced agreements with repairables program customers are not entered into the maximum extent practical. [Ref. 1: p. 6].
- 3 NAVSHIPYD does not provide as intensive support to the repair of items as contemplated by governing directives. Its production shops are dedicated to overhaul and repair of ships on the waterfront, and repairables work is accepted only as shop schedules permit. [Ref. 2: p. 1].

- 4 NAVSHIPYD does not accomplish the repair of items in accordance with repair program manager assigned completion dates or priorities. [Ref. 2: p. 1].
- 5 NAVSHIPYD provides erroneous data in its 2F/2S Cognizance and Secondary Item Repair Program Reports to repair program managers. [Ref. 2: p. 25].

B. OBJECTIVES

The objectives of this research effort are to:

- Describe the policies and procedures used by SPCC to workload DLRs at organic Designated Overhaul Points (DOPs).
- 2. Examine the effects of workloading on the policies and procedures used at naval shipyards to repair DLRs.
- 3. Describe the repair cycle currently in use at naval shipyards.
- 4. Examine each segment of the DOP repair cycle to identify possible alternatives to current policies and procedures at both SPCC and naval shipyards for reducing repair turn around time.

C. METHODOLOGY

literature search revealed The initial many Navy Instructions and Defense Logistics Studies Information Exchange (DLSIE) reports and studies that stressed the need for the Navy to more effectively manage depot level repaira-However, these studies did not address the specific issue of how to reduce repair turn around time at As a consequence, recent Naval Postgraduate shipyards. School theses covering DLRs were reviewed to gain a more complete understanding of the repairables cycle and identify possible ways of reducing RTAT.

Performance information was collected by visiting four naval shippards: NAVSHIPYD Long Beach, Mare Island, Norfolk and Charleston. A visit to SPCC was also made to gather information concerning the policies and procedures used by SPCC in workloading.

D. CHAPTER OUTLINE

Chapter II presents a description of the repair policies and procedures employed by SPCC and naval shippards in the repair cycle. A detailed explanation of each segment of the DOP repair process is given to provide the reader with an understanding of the complexities involved, beginning with the establishment of a job to make repairs and ending with the return of a completed repaired carcass to the supply system in a ready for issue (RFI) condition. Chapter III identifies problems that have contributed to excessive RTAT at naval shippards and explores possible alternatives to current practices used to workload and repair DLRs. Chapter IV is an executive summary of the problems and offers conclusions and recommendations based on the analyses of Chapter III.

II. THE REPAIRABLES CYCLE

A. BACKGROUND

A CONTRACTOR OF STATE OF STATE

The increasing complexity of weapons systems has caused the supply system to reevaluate the maintenance and stocking philosophy of wholesale systems assets. The life cycle cost of weapons systems has also increased. Many of these cost are directly related to maintaining assets which are repai-An item is designated as a repairable if it is more cost effective to repair it than to procure a replacement. repairing a DLR component has been accom-Historically. plished at one fourth the cost of a new item and third the procurement lead time [Ref. 3:p. IX-5]. policy is to repair if the repair cost does not exceed seventy five percent of the current purchase price. increased cost associated with the maintenance and repair of DLRs has dictated increased attention to management of repairable components. As a result, SPCC has transferred most of the previously managed consumable items Defense Logistics Agency (DLA) and has concentrated on the management of DLRs.

During the acquisition process of major weapon system a decision is made concerning the maintenance of each component that makes up the system. These components are classified as either consumeable or repairable. Consumable items will be discarded when they fail or exceed their useful life replacement will be procured. For repairables, a Level of Repair Analysis is made to determine the lowest level authorized to repair or condemn the item. uses a three level maintenance concept. Based on technical and testing requirements of the component, repairables may be repaired at the organizational, intermediate or depot Organizational maintenance involves those actions level.

that can be taken by the operating unit on a day by day basis to keep the item working. Intermediate maintenance is performed by a designated maintenance activity in support of the operating unit. Intermediate maintenance is normally or at shore based repair faciliaccomplished by tenders, These activities have the capability to perform repairs that are beyond that of the operating unit. include such functions as calibration, field changes and replacing parts. Depot maintenance are those repairs necessary to bring a failed or damaged carcass back to original Due to the extensive nature manufacturer's specification. machinery and test equipment the repairs and the involved, naval shipyards have been designated as the depot maintenance activities for many non-aviation DLRs.

When a system is first put into service the original equipment manufacturer (OEM) is normally designated as the interim depot for repair of DLRs. The reasoning behind this philosophy is that it is prudent to defer setting up organic depots when the system is new and subject to design changes and modifications. As the system matures and demand data is accumulated, the Hardware Systems Command (HSC) evaluates it and decides who should be the designated overhaul point (DOP). Assignment of a permanent DOP is a detailed and time consuming process made in accordance with the NAVMAT approved Depot Utilization Plan and NAVMAT Instruction 4000.41 [Ref. 3:p. IV-12]. Concurrently, inventory management responsibility is also assigned. Normally the inventory management function is assigned to NAVSUP Inventory Control Points (ICPs). It is the responsibility of the IM to manage material under their cognizance and have the available to operating forces when and where it may be in the Class Maintenance Plan for needed. As an example, FFG-7 Class Frigates, Long Beach Naval Shipyard was designated as the overhaul depot for approximately 200 hull,

mechanical and electrical DLRs. SPCC was assigned as the IM.

As repair requirements are identified the IM funds the DOP for repair. Until recently the standard time to accomplish repair has been 90 days. Due to funding constraints and increasing procurement lead times, NAVSUP now wants repair turn around time (RTAT) reduced to 60 days [Ref. 4]. If this can be accomplished it will have the same effect as reducing the number of failed carcasses required in the repair pipeline by one third. If RTAT for all DLRs can be reduced to 60 days the Navy may realize savings amounting to more than 180 million dollars, (average daily demand for DLRs is approximately three million dollars) [Ref. 4]. this goal can be obtained, the Navy can not only save a great deal of money but can also improve fleet support and readiness. In order to accomplish this task Naval Systems Command (NAVSEA) and NAVSUP must work together identifying and eliminating wasted or unnecessary time in the repair cycle.

As indicated in Chapter 1, this thesis will look at what NAVSEA and, in particular, naval shipyards can do to achieve a 60 days RTAT. To accomplish this it is first necessary to briefly review the segments of the current repair cycle at both SPCC and naval shipyards in detail. The cycle is defined for this thesis as the time from when a repair requirement is generated by the IM to the completion of repairs by the shipyard and a completed DLR is returned to the Designated Support Point (DSP). A DSP is normally the Naval Supply Center (NSC) nearest the DOP. Figure 2.1 is a flowchart of the non-aviation component repair cycle The numbers in parenthesis are the sequence of [Ref. 3]. events in the repair cycle.

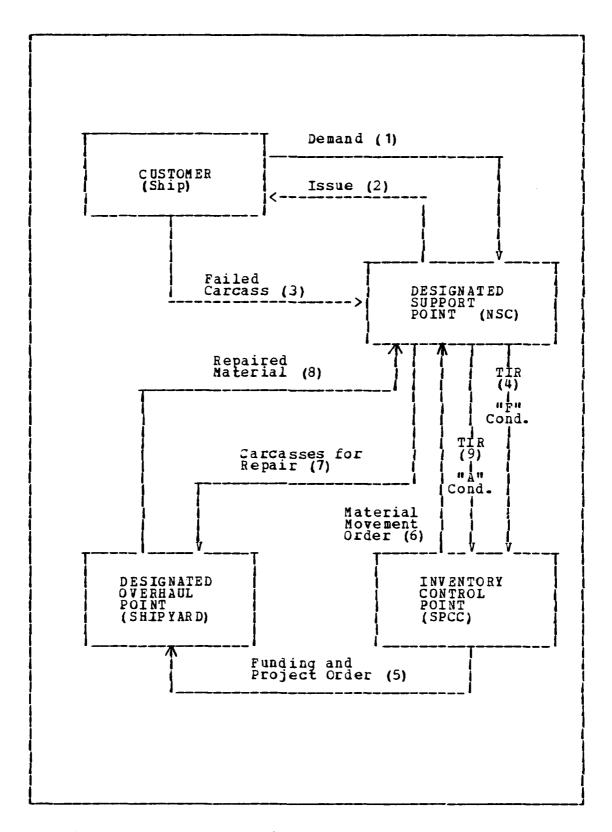


Figure 2.1 Non-Aviation Component Repair Process.

B. DETERMINING REPAIR REQUIREMENTS AT SPCC

When a DLE fails in operation it must be returned to the supply system so it can be scheduled for repair. Each operating unit has a copy of the Master Repairable Item List (MRIL). The MRIL contains a listing of all DLRs, the DOP or DSP as well as turn-in procedures and shipping instructions. The failed DLR is normally sent to the NSC nearest the depot having maintenance responsibility for the item. When the carcass is received at the DSP its location and status, such as ready for issue (RFI) or not ready for issue (NRFI) is reported to the IM via Transaction Item Reporting (TIR). Event 4 in Figure 2.1 is the reporting of the receipt of a failed carcass to the IM. Event 9 is the reporting of the receipt of a completed DLR.

The ICP uses the Uniform Inventory Control Point (UICP) computer system to track and monitor the status of all wholesale system assets. The TIR process is the primary means by which the UICP is updated on actions against any asset. This includes: demands, carcass returns, repair inductions to the DOP, repair regenerations, disposals, and receipts of material from procurement or repairs. TIR also calculates and accumulates procurement and repair times. [Ref. 5]

SPCC uses TIR information in four UICP programs to determine the procurement and repair requirements for DLRs. [Ref. 3: p. VII-2]

- 1. <u>Levels program</u>. Forecasts several key requirements determination elements such as demand, procurement lead time, requisition frequency, and turn around time. Computes wholesale requirements levels such as reorder point, order quantity, and repair level.
- 2. <u>Supply Demand Review (SDR) program</u>. Compares current inventory assets to requirements (set levels) and makes recommendations to purchase, terminate a

- purchase, expedite a purchase, redistribute on-hand assets, or recall material from disposal.
- 3. Cyclic Repairables Management (808) program.

 Compares current inventory assets to the computed repair level to determine repair requirements.
- 4. <u>Stratification program</u>. Compares forecast requirements with forecast asset levels to project future procurement and repair requirements for budget purposes.

SDR's primary function is to compare assets against requirements over the procurement lead time. If requirements exceeds assets, the IM will receive a recommendation to purchase additional units. The Repair Scheduling (BO8) application of UICP compares assets against requirements over the depot turn around time. BO8 also uses the urgency of need levels and fleet requirements to recommend repair and redistribution requirements to the IM. Appendix A contains copies of the forms that must be reviewed by the IM prior to workloading the DOP.

BO8 divides repair requirements into 4 levels to be used by the DOP to schedule repair work. Repair requirements fall into the following four categories based on urgency of need: [Ref. 3]

- 1. <u>Level one</u>. High priority backorders and approved special projects.
- 2. <u>Level two</u>. Other end-use backorders and planned program requirements of a continuing nature.
- 3. <u>Level three</u>. Backorders for stock and funded planned program requirements due within average depot turn around time.
- 4. <u>Level four</u>. Wholesale system safety levels. Economic repair quantity.

In addition to the urgency of need, the IM must also consider budget constraints when forecasting repair

The UICP Stratification program uses basic quantities. supply data on each item of inventory to calculate the funds required to support the wholesale inventory. The program considers cost of repair, repair turn around time, assets available, and demand. Based on this information program calculates expected deficiencies and simulates expected procurement and repair requirements for budget Once the money has been appropriated, preparations. stratification program is rerun to decide what procurements and repairs can be done within the approved budget. at this time that the first workload conferences convened for a given fiscal year.

Semiannually, workload conferences are held to determine and negotiate workload for each organic DOP. Figure 2.2 is a flowchart of the procedures used by SPCC in workload forecasting of quarterly requirements. [Ref. 6]. attendees at this conferences are program managers for Depot Maintenance, NAVSEA and NAVELEX inventory and maintenance managers, NAVSUP repairables management personnel, SPCC item managers, Fleet Intensified Repairabled Management (FIRM) personnel, NSC personnel and depot personnel from each shipyard [Ref. 3]. Conferences are conducted 75 days prior to the beginning of the workload period. At the conferences, which last one week, representatives of each shipyard and item managers negotiate workload for the upcoming two quar-Based on capability and capacity, shipyards accept or reject workload requirements. After the conference SPCC prepares quarterly funding documents and repair schedules that will make funds and carcasses available at the beginning of the quarter the work is to be performed.

SPCC uses three types of repair schedules: Cyclic Repair Requirements or "S" schedules, Interim Repair Requirements or "R" schedules and Projected Repair Requirements or "P" schedules. "S" schedules are generated bi-weekly or monthly

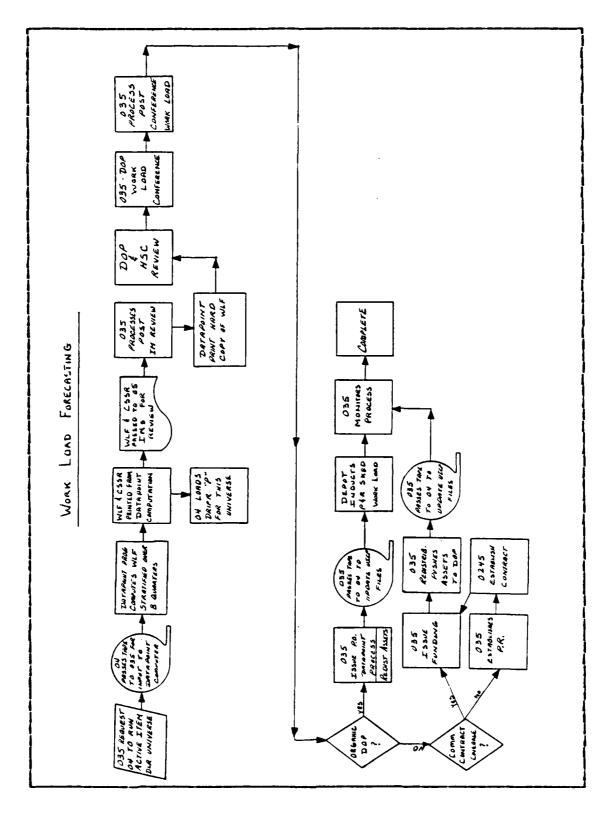


Figure 2.2 Flowchart of SPCC's Workload Forecasting Hodel.

and authorize repairs for low volume items by the DOPs. "R" schedules are for end-use high priority emergency requirements. "P" schedules are generally composed of those items that are scheduled during the workload conferences for planned requirements.

Funds for "P" schedules are open to obligation for 120 days. This is to allow the shippard to program for DLRs not available at the DSP at the beginning of the quarter but expected to materialize before the end of the quarter. If the carcass is not made available during the quarter the DOP requests that the IM cancel (BSR) the repair requirement and returns the funds if the cancellation is approved.

Project orders are also issued for "S" and "R" schedules to cover any emergent requirements that may occur during the Figures 2.3, 2.4 and 2.5 are flowcharts of the quarter. details of SPCC's B08 cyclic process, processing high priority repair and interim repair requests. Developing a workload must be coordinated between three departments at The Planning and Data Systems Group (Code 04) manages and maintains the UICP computer programs and files. Repairables Support Department (Code 035) repairable program and prepares and issues the funding documents to the DOPs. The IMs are assigned to the Weapons Support Group (Code 05). High priority and interim repair request are initiated by the individual IMs. [Ref. 6]

C. SHIPYARD REPAIRABLES CYCLE

The Shipyard Management Information System (SYMIS) is designed to support the repair and overhaul of ships. It is not designed to manage a repairables program. Although SYMIS is not programmed to provide management information on a repairables program, it does contain all of the data related to the program (ie. cost, job orders, and piece parts requirements). The CNM Repairables Management Manual points out that:

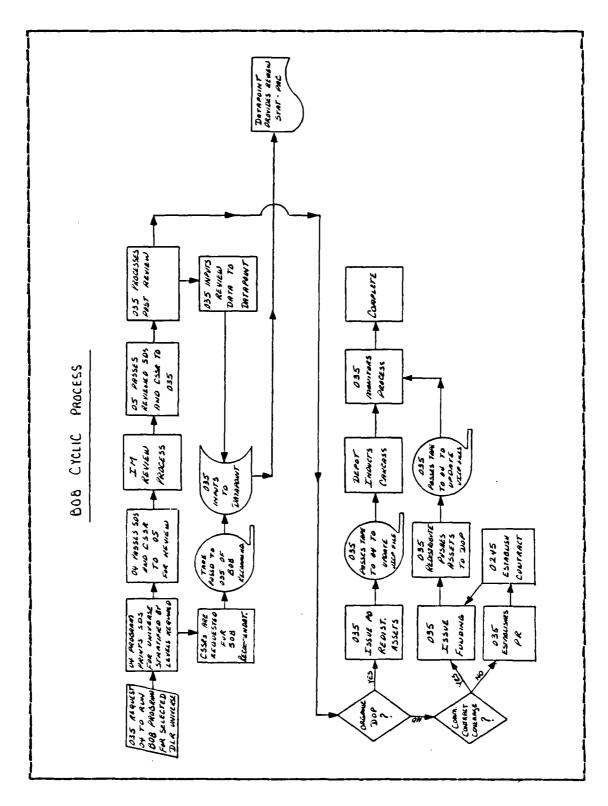


Figure 2.3 B08 Cyclic Process.

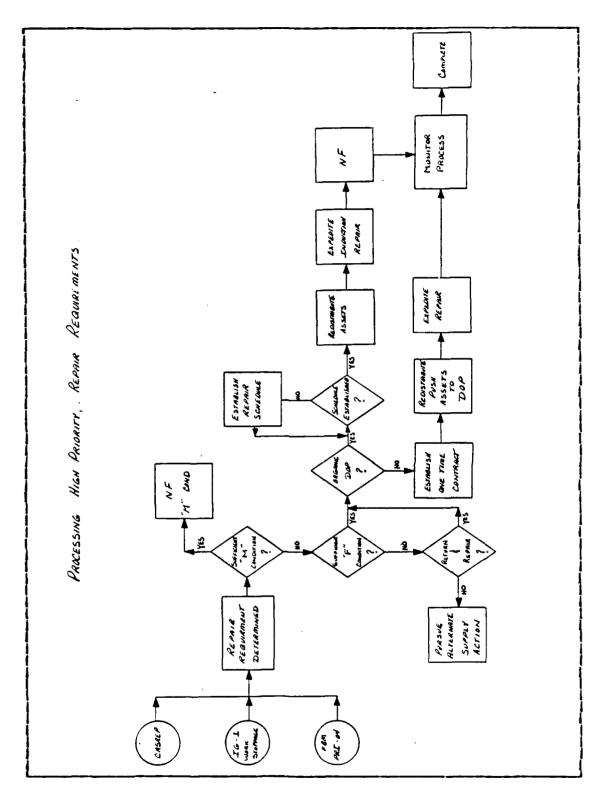


Figure 2.4 Processing High Priority Repair Requirements.

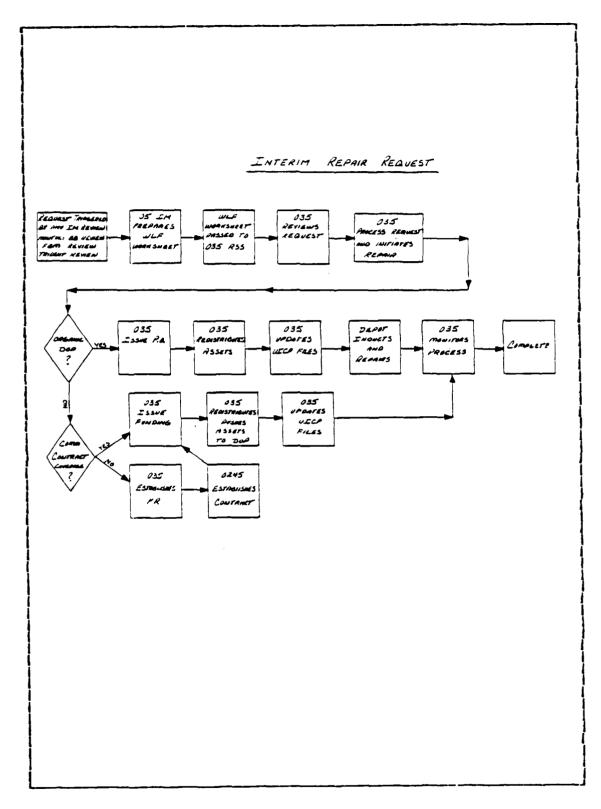


Figure 2.5 Processing Interim Repair Request.

Changes are therefore necessary to improve the standard SYMIS and provide a greater capability for managing repairables programs within the shipyard. [Ref. 3: p. XI-16]

Most snipyards process repairables information manually. However, Long Beach Naval Shipyard has developed and implemented an Automated Repairables Management Information System (ARMIS)¹ ARMIS is a relational data based computer system used in conjunction with SYMIS to provide management information, scheduling and automatically prepare many of the forms and reports that were formerly done manually.

Other initiatives that have improved repairables management include the Customer Order Documentation System (CODS) which permits electronic transfer of funds and has automatically prepares the Customer Order Acceptance Record (COAR). A COAR is basically the contract whereby the shipyard agrees to repair a component(s) for a particular price. It contains basic information about the repairs, source of funds, amount, what is to be repaired and quantity. Figure 2.6 is a copy of a COAR generated by CODS.

The recent implementation of a Material Management (MM) function of SYMIS has increased visibility and control of shippard inventory receipt and processing. This system tracks the status of all material ordered to support repairs on both ships and DLRs. The Material Requirements (MR) portion has been modified to maintain a nistory of all material used to repair a specific DLR.

The Fleet Material Support Office (FMSO) has recently developed a program, (UR22), for automating the repair induction process. To date, the UR22 program has been incorporated in the Stock Point Uniform Automated Data

Detailed information on AEMIS is contained in Chapter III.

NR TITLE: REFIT SPCC Vision No: 881 ITEM NO: 288	Coar 54 BSS NO: NUPNJ:	
HULL I HULL I FND I CHR		L I START I COMP P I DATE I DATE
FUNDS ORD REC! STA AUTHORIZED TYP LAI 3.529.98 R3 3	SOR I HATL I YR !	
	UEHD 08J ALLO 	RDER I ALL I
AAA TT PAA 30134 7T 30300	I GOOD TROD I	UIC EXP. DATE 38184 693805
JOB ITEM ORDER IDENT 64JMH77H66 6633019451572		HOMENCLATURE TROUIT CARD ASY.
UBSC HSSC FYUC UPC UNITS		ANCE CLOSURE RECEIVED
L11 999 2 I 3	4.677117774 4.686.686	S ZIP CODE
SPCC	MECHANICSBURG P	
APPENDIX A OF NAUCOMPT MANUAL, THE COAR, WHEN APPROVED. A DELI AUTHORITY TO ADMINISTER FUNDS; OF HIS RESPONSIBILITY AS FUNDS;	ECATION OF AND IS AWARE	REMARKS:
FUNDS ADMINISTRATOR SIGNATURE	-	
EXPENDITURE OF FUNDS REQUESTED CUSTONER ORDER IS APPROVED	CHARGEABLE TO ABOVE	
BUDGET STATISTICS SIGNATURE G.L. GAMRISON	DATE 191294	
	TO BE FILLED OUT BY ORIGINATING DEPT. THIS IS TO CERTIFY CUSTOMER ORDER MAY	1
DEPT. PERFORMING WORK THIS IS TO CERTIFY ALL WORK IS COMPLETE.	BE CLOSED.	
DEPT. PERFORMING WORK THIS IS TO CERTIFY ALL WORK IS COMPLETE.		1

Figure 2.6 Automated Customer Order Acceptance Record.

Processing System (UADPS-SP) at one DSP. This program allows the DOP to make inductions using a terminal located at the shipyard. [Ref. 7]

D. MAJOR SHIPYARD FUNCTIONS

The repair of DLRs within the shipyard is composed of six major functions. These are Production Controller (PC), Funds Administration Planning and Estimating (P&E), Scheduling, Induction, and Actual Repair.

1. Production Control

At the beginning of each quarter SPCC prepares the funding document and repair schedule. This is normally put in the mail and sent to the production controller at the shipyard. For emergency requirements naval messages are used. Upon receipt of the funding document, the PC will verify the quantity authorized for repair and ensure the funds match the repair quantity. He also verifies that the shipyard has the capability and capacity to repair the item. Any discrepancies are usually resolved by telephone with the item manager.

2. Funds Administration

The funding document and repair schedules are then sent to the comptroller where a Customer Order Acceptance Record (COAR) will be established in SYMIS. This allows repair costs to be charged against the right job when the Normally one CCAR is established per actual repair starts. funding document even though it may contain a hundred or more different line items. This practice also allows the financial administrator (normally the PC) to shift funds between line items. When one line item's repair exceeds the quoted repair price, funds from another item that is under cost can be used to cover the item that is over cost.

When the COAR has been established in SYMIS the PC can then prepare the log sheet and work estimate sheets

(WES). Figures 2.7 and 2.8 are samples of a log sheet and work estimate sheet. Log sheets are used as a management tool by the PC to keep pertinent data of the line item on each project order including NSN, BSS number, nomenclature, job order number, authorized quantity, repair costs, estimated repair hours, date job was issued and date completed. It should be noted that log sheets are not common to all shipyards. In addition, only ARMIS can automatically generate a log sheet.

Methods of retaining information on what is being repaired on each funding document vary between shippards and production controllers within shippards. WESS are internal planning department sheets which contain pertinent information of what will be repaired. WES sheets are used by P&E to write job orders. One WES must be prepared for each line item on the project order. Usually, WES sheets are prepared manually by the PC, only ARMIS has automated the preparation of WES.

3. Planning and Estimating

P&E will prepare a work control document (WDC) for each WES. The work control document is a detailed outline of what work must be accomplished and hours authorized for each shop and work centers. The WCD also contains any technical documentation applicable to the repairs. Figure 2.9 is a sample WCD.

For items which have a repair history P&E personnel have generated standard Job Material Lists (JMLs). JMLs are in-nouse requisitions sent to the supply department for known piece part requirements.

Some shipyards use Wang computers to maintain a list of piece parts required to repair DLRs. The Wang computers are also used to process requisitions for piece parts into the SYMIS. However, if P&E is unfamiliar with the line item he must research what piece parts are required and hand prepare JMLs.

19 日本の日本の日本の日本の日本の日本の日本の日本の日本の日本の日本の日本の日本の日	HIST	101.01			Jim Orden 19538.	KLY (4.	antatatatata DAIL	1. 10 E A A A A A A A A A A A A A A A A A A
FIEN MSH PESS NO.	> 5	REPAIR CUBI	JOR CROER EST.	E81.	GIY REPAIR JOR CROER EST. EST,	Y DATE U	CHED 620	
			GGOKL77766 LV	報表 受 な 基 本 な 本 な 本 な 本 な 本 な 本 な 本 な 本 な な な な	/ YSV PE /	8118	Yay)	
3912 BRC-16 SUITCH CONTROL 2 030 66EAH77666 16 830 2 14 7755 2 720 770/3		# # # # # # # # # # # # # # # # # # #	**************************************	**************************************	7 1/1/2 7	1/20 1/2	30/5	
3803 05511LATOR 1 978 660XH77G66 22 970 1/5/2 00 0986897	-	# # *	668XM77G66		1.21 118	3 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8		*
3004 AC/DE HETER CALIB 6623 00 1072878 HWPM35-5101-9452	在是高泉 医医院 医医院 医皮肤	本ののの	PP P P P P P P P P P P P P P P P P P P		1 1955 66DXH77G66 44 1855 4.9 7/5/5 7/9/9/11/11/11/11/11/11/11/11/11/11/11/11	3/ 5/6//	125/	# # # # # # # # # # # # # # # # # # #

Figure 2.7 Sample Log Sheet.

4. Scheduling

After the WCD and associated JMLs have been prepared P&E forwards the WCD to scheduling. Scheduling reviews the current workload for the affected shops and schedules the repair of the carcass. The WCD is then sent to local printing for reproduction and distribution. Copies of the WCD are also sent to keypunch to be input into SYMIS. the WCD information has been entered into SYMIS the job is open to repair charges by the authorized shops. The WCD is passed to the applicable shop planners who monitor the actual repair process. The shop planner establishes key operation for each job order in SYMIS. Key operation are those activities that must take place to repair the Examples of key operations are open and inspects, repair and test. The shop planner authorizes the number of hours for each work center to complete each key operation. When this information has been put into SYMIS the shop can induct up to the authorized quantity and commence repair.

5. Induction

To induct a carcass, most shippards prepare a JML which is forwarded to the DSP holding the failed carcass. In the future, they will use the automated induction program developed by FMSO . The UR22 program gives the (UR 22) person making the induction visibility of all "F" condition2 assets at the DSP and automatically generates an induction notice via CRT input at the DOP. The carcass is then shipped directly to the applicable repair shop in the ship-This program also generates ZUC and ZUB cards. ZUC functions as a proof of receipt by the shipyard and is signed when the material is received. Once signed, the card is retained by the DSP. The ZUB card remains with the

^{2&}quot;F" condition code refers to a failed DLR that has been returned to the DSP for repairs.

WORK ESTIMATE SHEET - JOB OR	JOB ORDER: 67CHK27H66 CREATED ON: 13-NOV-85
REFIT: SPCC	JOB TITLE: 7H-5985-00-333-2534
PLANNER: 224.12 ENGLISH	JOB LEAD SHOP: 662
FUNDING DOCUMENT: NO0104-86-WR05028	-WR05028 ITEM HO: 3004
BSS NO: NWRN35-5303-9530 NC	NOMENCLATURE: WAYEGUIDE HORN
теси маниас,	PART NO: BR716604 APL: EP7467350 GS16659 1448540
UNITS AUTHORIZED TO REFITA	I NSN:-5985-00-3332534
+++++++++++++++++++++++++ ES	ESTIMATE DATA ++++++++++++++++++++++++++++++++++
TOTAL MAN/HOURS ALLOWED: 16	
SHIPS 66 71	

Figure 2.8 Sample Work Estimate Sheet.

carcass and is returned to the DSP when repairs have been completed. [Ref. 8]

Several shipyards have prepared local induction sheets that are passed to the DSP to induct carcasses. The stock point then pulls the carcass and forwards it to the DOP. At this point the DSP reports the change in condition code from "F" to "M" via TIR to the ICP. The signed ZUC card is used for TIR. "M" condition means the carcass is in repair.

6. Repair In Process

When the shop receives the carcass it is inspected to determine if it can be repaired. This is only a cursory inspection to see if all major components are present. the carcass can not be repaired economically the item is removed from "M" condition and placed in "H" condition (disposal) and returned to the DSP and another carcass is inducted. If the disposal action is approved by the IM or on site SPCC representative, the usable portions of the carcass are cannibalized and retained by the shipyard for use in later repairs. For carcass with missing subassemblies a Defective Material Report (DMR) is prepared and If the turn-in activity is known, the forwarded to the IM. IM will request the missing parts be sent to the shipyard or the turn-in activity will be charged the price of a new replacement for the failed carcass vice only the regain price.

During the repair process the mechanic may identify additional repair parts. If the lead time on these parts are expected to exceed 30 days the item should be placed in "G" condition (awaiting parts). By placing a carcass in "G" condition the IM is notified via TIR that repairs have stopped due to a lack of repair parts. The DOP is required to list the required parts and associated requisition numbers on the monthly refit reports. To accomplish this

	102	224	72	E 2		4	1	1	1	4	4	1	4	1	1	4	1	1	\downarrow	_	\sqcup	in	
23	11716	r	404	MILON			ļ				350											mi.	#
		224.12					1	1	1		3		र्य		1	7	1	4	1	1	7	2	廿
404 645 160	ર	224		10047 111	11140480 106			1	3		वै	3775	KE	PROPER	1	न्	1	REPAIR	1	1			
8	: 7,0	7	107	40.0			}	}	44	1	273	1	577	660	KK	2000	1	RE	1	1	1 -	3	177
	1166		7000 60	COMPLETE VIENDO	25	1	1	46.	777		P. RK	7	ame	À	A	d	165,	78				177	2
E	7 7	0056		370	501			46	1 46		PE	Su.	ACC	77753	1	7	ZZW	77 707	H 5B			77	99 133 136 228 244,1 578,3
" MISSION ESSENTIAL / VITAL SYSTEM	REPAIR (1) AN/URO-4 DIRECTION	i o		STARE Verido	41.210501.25	SHALL	3	(C) MIL- SPEC 464 F	(D) LANS INST 4865. 2 MACKET		REE (A) L'A) DER RKE (C) (DXE)	OPEN, INSPECT, ORDER MATERIAL, CLEAN DENEW ALL SUB	LOGED PARTS, WIRING AND HARDWAKE, ACCOMPLISHELC	9 APPLICABLE, ALKEN AND TEST TO ASSURE	OPERATION, UNITS SHOULD PERFORM AS IE THEY	WAKE NEW, PROVIDE A WRITTEN REPORT TO	MOTING: MIX OF EQUIPMENT, SHORTAGES,	ECONOMICAL	TO N.S.C. LBEACH			44 1035	2 2
AL.	anla	1			77	8	PECTI	7117	7.		2) 3.	166	246	I	H V	4	H	DE	9			1	4 11 12 12 12 12 12 12 12 12 12 12 12 12
5	\odot	m	MATERIAL ALCORANCE (55) &	P K			N INS	9	9	0	1	7/7	KARI	332	330	ER	MEA	XON	570				
<u> </u>	11. P. J. 1.7		A L On A	1.0 išur			ADY PC	ļ	5	107-	4 4	25.00	9	9	9	177	ane	BE	10		3	*	
	REP	240	M 168/AL	K O		ļ	EN	7/2	1939	801-	780	lare	8	4	777	WK	6 60	2/2	2	8			3 3
SEP		603	_				ES VE	17-80	4224	276	AN	7 4	RING	2/10	345	A	ģ	ITE	141	2		134	1
Z E		85 P/603040		ITEM OR KEY OP SYNDPMS		66-11.	DESIGNATED OA WORK CENTERS WHEN READY FOR INSPECTION.	(A) N/SWA SR25-00-078-4017	B) 5/4 4 MW P N35-4274 9393	(5) TARK MANUAL 0967-108-6010	REPAIR (1) EN PIN: AN URD 4A	801	74		Y	1106	M	MISSING PARTS, AND ITEMS BEYOND	URAL REPAIRED WAITS	ANNEX ON REF (A) & (B)		17	2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2
		i oʻ	1	A 7 2 4		77	WORK	25-0	PW	MA	6.4	0		186	1111	PRO	197	4	Suk.	REE		5553	
Ę\$	7	إلا	MA IFRIAL ALL DRAME (EXCEPT SHOP STORES) &	11EM OR	١	s/uc	yb az	15.1	477	3		PEC	9	KIC	8	3	7.40	ARI	REE	3			
2	MECH		ERCEPT >	HE KEY OP TITLE (18 Character)	(1) DEPAIR	OF SHOPS/WC	ICHAT	73/7	4/2	Tar		37	980	900	740	2/4	ala	19	3	X		10/2/84	2 2
1073	v	77	PARCE	INC	00					3	Paul	3	079	8	CKA	KK	7	7753	TUR	14/4			= >
(AEV.	Spec	97922 d	14 416	KEY OF	3	POKENCEN	NOTIFY	REF			26	96	STAA	95	90	10/10	224	780	PETA	4		7	=
10CUat 11/1600	-			3	3						1077									\perp] 3	3
MDRE COMINGE DOCUMENT MITE 8-4831/1000 (REV, 4-79	REFI	26.5	8 3	1	3	_		_												+	+	EN64.15H	3
Ž.	REF	12	3	Ęa	430																	V	ROUTING

Figure 2.9 Sample Work Control Document.

the shipyard will notify the DSP to place the carcass in "G" condition. While in "G" condition the RTAT is interrupted and the carcass put in custody storage. Custody storage may or may not be at the DSP depending on the complexity of the equipment as well as local agreements made between the DOP and DSP. When the parts arrive at the shipyard, the carcass is returned to "M" condition and rescheduled for repair.

When the repair has been completed the DLR is returned to the DSP and reported in "A" condition via TIR (ZUB card). The shipyard attaches a documentation tag to each completed DLR identifying the DOP, the mechanic who repaired the item and the date repairs were completed. This tag remains with the item until it is placed in service by the end user. Preservation of the DLR is accomplished by the DOP prior to returning the DLR to the DSP. With very few exceptions the DSP will package the DLR. Most shipyards provide separate funding to the DSP for this service. Before the DLR can be issued it must be stowed at the DSP and its location reported via a ZUD transaction. This TIR notifies the IM the DLR is in RFI condition.

E. DOP REPORTING REQUIREMENTS.

In addition to the information reported to the ICP concerning RTAT, the DOP is required to submit monthly refit status reports containing the following information.

[Ref. 3: p. XII-4.5].

- Repairable Surveys: The number of units beyond economic repair. This is entered in SPCC's Repair History File and is used in computing wearout and survival rates. Intermediate Maintenance Activities (IMA) surveys obtained from the 3M system are not included in the computation of survival rate at the depot, but are an additional element in the computation of the wearcut rate. Items condemned or surveyed by the DOP will be transferred from "M" to "H" condition and expended from "H". Expenditures from "H" will be used to compute wearout and survival rates.
- 2 Repair Completions: The number of units that were completely repaired during the time period, by NSN and by DOP (transfers from "M" to "A" condition). This information is entered in the Repair History File.

- 3 <u>DOP NIF Rates</u>: Navy Industrial Fund rates for the cost-per-hour work performed by a DOP. These are stabilized rates and normally do not change during the fiscal year.
- 4 <u>DOP Workload Standard (NORM)</u>: Organic DOP repair time plus administrative time required to complete repair of an item. This information is maintained by the DOP and used in conjunction with the applicable NIF rate to determine the DOP repair price.
- 5 <u>DOP Capability Code</u>: This code reflects current, actual repair capability or noncapability at a specific DOP and provides noncapability by reason. It is used in the BC8 probe and MRIL assignments.
- 6 <u>DOP prime shop</u>: The DOP prime shop area for each specific component is listed.
- 7 Type Repair Directive Code: The type of repair directive is identified: NWS = Scheduled BO8 requirement; NWP = Projected or workload requirement; NWR = Interim requirement.
- 8 <u>Bill Of Essential Support Parts:</u> Repair part requirements (by NSN) are identified for all repairables for which that repair facility is the assigned DOP. The probability factor (expressed as a percentage) that particular repair part will be required in the repair of a single unit of the repairable is also listed.
- 9 Repair Price: These prices are computed from observed repair actions for a specific NSN and dated to show the date the item repair price was negotiated.
- 10 Repair Cost: Includes direct labor cost to repair, material cost to repair, and other costs such as overhead are presented. This provides visibility of price variances for comparison among commercial, interservice, and organic facilities for like items. Manhours to do repair are also listed.
- 11 Beyond Economical Repair: Identify items for which repair costs will be excessive (greater than 75 percent of current procurement cost).
- 12 <u>Current Funds Received</u>: The dollar value of all repair schedules received and accepted at the DOP is listed.
- 13 <u>Current Funds Scheduled</u>: The dollar value of all schedules accepted for which there has been no induction (outstanding requirements) is listed.
- 14 <u>Current Funds in Process</u>: The dollar value of repair schedules that have been inducted for repair but are not yet complete is listed
- 15 Funds Obligated or Expended to Date: The dollar value of all schedules that have been inducted and/or completed during the fiscal year is listed.
- 16 Other Reporting Requirements: Unique data requirement emanating from special procedures for processing repairable material for Security Assistance Program (SAP), training equipment, battery jars, etc. is listed.


F. RTAT PERFORMANCE

CNM defines repair turn around time as:

the time from generation of a repair directive to the date repair is completed, indicated by a TIR transferring the item from "M" to "A" condition. [Ref. 3: p. XII-3]

To maintain visibility and management control over DLRs in the repair process CNM requires that the SPCC IM maintain RTAT by item and family group. Actual RTATs are to be compared with established performance goals. To enable the ICP to measure RTAT the depct is required to report the various segments constituting RTAT. [Ref. 3: p XII-3]. Figure 2.10 is a graphic portrayal of the RTAT segments and performance goals. The definitions of the segments are: [Ref. 3: p. XIII-9].

- 1 <u>DOP Acceptance</u>: Time from ICP forwarding of a repair schedule and funding to a DOP to the date of acceptance by the DCP.
- 2 <u>DOP Carcass Request</u>: Time from DOP acceptance of repair schedule to the date of request for carcasses from the DSP.
- 3 <u>DOP Material Receipt</u>: Time for DOP request for carcasses until DOP receipt of material.
- 4 <u>DOP Induction</u>: Time from DOP receipt of carcasses until repair start date ("M" condition TIR).
- 5 <u>DOP Repair in Process</u>: Time in "M" condition (exclusive of "G" condition time). This time will be measured for each repair action via TIRs and computed as a periodic average for NSN, COG and DOP.
- 6 Awaiting Parts: Time in "G" condition as measured by TIRs. Time will be computed for each repair action and used in developing a DOP and system average AWP time and in highlighting excessive AWP situations as they occur.
- 7 RFI Receipt Time: Time from completion of a repair until the item is reported in "A" condition via TIR. This includes time in preservation and packaging after the repair has been completed. This time is measured for each repair action and used to compute the average DOP time to make repairables ready for shipment after repair.

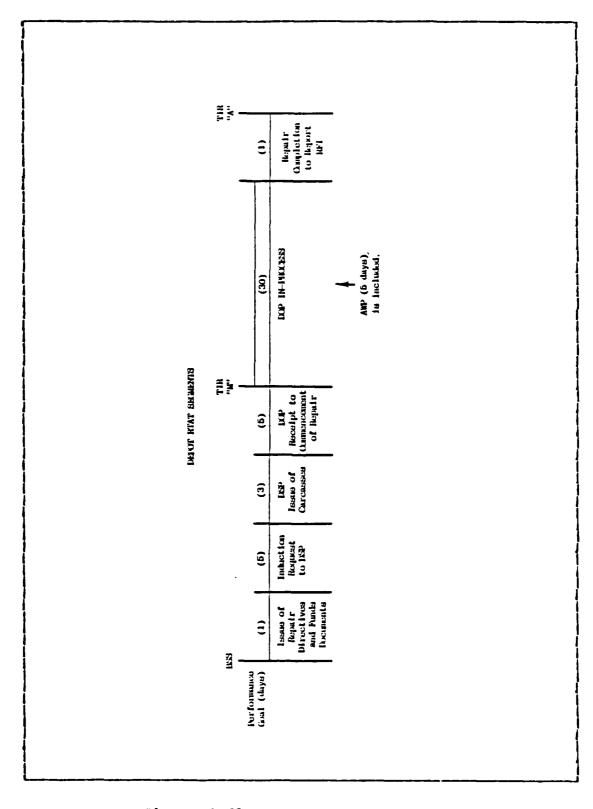

The control of the co

Figure 2.10 Depot RTAT Segments.

G. SUMMARY

This chapter provides the reader with a general overview of the repair cycle as well as a feel for the complexities involved in effectively managing the repair of DLRs. It provides a brief description of how SPCC determines DLR repair requirements and workloads the shipyards. A more detailed description is provided of the steps and procedures each shipyard takes to repair DLRs. It also details performance goals and reporting requirements set forth by CNM.

Some simplifications were made and the chapter is not intended to be a complete picture of how each shipyard and/or SPCC actually operates. Each step in the repair process is a complicated interface of various activities, computer systems, and individuals. Each is dependent upon the other to effectively manage repairables. In such a complicated environment there is ample operationally for problems to develop. The next chapter will look at each step in the repair process and identify problems that tend to increase RTAT and hinder effective management at both SPCC and the shipyards.

III. ANALYSIS OF THE REPAIRABLES CYCLE

A. GENERAL

As outlined in Chapter II, the repairables cycle is a complicated system with numerous interfaces between various organizations, computer systems and people. To efficiently move a failed carcass through the repairables cycle these organizations, computer systems and people must coordinate their actions and ideas.

This chapter will address current practices and procedures which tend to increase repair turn around time and will recommend actions which may be taken to reduce RTAT. Many of the recommendations are based on the author's personal experience as the Repairables Management Officer at Long Beach Naval Shipyard from March 1982 to May 1984. Additionally, areas in which individual shipyards have taken the initiative to implement policies and procedures have reduced RTAT will also be explored. Prototype improvements have be∈n developed in both the organization and automation areas at individual DOPs. However, little has been done at the system level to coordinate these improvements at The specific areas which will be all organic DOPs. discussed are:

- Institutional issues, related to the problems in measuring DOP performance;
- 2. <u>Depot organization</u> as it pertains to repairables management and DLR repairs;
- 3. Workload forecasting as it affects organic DOPs.
- 4. Administrative time, the time required to process funding documents at the DOP; this time includes preparation of all documentation necessary to induct a carcass for repair as well as the induction time.

- 5. Repair In Process Time (RIPT), the time from receipt of the carcass in the repair shop until repair is completed and turned over to the DSP in "A" condition.
- 6. <u>Preservation</u>, <u>packaging and storage time</u>, is the time required for the DSP to P&P, and store the DLE in RFI condition.
- 7. <u>Automated Repairables Management Information System</u>
 (ARMIS)

Several Naval Audit reports conducted in the early 1980's point out the deficiencies in the repairables management functions at shipyards.

NAVSHIPYD does not have a Repairables Management Organization with centralized authority and responsibility. As a result, repairables processing is fragmented and lacks overall coordination and direction [Ref. 1: p. 3].

The report goes on to say this problem stems from:

- 1 Lack of dedicated personnel;
- 2 Lack of recognition/support for repairables within the shipyard;
- 3 Lack of precisely defined departmental functions and responsibility regarding repairables; and
- 4 Lack of interfaces between shops, shop planners, progressmen and expediters.

Another report cited a similar problem.

NAVSHIPYD does not provide as intensive support for the repair of 2F/2S cognizance and secondary items as contemplated by governing directives... its production shops are dedicated to overhaul of ships on the waterfront, and repairables work is accepted only as shop schedules permit [Ref. 2: p. 2].

These reports were based on specific problems at two different DOPs. However, the problems cited are common to most of the shipyards visited. The problems addressed in the audit reports as well as several problems that were not mentioned will be examined in this chapter.

B. INSTITUTIONAL ISSUES

Before examining the problems with the repair cycle, it is important to define segmented RTAT responsibilities and look at the criteria currently in use to measure DOP performance. These are important because they affect the policies and procedures adopted at the DOPs.

SPCC measures DOP performance in two ways, (1) RTAT and (2) workload backlog [Ref. 9]

1. RTAT

SPCC uses TIR information to compute RTAT National Stock Number (NSN), Cognizance Symbol (cog), Depot. SPCC defines DOP repair turn around time as the time from when the carcass and funding are available to the time the carcass is reported in ready for issue (RFI) condition This definition differs from CNM's definition [Ref. 9]. presented at the end of Chapter II, which includes induction time but does not include preservation, packaging and storage time. SPCC's definition includes the additional time the item is in preservation and packaging (PEP) as well as the time the DSP takes to stow the item and TIR it as With the exception of one shipyard visited, P&P and RFI. storage are accomplished after the item is turned over to the DSP in "A" condition [Ref. 10].

Both SPCC's and CNM's definitions include the time it takes the DSP to deliver the carcass to the DOP once the request for induction has been made. It is the DSP's responsibility, not the DOPs, to move the carcasses to the DOP in a timely manner.

The shippards have a problem with both of the above definitions because both definitions contain times over which the DOP has no control.

When discussing what can be done to reduce RTAT it is important to specify who has responsibility for each segment of the cycle. DOP's should not be measured on

segments of RTAT over which they have no control. NAVSUP should provide definitive guidance on who has responsibility for each segment of the repair cycle as well as realistic times for each segment to be accomplished.

RTAT is computed exclusive of "G" condition time (awaiting parts). Current regulations require the DOP to package a DLR and return it to the DSP when a item is placed in "G" condition. Additionally, the DOP should cancel the requisitions and have the DSP reorder the required parts. When the parts are received, the DLR and the repair parts are returned to the DOP to complete repairs.

For the larger DLRs it is not cost effective to gather up all the sub-assemblies and component parts that have been sent to various shops and workcenters for repair. Consequently, most DOPs do not use "G" condition for these larger items. At one DOP visited, "G" condition was not used at all and at another only one DLR was in "G" condition. When "G" condition is not used RTAT suffers. SPCC is also unaware that repair has stopped and can not expedite the required repair parts.

To encourage the use of "G" condition, NAVSUP should authorize local agreements between the DOP and DSP to allow larger DLRs to remain in the custody of the DOP pending receipt of the parts. The policy of canceling the DOP's requisitions and the DSP reordering the parts should be rescinded, particularly in view of the increasing procurement lead times. The DOPs will have to assume responsibility for notifying the DSP when a DLR has been placed in "G" condition as well as when repairs have restarted.

2. Workload Backlog

SPCC uses the workload backlog statistics to measure how much work the DOP has on hand. Backlog is the total number of carcasses scheduled minus those completed and or canceled (BSR). Based on the last six quarters data, SPCC

computes the average number of units completed each quarter and compares that figure to the average number of units available for induction. If the the average number completed each quarter exceeds the average number of units scheduled, the DOP is said to be working down its backlog.

Figure 3.1 is a sample of the form used to compute backlog. In this example, the DOPs average units completed the last two quarters is 118 percent of the average units available for induction. However, the report shows the current backlog will still support one and one half quarters worth of work. Table I is a summary of the backlogs that SPCC has calculated for 7H cog for each of the DOPs visited in this study, based on the last six quarters' workload.

TABLE I
7H WORKLOAD BACKLOG IN UNITS

<u>DOP</u>	SCHEDULED	COMP.	BSR*	BACKLOG	<u>AVE</u> -	BACKLOG
1	2648	16 8 7	740	221	1.65	qtrs
2	10591	80 1 6	1421	1154	1.55	qtrs
3	2947	132 7	312	1308	7.16	qtrs
4	1544	100 2	149	393	5.31	qtrs

^{*} BSR is a document identifier used by SPCC to cancel repair requirements.

These figures were made available to the DOPs at the last workload conference held in September 1985. As pointed out earlier, many of the DOPs were not canceling (BSR) carcasses that were not available during the quarter in hopes the carcasses would materialize in the future. Subsequent to this report, the DOPs have reduced the backlog by canceling many of the carcasses that were not available for induction.

SPCC recognizes that this information does not accurately reflect the backlog but is forced to use whatever information is available. In this case, the data on DLRs scheduled and completed is available via TIR reporting.

DOP BACKLOG AND PRODUCTIVITY ANALYSIS DOP: NSY LONG BEACH (7H)

	DATE	ONITS SCHEDULED	COMPLETED	BSR	BACKL	<u>∝</u>
10 FY84	12/31/84 - 6/30/85 Difference	1888	1464 1602 138	222 224 2		202 62 140
2Q	12/31/84 - 6/30/85 Difference	1651	1288 1345 57	271 272 1		92 34 58
3 Q	12/31/84 - 6/30/85 Difference	1467	1077 1222 145	154 157 3		236 88 148
4Q	12/31/84 - 6/30/85 Difference	1386	837 980 143	226 235 9		323 171 152
1Q FY85	12/31/84 - 6/30/85 Difference	2205	502 1720 1218	0 151 151		1703 334 1369
2Q	12/31/84 - 6/30/85	1994	0 1147 1147	0 382 382		1994 465 1529
TOTAL		10591	8016	1421 134		1154
DIFFERE	NCE TOTALS		2848	548		3396
AVE U	nits sked last	6 orrs 10591/6	S		•	1765
AVE U	inits bsr'd last	6 QTRS 1421/6	S			236
AVE 0	NITS AVAILABLE	FOR INDUCTION			=	1529
AVE	UNITS COMPLETE	D LAST 2 OTRS	785 + 2848/2 :	3633/2	=	1816
*	COMPLETED VS AV	AIL			•	1 18%
UNITS	REMAINING FROM	1 PRIOR QUARTE	RS		=	1154
UNITS	S REMAINING FROM	1 CURRENT QUAR	ter minus proj	ECTED BSRs	=	1675
TOTAL	L UNITS IN BACK	roc			-	2829
AV	e units complet	20			=	1816
*	OF UNITS IN BAC	RLOG			-	1.55 gms

Figure 3.1 SPCC Backlog Computations Sample.

When units completed are used in the computations the work in-process is ignored. To accurately measure backlog, manhours authorized should be compared to man-hours expended. With the exception of one DOP, man-hour information is not readily available. Only Long Beach NSY, which has ARMIS, can automatically generate man-hour information in a timely manner.

The author was faced with a similar problem in gathering statistical data for this thesis. A great deal of time was required to gather and compile the data at the non-automated shipyards. At one DOP the lack of any automated repairables management information by either the DOP or DSP, as well as time constraints, precluded gathering segmented RTAT on the DOP's performance. It is obviously difficult to determine what actions should be taken if accurate information on the current situation is not available.

C. DOP ORGANIZATION

1. General

Historically, the primary mission of naval shipyards has been to provide logistic support for the construction, conversion, everhaul, repair, alteration, and drydocking of U.S. Navy snips and service craft. Additionally, shipyards have been assigned depot responsibility for overhaul of DLRs.

At most shippards the DLR workload accounts for less than five percent of the total shippard effort [Ref. 11: p.11-3]. Consequently, shippards are organized and management information systems have been set up to support the ship related work (ie. construction, conversion, overhauls, etc.).

Although the shippard priority list indicates that the repair of DLRs is relatively high, the low volume of repairs as compared to the waterfront workload precludes most shippard commanding officers from dedicating personnel

to the repairables programs. In this thesis, dedicating personnel refers to having people assigned to a program on a permanent basis. For example, personnel dedicated to the repairables program would not be assigned to do work on ships on the waterfront. Their primary responsibility would be to repair DLRs.

During several of the interviews conducted for this thesis, repair of DLRs was referred to as "filler" work. ³ Without dedicated shop personnel to repair DLRs, repairables will continue to be used as filler work.

Most shippards could survive without the DLR work-load. However, the ICPs cannot survive without having organic DOPs. With the increasing number of DLRs (approximately 90,000 at SPCC alone) and the increasing complexity of weapons systems, it may be difficult for SPCC to locate commercial DOPs with the capability and capacity to provide timely repair of DLRs.

2. Proposed Organization

There was unanimous agreement between the shipyards visited and SPCC that the single most important factor in reducing RTAT at the shipyards was for NAVSEA and shipyard commanders to <u>support</u> the repairables program at their shipyards. If a repairables program is to be actively supported the shipyard needs to address four separate functions: (1) Planning, (2) Production, (3) Transportation and (4) Supply.

a. Planning

As a direct result of one of the audit reports mentioned above, Long Beach NSY established a dedicated planning office called the Repairables Management Office (RMO). Historically, this shipyard has been the largest DOP with respect to the number and value of DLRs repaired. It has been designated the DOP for over 4500 different DLRs,

³work that is accomplished when the waterfront workload is low and can not provide work for all the production workers.

3500 of which are managed by SPCC. The remainder are managed by NAVSEA and the old NAVELEX organization. In Fiscal Year (FY) 84 this DOP was funded over \$65 million dollars to repair DLRs (this represents approximately ten percent of that shipyard's total workload).

Figure 3.2 is the NAVSEA approved organization chart for the Long Beach RMO. Figure 3.3 is a skeletonized organization chart that shows the relationship between the planning (RMC) and production (RRC) departments. The primary benefit of an RMO organization is the consolidation of the production controller and planner and estimater functions in one office. By having the P&E personnel in the same office and dedicated to repairables, the time required to generate the Work Control Document (WCD) / Job Order (JO) is reduced. The other major benefit of this organization structure is the centralization of authority and responsibility for managing repairables.

Due to the volume of repairables managed at Long Beach NSY, the number of PCs (5) and P&Es (6) is large when compared to other DOPs. The PCs are organized by DLR type. Two are assigned to SPCC items and two are assigned to NAVSEA items. One is assigned to manage the Pacific Fleet winch Repair program. Three mechanical P&E, one electronic P&E, one electrical P&E and a P&E supervisor are fully employed in preparing WCDs and ordering material.

The most important factor is to have personnel dedicated to the program not the number assigned. For example, the smallest DOP analyzed in this thesis repairs approximately 500 DLRs for SPCC with funding less than \$1 million dollars in FY 84 [Ref. 7]. Although this shipyard does not do the volume of DLR repairs that the larger shipyards do, the process and procedures involved in the administrative and repair functions are essentially the same. This shipyard does not need as many people assigned

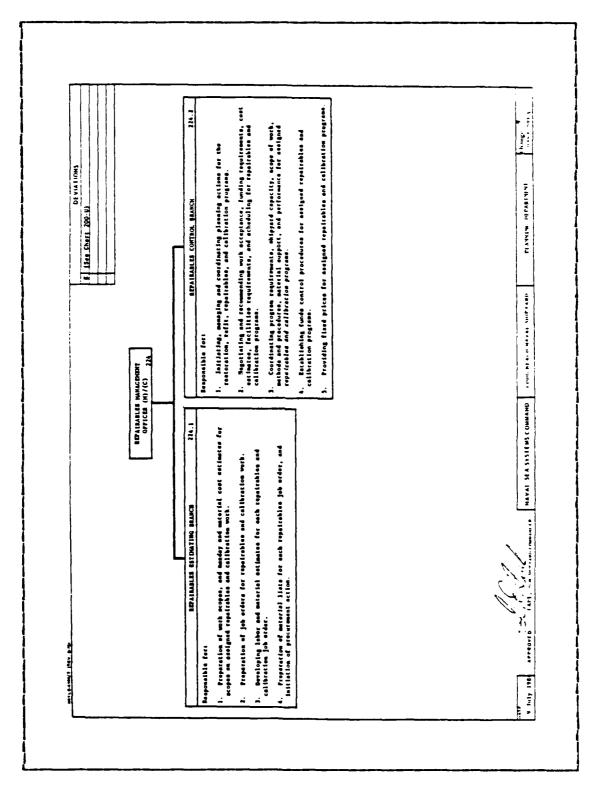


Figure 3.2 NAVSEA approved Repairables Management Office.

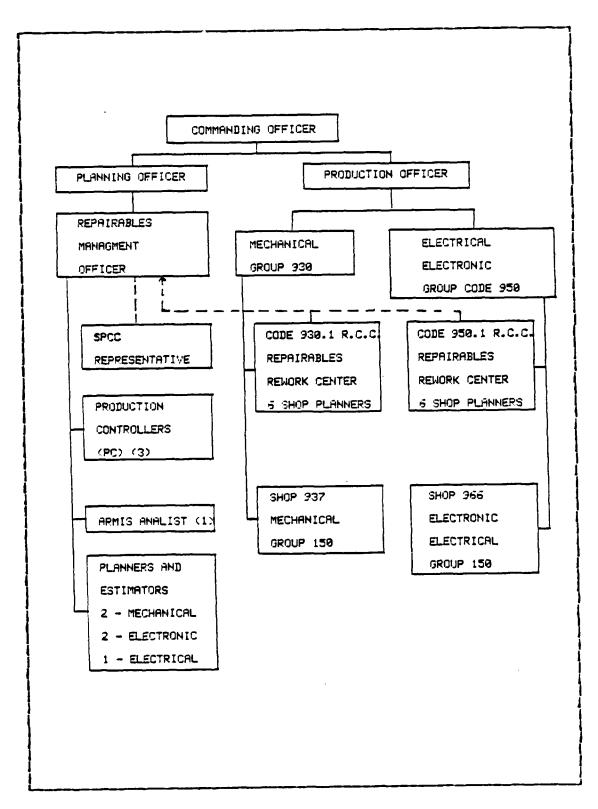


Figure 3.3 Long Beach NSY RMO and RRC Organization.

to the repairables program but it does need a dedicated organization with centralized authority and responsibility. At this DOP only one PC is used for managing the entire repairables program.

b. Repairables Rework Centers

Repairable Rework Centers (RRC) are designed to have dedicated mechanics and shop planners assigned to work centers whose primary responsibility is the repair of DLRs.

RECs were first introduced into selected ship-yards in 1978. Currently, only two shipyards have RECs (NSY Long Beach and NSY Norfolk). The driving factor in establishing RECs dates back to 1975 when several shipyards were faced with (1) major reductions in the waterfront workloads, (2) underutilization of electronic repair facilities and (3) a need to provide customers a lower priced cost center due to rework funding deficiencies. [Ref. 11: p. I-1.]

In 1981 an RRC was formally established in the Electronic/Electrical Group (Code 950) at Long Beach NSY. Efforts are also being taken to establish a similar organization in the Mechanical Group (Code 930). Recently the LBNSY organization was expanded to include a Shop Superintendent (Code 966). A shop superintendent is responsible for several work centers. Currently there are approximately 300 dedicated shop personnel assigned to the two RRCs at Long Eeach NSY.

About the same time an RRC was established in the Electronic Shop at Norfolk NSY. Although not formally organized, the Norfolk RRC has continued to have personnel dedicated to the repairables program.

Figure 3.4 is the formal organizational chart of the Electronic / Electrical Group (Code 950) RRC at Long Beach NSY. This is the largest RRC at any shipyard and

^{*}lower priced cost centers refer to establishing tailored stabilized rates for DLR repairs.

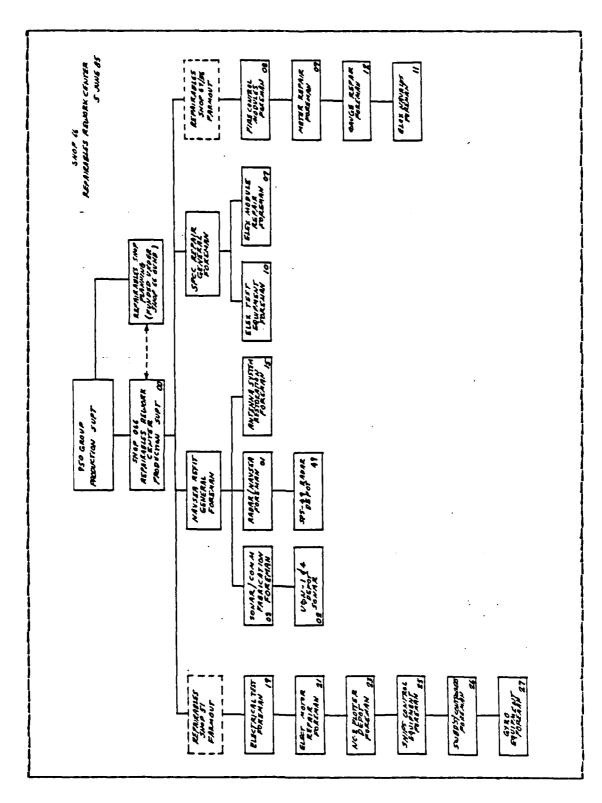


Figure 3.4 Electronic / Electrical RRC.

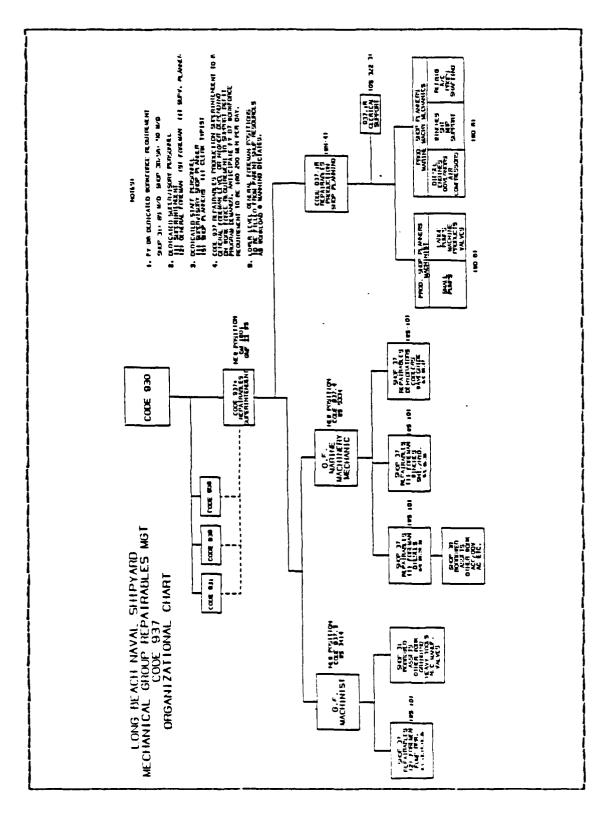


Figure 3.5 Mechanical RRC.

employs approximately 150 personnel. Figure 3.5 is the proposed Mechanical Group (Code 930) RRC. Although the formal organization has not been fully implemented, this RRC also has approximately 150 personnel working on DLRs each day.

The larger an organization is the greater the need for a formalized structure. However, size is not the only criterion that should be used to justify a formal Even the shipyard that does the least amount organization. of DLR repairs has enough work to establish an RRC. Instead of 150 people it could be as few as 15. A minimum of one shop planner needs to be assigned to monitor induction, repairs in process and the steps for returning DLRs in "A" The number of shop personnel assigned should be based on the number of man-years of work accepted by the If the DOP accepts the work it should be willing to DOP. dedicate the people to do the work. As the workload increases so can the the size of the RRC.

In the years since RRCs were first introduced in naval shipyards, major benefits and improvements have resulted for DLR customers.

1. Repair prices have been reduced. RRCs allow the shipyards to segregate the repairs of DLRs and organize the work force. By making repairs in a production mode, separate stabilized rates can be developed for each work center. Prior to the RRC concept, DLRs were repaired using the applicable ship rate. NSY Long Beach has 25 different rates based on the type of equipment, complexity of the repair and piece part requirements.

At NSY Long Beach analyzing the repair price has been made much easier using ARMIS. ARMIS retains cost information for material, labor and overhead by DLR. Actual charges are compared with estimates to determine if the

repairs have been priced correctly and the rates are adjusted accordingly. Rates are submitted and approved by NAVSEA annually.

- 2. <u>Dedicated personnel</u> were assigned to repair DLRs.
- 3. RTAT was reduced. Table II is a summary of 7G, 7H and 7Z cog RTATs over the last five years at NSY Long Beach. RTAT has been reduced from over 100 days in FY-81 to just under 50 days for those FY-85 DLRs that have been completed to date.

TABLE II
HISTORY OF RTAT BY COG. FOR NSY LONG BEACH

YEAR	<u>COG</u>	UNITS COMPLETE	AVE-RTAT
FY-81	7 G	1533	100
FY-81	7H	927	114
FY-81	7Z	N/A	N/A
F Y-82	7G	5442	98
F Y-82	7H	N/A	N/A
F Y-82	7Z	2588	109
FY-83	7G	1426	112
FY-83	7H	4151	96
FY-83	7Z	435	102
F Y-84	7G	1248	74
F Y-84	7H	4811	72
F Y-84	7Z	703	87
FY-85	7G	145	47
FY-85	7H	623	46
FY-85	7Z	91	50

Although comparable data was not readily available at Norfolk's RRC, SPCC personnel are confident the RRC concept has reduced RTAT significantly at that shippard also. [Ref. 9]

Table III groups NSY Long Beach repair history data for the Electronic/Electrical RRC by cog and RTAT. Based on this information, approximately fifty percent of both the 7G and 7H cog DLRs have RTATs less than 60 days. When the data is reviewed in this way the manager can concentrate his attention on those DLRs that have excessive

RTATS. ARMIS can also list the individual NSNs that make up each category.

TABLE III REPAIR TURN AROUND TIME

7G Cog RTAT for 307 NSNs

less than 60 days = 162 60 to 90 days = 52 90 to 120 days = 24 above 120 days = 69

7H Cog RTAT for 1005 NSNs

less than 60 days = 499 60 to 90 days = 140 90 to 120 days = 77 above 120 days = 289

Using the ARMIS in conjunction with the RRC, shop performance can be monitored to the shop foreman level. Figure 3.6 is a sample of a shop manning report obtained using the RRC and ARMIS combination. Using the number of man hours authorized and the number of man-hours expended, ARMIS computes the number of men needed to complete the work assigned to a foreman. This figure is compared to the number of personnel which worked the previous week. sample, the shop foreman has enough work to keep 35 people employed for the next two weeks and 28 people employed the However, the foreman worked only following week and so on. 12.5 people last week. If this foreman is going to meet his Repair in Process Times (RIPTs) he will have to assign more personnel. With this type of information available the manager can foresee problems such as, inadequate staffing, and take corrective action.

Appendix B contains flow charts of how the RRC at Long Beach uses ARMIS to process WCDs and induct carcasses for repair. [Ref. 13]

Figure 3.6 Shop Manning Requirements
Sample Report.

c. Transportation Services

There are two support services that directly effect RTAT at shippards; (1) transportation and (2) supply support services.

Transportation problems, both within the ship-yard and between the DOP and DSP, were found to be increasing RTAT at all four shipyards visited. In most cases the delays occurred when failed carcasses were being moved in or cut of the DOP. In one case, completed DLRs were staged in a large box prior to being delivered to the DSP. This box, because of its size, is only picked up once a week and then only if it is full [Ref. 12]. This practice automatically adds an average of three and a half days to the repair in process time for those items staged in the box.

Another problem that has caused delays is the losing of carcasses after the induction request has been At one shipyard, a sample of six FY 85 project orders involving 1493 carcasses was reviewed. Of the carcasses, 294 or 20 percent were shipped from the DSP but not received. Because there was no DOP or DSP monitoring of the movement of the carcasses it is difficult to determine the disposition of these carcasses. Due to the large number of carcasses that are reported shipped but not received. several of the shipyards have instituted signature receipt. Previously, the DSP driver was dropping the carcasses off at the DOP without requiring a signature [Ref. 13]. control has added some time to the receipt process but has reduced the number of lost carcasses.

Shipyards without RRCs have DLRs delivered to the Material Control Centers (MCC) in the various shops. MCCs are designed primarily to stage material coming off ships in overhaul as well as material being returned to the ships when repairs have been completed. To help eliminate

the impact of transportation delays between the DSP and DOP, the DSP that supports Long Beach NSY has begun making daily pick up and delivery at the RRC. By making deliveries and pick-ups at the RRC, the shop planners have more control and visibility of the DLR. Having the RRC control movement of DLRs also reduces the chance the material will be mixed with DLR being repaired for ships on the waterfront.

Finally, arranging transportation/materials handling services within the DOP has also been difficult due to competition from the waterfront workload for cranes and other materials handling equipment. These delays can increase RTAT unnecessarily.

d. Supply Support Services

Organizing certain DOP supply activities or functions to support the repairables program could have a significant impact on reducing RTAT. Two functions that are important are: (1) shop stores support and (2) expediting of piece parts used to repair DLRs.

Two of the shipyards visited cited instances where shop stores' personnel were not supporting the repairables program. In both cases snop personnel directly involved in the repair process had provided shop store managers with lists (approximately 2000 NSNs each) material they felt were needed to support the repair particular DLRs. According to the personnel interviewed, no action was taken to stock these items in shop stores. Management attention and affirmative action OD the production shop's request for support would obviously elimiby lack of repair part support. nate delays caused [Ref. 13, 14].

SConcurrent repair of DLRs is not normally authorized and causes inaccurate demand data for the Supply system. Concurrent repair is when the operating ship or activity has the DLR repaired at the DOP without notifying the IM. Concurrent repair is a significant problem but will not be addressed in this thesis.

Once piece parts have been placed on order it is the shipyard supply department's responsibility to expedite material based on priority and urgency of need. Only one DOP indicated they had a dedicated expediter assigned to the repairables program [Ref. 13]. At the other shipyards expediting piece parts for the repairables program was considered in direct competition with waterfront requirements. As indicated earlier, at most shipyards DLR work is accomplished only when it doesn't interfere with the waterfront work.

D. WORKLOAD FORECASTING

Workload forecasting is a key factor in reducing RTAT. Without a steady and reliable workload it is very difficult for the DOP to schedule man-power and machines to support a repairables program in shipyards. When the planned workload is not available at the beginning of the quarter, production workers will be left idle or must be reassigned. If carcasses arrive later during the quarter in which they were workloaded, repairs will normally be delayed until the carcasses can be inducted and personnel reassigned. Such inaccuracies in the forecasted workload can and do cause major problems for the DOPs.

DOP can be assured of a consistent workload it can staff the the shops accordingly and integrate the DLR workload with ship repairs. Consistency of the workload is more important than volume. The volume of work only becomes important when the shop has been manned to meet a certain For those organic DOPs who repair a large workload level. number of DLRs each quarter, RRCs have been established which have dedicated shop personnel. These personnel rely on the forecasted workload to keep them employed for the If the actual workload is less than the entire quarter. forecasted workload, the RRC manager must schedule over the entire quarter even though he could inductions repair the carcasses faster [Ref. 12].

Workload forecasting is the responsibility of SPCC and has a direct effect on many of the policies and practices adopted by shipyards. SPCC's policy in recent years has been to workload only those non-ready for issue (NRFI) carcasses that are on hand at a DSP or are due in from operating units. This policy was put into effect due to a number of complaints by the DOPs that carcasses were not available for repair after they had been workloaded.

Although some improvements in carcass availability has been made, there still seems to be a problem. DOP's monthly refit reports, sample data was extracted to determine the percentage of workloaded carcasses that are subsequently cancelled beca use the carcass was identified or was not on-hand at the DSP. At one DOP a sample of three project orders covering the first three quarters of FY-85 revealed that only 42 per cent of the 118 different 7H coq stock numbers workloaded actually had carcasses available. Repairs to 69 of these stock numbers were cancelled because the DSP did not have carcasses available or when the carcass was delivered to the DOP it had been mis-identified and was a carcass for some other NSN.

A similar sample was taken at another DOP. This sample involved six FY-85 project orders to repair 204 different stock numbers with varying quantities of carcasses assigned to each NSN. 438 of these carcasses, involving 71 NSNs, were either not in stock (NIS), not received or mis-identified.

This information does not significantly differ from the information available at SPCC. In a recent briefing SPCC noted that the carcass cancellation (BSR) rate has averaged approximately 22 percent at organic DOPs. [Ref. 15]

The recently established Repairables Policy and Systems Office (Code 0503) at SPCC is trying to identify and take corrective action on the problems of repairables management.

In addition to carcass availability, this office is investigating problems with carcass visibility, DOP management, repair requirement identification, institutional issues, ADP issues and financial issues. [Ref. 15]

Much of the carcass timing problem is a result of the operating units not being timely in returning their failed carcasses. If the carcass does not arrive at the DSP during the quarter it was workloaded, repair of that carcass is cancelled by SPCC. Eliminating planning for due-in quantities would improve the accuracy of the workload forecast. Thus, if SPCC were to base the workload solely on on-hand non-RFI carcasses, the percentage of available carcasses should increase.

Another action that may improve workload forecasting is to develop an automated interface between the BO8 and the shipyard's computer system. The Aviation Support Office (ASO) uses a magnetic tape of the Cyclic Repairables Management Program (BO8) to workload the Naval Air Rework Facilities (NARF) on a weekly basis. The NARF receives 90 percent of its workload automatically by interfacing the BO8 tape with the NARF's weekly induction scheduling system. [Ref. 6].

Under the present system used by SPCC and organic DOPs, 90 percent of the workload must be accomplished manually by reviewing over 19,000 NSNs each quarter. Figure 3.7 and 3.8 are samples of two of the forms that must be reviewed by the IM for each NSN. For each of the NSNs workloaded the IM must compare and verify the actual stock status on the Consolidated Stock Status Report (CSSR) with the forecasted workload figures on the repair workload forecast. The UADPS Supply Demand Review program provides the CSSR forms and SPCC's DATAPOINT system computes the workload forecast. DATAPOINT receives information on a selected universe of NSNs via magnetic tape from UADPS. For example, UADPS may

STOCE NUMBER	2	Ц	CSSN PRINT REASONS	BCKE PW	1140 00	NAMOON BRUAND AVE	0000. 661	REPAIR TAT	26 3	PEPARABLE BANTAL	T	u de	-								一分 り)											_							_
1	3	200	-	2	*!	N. A.	-		7	L	L			-			Ŧ															Ì								l
	+	5		e ec.	IAP AEPAIN TAI	100		4 00	1	4.2	1E02		DESIGNATED OVERHALE POWER				3			-	'	•			1				Ī	-	1	7			Ī	_		Ì		-
3		ė	PACKAGE	-	PROC IAF		1	FRO OF 15	33	, 5			O T	_	-	-			$^{+}$		1			<u>!</u>	+	-		<u></u>	<u> </u>	<u> </u>	1				$\frac{1}{1}$	_	<u> </u> 	1		_
1 ac		=			2 Y	DAG	8	15.0		REPAIR Until COST	315.00		ž L	+	E	> -		_		-						2		_	_	_			8	Ļ	1			1		_
		COUPL	CUM	8	1 A A A C		0542	MET 9781	-	Ì				11.0	173		3									_) PC(10							
300 MANE	1	2	WEIGHT	8.5	DIVE MAINT DIVE	OKULAN OF US	38.8	BAT RECEN	-	BE PA: S)		135	100 0 10	101	-	De HAND									- (PC(FR			· •	4	4		
	1	APC. PPC.	-	80	NOCH AND	Production and	•••	PLT A55618		Mean Livel	101	WAL REPAIR	106		1			4		4-		4 4	-	1	4	-	4	4	4 4		İ	4	- 1	1	000	366 77	85004 E	104300 1000 1000 1000 1000 1000 1000 100	1052 E	-
MEPLACEMENT	١.	1234.84 M	200		A DIA	DEGATED IT	197.8		OF ME MALE		-	PROC SURVINA			٠,	7	TOWAL TOWAL	<u> </u>	<u> </u> 		-	_		<u> </u> 	-		P		_	-		-	Y DATE	:	+	_	9		-	
1	_	2	CODE			_	_	12		2 5	-		-	ᆫ	2	2		Ī	+			_	_		-		•	<u> </u>					V 017	B (7 F	5277	T.	227	8 2 2	
	-		SOL)		VARIANCE			<u> </u>	PCO4	•	, į	1		1	7			1						_			<u> </u>		_			de DELY	50038	18.5	052	- 152	200	=	
Test 2001			AP BOC S		07142 AN		8	Diver CONDITIONS	3	BONT-BYA	189	K:				- 12	ļ																110	5	<u>- </u>	٠ ٣	-	~	•	
	<u> </u>		j.,	_		STEPPE PRETE		03 Na+10	2	PLOADE	-	20.00	5604	134	1		\$		-	9 4	. 4	۰ <	4	•		٠.	• •	4 0		-		•		7	,		7	715	, ,	1
16 111	_	~	Boac Prairie		62CC	ii	-	ai I	1	94.614	†-	İ	Ī			P	1 5 4 3 5 4 O 4	8	58	88	٠ .	8					3.025	8	60		1023	2.313	FROM 10	2:	23	: ≩	2		2	
1 400 COV		E 72091 P	***		832	SULATION	Ļ.	REGINENAC:	S	<u> </u>	!	CARCASS	C 12	S	Ş		1000			†	'		_	1	-		-		-		+	_	<u>د</u>	-	+	_			300	
		ę	2110	•]: 0 i:	-15 E		76	5	PC-FEE		10	-		ě è	8		-		•	•	_	_	+	•		-	<u> </u>			1			-	-	_		-		<u>_</u>
40'B	2	8	ACTIVE POPULATION	_	55	BEDAMO SESTAVATION - EURA			3	OR IGNIALS	=	=	<u> </u>	- 3		. 13	5	02		<u> </u>	+			-	ا.	•	<u> </u>	 			1		II/CALI	Napris 12729272	9/0/6	18605	140990	4000	4175	1084
E C	8	8	ACTIVE P		ACON WAS	15 DE SE	9	COMPTION COOL A	-		2	ERECASS REFLAN DAS	Š	_	8	_[:	2	1	1	6	-	_ 0		9 5	1 2		2	<u> </u>	<u>88</u>		1 6	₽	CONEN	215EN4	585111	065 43	565 43	264943	000	, or or
PAGE	# C	20152			1450a8:0	THE PERSON		COMO	5	BACK DROTHS		ARCASS.	MAN		2006	_	_	-	- Z	724	- Z	2 2	2 W	7 20	70	70	70	20	20 X	XX GN	1 6	22	_ <u>ă</u>	BS I VE	X 02 2 15 2 15	X	15	200	202	3

Figure 3.7 Consolidated Stock Status Report.

						0		96	666		350	B 2		11:4-11	90.080	ER DOLLARS	080.018	\$ 10.080	QUANTITY	Š	
	\$1,140.00	\$1,254.84	\$501.00	\$315.00	9.	20		39 39	39 39 39 39	214 117	163 32	163 69	81 28	## ===================================	21 24 24 24 21 24 21 21 21 21 21 21 21 21 21 21 21 21 21	4TH QUARTER	0800	32	H/H		60 · 64 shi shi shi shi shi shi shi shi shi shi
	: 3 01	PRICE:		:	CRF:	09	~ :	38	. e. e.	207	25	32	176	ż,	\$10,080 \$10,080 159 21	RS UNITS			3RD QUARTER:		č
	STANDARD PRICE:	REPLACEMENT PRICE:	NET PRICE:	REPAIR PRICE:	SR: 0.90 M/H:	ę		8	8 8	190	33	32		$\bar{\chi}_{z}$	\$10.080 \$10 146 22	INTER DOLLARS	• 10.0	\$ 10.080	,	<u> </u>	
MECASI	•	ď.			22	90	2	8	88	- 161	33		159	- X3	\$10.080 141	3RD QUARTER UNITS M/H			M/H QUAN	-	
SPCC REPAIR WORKLUAD FUNECASE	84383	1907	AM-30078/URT, AMPLIF	\$1300109 EP UJ7 AM-3007/URT SER F1-F	REORDER LEVEL: REPAIR LEVEL:	20	8	60	" គឺ គឺ	9.0	23	23	152	हर्र	10.080		2222	000	ZND QUARTER: M/	11-11-11-11	
C REPAIR .	EXTRACT DATE: 84353	CURRENT DATE: 84357		\$23001 AN-300	REORDES	9	▼ 8	6	- 66 66		779	58	133	. 8 7	\$5.670 128 138	IRTER DOLLARS	080,018 080,080	\$10.080		æ 9	2 2
3			EQUIPMENT NAME:		32.000 38.810	OPENING POSITION	₹ 0	88	2.0	:	775					2ND QUARTER 15 M/H	0200	22	DOP	N68584	3
		AAVE O				•	-==	ΞΞ	= 2 2	:						ST IND		•			
		=	PPC, DIR COUPL		REQ. FREQ.: DEMAND:		DOS - CASREPTS BOS - DOS		LEVEL	FOURTH COMMISS	ON HAND OUE IN (DOS/A2) BY OTH		1 REMENT	D (UNFUNDED) URM FORECAST ON QUANTITY	A INT	POLLARS	\$2,838 \$2,838 \$2,838	\$5,670	DOLLARS	\$35,910 \$40,320 \$40,320 \$40,320	•
					5. to 8.		10 1 80s, DOS ALL OTHER BOS	DEMAND X RTAT	ALL DIHER PPRS - PWRS REPAIR SAFEIV LEVEL	ECUNOMIC WEPAI	1AND 1N (005/A2	TOTAL ASSETS		NRFI DN HAND (UNFUNDED) CARCASS RETURN FORECAST PRODUCTION QUANTITY	REPAIR COST CARCASS CONSTRAINT ESTIMATED BUY GTY	IST QUARTER		:	M/H		
	NSM	8985-00-0062031	TTEM NAME: APC.		PLT: RTAT:		REMENTS: 10	1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1	ALL REP.		NO OF		_	CARC	CARC	7	0000	=======================================	UNITS	128	
	000	704A					REQUIREMENTS:				ASSETS:						16 VEL 11			1ST YEAR 2ND YEAR 3RD YEAR 4TH YEAR	

Figure 3.8 SPCC Repair Workload Forecast.

be asked to generate a tape of all DLRs that have experienced any activity in the last two years. Using the data tape from UADPS, DATAPOINT generates a workload sorted by DOP and develops the workload forecast selecting only those DLRs that have due-in or on-hand quantities at the DSP.

B. ADMINISTRATIVE TIME

Administrative time is the time required to process funding documents at the shipyard and to order and receive a carcass to be repaired. Its two main components are documentation preparation time and induction time. Figure 3.9 is a diagram of the actions that must be accomplished during the administrative time. Documentation time, the induction process and induction time will be discussed separately because the DOP is responsible for the documentation time and induction process while the DSP is responsible for the induction time.

To measure the administrative time at DOPs, sample data was collected at both a "non-automated" and "automated ship-yard". The non-automated shipyard prepares documents manually, with the exception of the COAR. Using the Customer Order Documentation System (CODS) mentioned earlier, all shipyards have now automated preparation of the COAR. The automated shipyard, Long Beach, uses ARMIS. Table IV is a summary of document preparation and induction times at the two shipyards: shipyard 1 is non-automated, shipyard 2 uses ARMIS.

1. Documentation Time

The ARMIS system has reduced documentation preparation time significantly at the automated shipyard. The time required to process the documentation necessary to make repairs using ARMIS was only one sixth the time required by the manual system. This reduction in time is due primarily to two factors: (1) the RMO organization discussed earlier and (2) the fact that ARMIS has automated many of the

Figure 3.9 Elements of Administrative Time.

functions that must be performed manually at the non-automated shipyard. A detailed discussion of ARMIS is provided at the end of this chapter.

2. Induction Time

The difference in induction times is attributed to the responsiveness of the related DSP. Even though DOP 1 has implemented the UR-226 induction program, which automatically generates inductions at the DSP as part of the DSP's UADPS-SP, the DSP serving DOP 1 takes twice as long to move carcasses to the DOP. The UR-22 program uses a CRT terminal located in the shipyard which gives the PC direct access to UDAPS-SP to make inductions. Therefore, the induction time

The UR-22 program was develop by FMSO in 1983 and installed at DOP 1 in early 1984. The system was designed to work at all DSPs, but to date has only been installed at one. [Ref. 16]

TABLE IV DOP ADMINISTRATIVE TIMES

DOCUMENT PREPARATION TIME

DOP	NUMBER IN <u>SAMPLE</u>	TOTAL DOCUMENT PREPARATION TIME	AV ERAGE TIME
1 2	48 410	2886 days 4112 days	60 days 10 days
		INDUCTION TIME	
DOP	NUMBER IN <u>SAMPLE</u>	TOTAL INDUCTION \underline{T} IME	AVERAGE TIME
1 2	78 34 6 5	1194 days 23653 days	15 days 7 days

TOTAL AVERAGE ADMINISTRATIVE TIME

DOP

1 75 days* 2 17 days

recorded for DOP 1 consists entirely of the time it takes the DSP to pull the carcass from storage and ship it to the DOP. Using the ARMIS system DOP 2 automatically generates induction sheets which must be hand carried to the DSP. Implementing the UR-22 program at DOP 2 is expected to reduce RTAT by at least one day.

Some shippards have coordinated their actions with the supporting DSP to reduce the impact of induction time on RTAT. Working together, the DOPs and DSPs have allocated personnel and facilities to pre-stage carcasses at or near the DOP. Additionally, the DSPs supporting these shippards normally send representatives to the workload conferences. Then just prior to receiving the official funding document

^{*} When carcasses are available this figure may be as low as 60 days.

an advance copy is given to the DSP representative and all carcasses that are available are moved to DSP location near the shipyard.

3. Induction Process

The induction processes used by the various shipyards also affects RTAT. Three of the shipyards visited use the UADFS-SP UR-17 report to monitor DLRs flowing between the DOP and DSP. The fourth DOP does not use the UR-17 because the DSP has elected not to generate this report. The UR-17 report contains such information as: carcasses available at the DSP, condition codes, time and quantity inducted, shipped, received and completed. For the shipyards without ARMIS, the UR-17 is the only report that provides the data necessary to compute induction times used to schedule both manning and repair of the DLRs. program also produces punched cards that act as signature receipts, are used to TIR the DLRs from "F" (failed) to condition and from "M" to "A" "M" (in repair) specs.) or "G" (awaiting parts) condition. The report also shows when a DLR has been stored and is available for the IM to issue.

At the DSP that doesn't use the Uk-17 the DOP has no visibility of the carcasses available for induction. The DOP must call and have each item checked to see if it is available for induction. Additionally, this DOP must manually prepare two DD 1348 forms for each induction. This is very time consuming. A review of induction notices that were waiting to have 1348s typed revealed one that had been sitting in the typist's in-tasket for over three months [Ref. 18].

Another aspect of the induction process that has a significant impact on RTAT is the timing of the induction request. The DOP that is currently using the UR-22 program normally makes an induction request when the estimate sheets

are prepared by the PC [Ref. 8]. By making inductions in this manner many of the carcasses arrive at the DOP before the administrative loop can produce the WCD/JO. As mentioned earlier, if signature control of carcasses delivered to the shipyard is not used and the shop is not aware of the repair requirement, the carcass may not be matched to the WCD/JO. This practice may be contributing to the number of carcasses reported not received.

For DOPs with relatively small DLR workloads, making inductions shortly after the funding documents have been received is satisfactory, provided the shop or MCC is aware of the repair requirement and is expecting the carcasses. For the larger DOPs, inductions must be scheduled throughout the quarter to maintain level manning in the RRCs.

Another constraint may be that the shop does not have the space to store three months worth of work. Consequently, carcasses must be scheduled and inducted throughout the guarter they are workloaded.

Based on SPCC's definition of depot RTAT, that the repair clock starts when funding and the carcasses are available, DOPs are forced into artificially high administrative times. For example, if 3 carcasses are available when the funding document is received but, due to scheduling constraints, the DOP can only work one carcass a month, the carcasses scheduled for the last two months will have RTATs which are at least 30 to 60 days longer than is true. If quarterly forecasting of RTAT's continues, then RTATs computed by SPCC will remain high for the larger DOPs. By automating the workloading so that it occurs on a weekly or monthly basis using BO8, ARMIS and DATAPOINT, the average value RTAT as measured by SPCC would be reduced.

F. PIECE PART SUPPORT AND REPAIR-IN-PROCESS TIME

Repair-in-process time (RIPT), as defined in this thesis, is the time from receipt of a carcass in the DOP to the time the carcass has been repaired and returned to the DSP in "A" condition. In this section, piece part support will be considered as a primary influence on reducing RIPT.

1. Measuring RIPT

Prior to looking at how RIPT can be reduced it is helpful to understand how SPCC measures RIPT. Like RTAT, SPCC measures RIPT by NSN, cog and depot type (organic and commercial). The RIPT seen by SPCC is a composite of several DOPs' efforts to repair that particular NSN. By measuring RIPT in this manner SPCC can not isolate which DOPs are performing within the desired RIPTs for any particular NSN or cog and which are not.

Because the SPCC data do not accurately reflect RIPT. samples were taken from two DOPs to determine realistic values for an automated and non-automated depot. results of these samples are presented in Tables V and VI and have been aggregated by Federal Supply Classification (FSC). 7 The repair-in-process time shown in the two tables does not include induction, P&P and storage time. sample for Table V included 328 different 7H NSNs. This DOP does very well in repairing selected FSCs. Of the 328 NSNs completed 60 were from five FSCs. These five FSCs represented 1277 of the 1639 units completed or 78 percent. These included only 61 NSNs or 18 percent of all repaired by the depot. This group of FSCs had an average repair in-process time of only 10.5 days. The remaining 268 NSNs correspond to only 362 completions and have an average repair-in-process time of 52.5 days.

⁷The FSC is the first four digits of the NSN and represents the family group and class of the DLR. For instance, the FSC for diesel engines is 2815.

TABLE V

NON-AUTOMATED DOP
REPAIR IN PROCESS TIME

<u>FSC</u>	<u>NSNs</u>	TOTAL RIPT	UNITS COMP.	AVE- RI	<u>PT</u>
1220 5845 5865 6140 6630 BALANCE	39 16 1 3 268	516 8292 3097 428 1172 19006	74 462 161 269 311 362	17.9 da 3.8 da 19.0 da 1.6 da 3.8 da 52.5 da	iys * iys * iys ** iys ** iys *
TOTALS	328	32509	16 39	19.9 đá	ıys

* DLRs repaired in transducer repair facility. ** NSN 6140-00-635-1398, Battery Jars.

Table VI provides a complete picture of the RIPTs for the DLRs repaired by the Electronic/Electrical RRC at Long Beach NSY and was generated by ARMIS in less than thirty minutes (it took several hours of sorting data by hand to generate Table V using the UR-17 report for the non-automated DOP).

There are several points that can be gleaned from the information in Tables V and VI.

- 1. DLRs that are workloaded and repaired in large volumes can support a production line operation and will reduce RIPT.
- DLRs that are workloaded infrequently and in small numbers will nave higher RIPTs.
- 3. Aggregate measures of RIPT can be easily distorted by a relatively few NSNs that are repaired in large quantities.

2. Piece Parts

Piece parts are those components used to repair a carcass. These components can be consumable in nature (ie. screws, bolts, gaskets, washers, etc.) or other repairables.

Normally, piece parts are ordered by P&E when the job orders are prepared. Piece parts may also be ordered by shop planners or mechanics as new requirements are

TABLE VI
AUTOMATED DOP
REPAIR IN PROCESS TIME

<u>FSC</u>	UNITS COMPLETED	AVE. RIPT
500500005550055005500950050050505050 745854125023441356889990111233366666666666666666666666666666666	111249982128827838416699931446900592021 21233344316699931446900592021 3 10 11 2 354 11 1 2 354 11 1 4 1 9 9 8 3 1 5 3 7 5 8 1 2 3 5 4 1 6	24 49 <td< td=""></td<>
4		55 4475

identified when the carcass is disassembled. A third source of repair parts is shop stores. The impact of shop stores on the repairables program has been discussed earlier.

Until recently piece part initial provisioning for the depot level for major weapons systems and associated DLR subassemblies has taken a back seat in the acquisition process. When funding was tight most project managers opted to reduce support functions instead of reducing the number of systems purchased. This practice resulted in fleet comments such as, "it takes 5 DDGs to keep 3 operating". In the mid 1970s the surface community recognized the benefits of modular repairs and began designing and provisioning ships accordingly. The FFG-7 Class "Lo-Mix" and Sprunce Class destroyers were designed for modular repairs. By replacing DLRs before they broke, the ships could be kept in operation longer and would require fewer major overhauls. This was also one of the first class of ships where the DLRs were provisioned to the DOP level. Recognizing the importance of provisioning to the depot level and supporting the logistics pipeline should improve RIPT in the long run.

But what can be done in the short run? Piece part requirements are also driven by forecasted DLR requirements. The importance of accurate forecasting was addressed earlier with respect to dedicating personnel and facilities at the The same arguments apply to stocking and ordering However, shipyards can not afford to stock piece parts. piece parts for repairing carcasses that don't materalize. As Navy Industrial Fund activities, organic depots are paid only for the work that is performed for the customer. advance ordering of piece parts to repair carcasses that may or may not materalize must be absorbed in the Given the accuracy of the forecast, it is understandable why the DOPs are hesitant to invest in piece part support for the repairables program. One shippard is so skeptical of the forecast that it doesn't order piece parts until the carcass has been received and torn down. If the accuracy of the forecast and timing can be improved DOPs would have no reason not to pre-order piece parts.

In addition to the accuracy of the forecast, DOPs are also concerned about the extent of cannibalization of the carcasses. [Ref. 7]. Often carcasses are missing major sub-assemblies when they are inducted. A good example is Main Peed Pump (MFP) rotating assemblies. When a MFP

rotating assembly is turned in by an operating unit, the carcass should be composed of a housing, the shaft, impellers, and various smaller component parts. More often than not one or more of the impellers are missing.

One of the reasons impellers are cannibalized is the scarcity of impellers that meet OEM specification. The mechanics on board ships are aware of this problem and will retain the impellers as operating spares. The lack of quality impellers in the supply system, has also lengthened the RIPT for the MFPs. Several MFP rotating assemblies have been in the repair process in excess of two years awaiting impellers that meet OEM specifications. The supply system has provided two shipments of impellers all of which were unacceptable. Each MFP rotating assembly requires four impellers at a cost of \$2,400.00 each.

In the last couple of years, SPCC and the DOPs have developed procedures to help identify those activities that have cannibalize carcasses. When the DOP reports a cannibalized carcass to SPCC the turn-in activity will be charge the standard price for a replacement if they do not return the cannibalized parts. Although this procedure is available, it is not fully utilized by all the DOPs.

Quality control of repair parts purchased by the supply system has been a recurring problem. Normally, repair parts are purchased based on form, fit and function criteria. If the part looks like what it is supposed to be the part is accepted. In most cases inspecting for form, fit and function is acceptable because it would be cost prohibitive to inspect the thousands of parts the supply system purchases each day. However, for those parts that have Defective Material Reports (DMR) written, it may be wise to inspect the next batch of parts that the vendor

The supply system as used in this context refers to parts purchased by both Navy ICPs and the Defense Logistic Agency.

produces. This has not been the case in the past. Another option is to put inspection criteria in the contracts for those parts that that have two or more DMRs submitted in a year. To resolve the quality problem with MFP rotating assembly impellers, SPCC has agreed to purchase the impellers from the OEM.

To illustrate the impact of cannibalization quality of piece parts on RTAT, RTAT was computed for two MFP rotating assemblies. Three Byron Jackson rotating assemblies (NSN 7H 4320-00-884-8202) repaired prior to 1981 had an average RTAT of 117 days. During this time frame there were no problems with the impellers. Beginning in 1982, when quality and cannibalization became a problem, the average ATAT for eight Byron Jackson rotating assemblies increased to 575 days. For twenty eight Worthington MFP rotating assemblies (NSN 7H 4320-00-667-0085) completed prior to 1982. RTAT averaged 133 days. When quality impellers became a problem, RTAT for the forty eight Worthington rotating assemblies completed since 1982 averaged 431 days. [Ref. 19]

Several shipyards have taken initiative to improve piece part support. At two of the shipyards visited, P&E personnel have develop lists of piece part requirements for DLRs they routinely repair. These lists have been loaded on WANG computers and automatically generate job material list (JMLs) for those items that are open purchased. At Long Beach NSY the program has been expanded and includes an interface with SYMIS. This program generates MILSTRIP requisitions which are passed via AUTODIN to the supporting

⁹⁰pen purchases are for items that do not have NSNs assigned and must be procured from a commercial source.

DSP for piece parts that have NSNs assigned. At Long Beach the RRC shop planners also maintain a file in ARMIS which contains items that should be stocked in shop stores to support DLR repairs.

Table II of this chapter listed RTATs for both 7G and 7H COG DLRs. The majority of the DLRs that had excessive RTATs require a large number of piece parts or have parts that are difficult to manufacture or procure. If the DOP has the capability and capacity to manufacture these parts, SPCC should provide the DOP with separate funding and allow the DOP to make the parts in volume. If the capability does not exist at the DOP, the DOP should provide SPCC with a list of the parts that have been difficult to procure. SPCC can then procure the parts at the wholesale level. This list should be in addition to the list of parts creating a "G" condition for an item in repair, which is provided with the monthly refit reports. That list only provides those parts which need to be expedited because they have delayed repair of a DLR by at least 20 days. not consider future repairs.

Manufacturing Resource Planning (MRP) has been installed at one DOP to provide material for selected DLRs [Ref. 17]. Based on forecasted DLR repair requirements the MRP system pre-orders piece parts using lead times and frequency of replacement to have the correct parts available when the DLa is inducted for repair. Appendix C provides a brief description of the MRP system currently in use at Long date this system has only been used to order Beach. parts for two types of DLRs, both of which are managed by These are MSO diesel engines and sealed hydrolic transmissions used on auxiliary type ships (AFS, AO, At the present time this system has not proven to be cost effective and should not be exported to other shipyards in its present configuration. Efforts are continuing to

improve the MRP application and, in the long run, this type of system may prove to be applicable $t\circ$ industrial repairs.

The NARFs are installing an MRP system under the Automated Storage, Kitting and Retrieval System (ASKARS)/Workload Planning concept, which is more sophisticated than this shipyard system. An important feature of that system is that the local DSP will be responsible for stocking the piece parts needed by the DOP. NARF Alameda is the prototype for this new system developed by SPS Corporation and NSC Oakland is its DSP.

alternative to MRP is to modify the existing Material Requirements (MR) program. Some modifications have already been made to the MR program in SYMIS to accumulate piece part usage on DLRs. MR was originally designed to retain usage history on ship overhauls, but has been modified at Long Beach NSY to retain a history of the piece parts used on DLR. The history is retained by COAR and NSN. This was one of the reason Long Beach NSY converted from establishing a COAR per funding document to using a COAR for each line item of the funding document. Although this requires a little extra work on the part of the comptroller department, it has reduced the workload of the PCs. precludes the PC from manipulating the funds between line items and encourages more accurate charging by the mechanic. As DLRs are completed the usage data is added to previously completed DLRs.

When the MRP program was first started, work on the local MR program was halted. The local MR program works in its present form but is not being fully utilize and still needs some minor changes to be fully effective. With a few changes and a concerted effort by the DOP this program could be integrated with ARMIS and provide a basis for determining piece part requirements of DLRs. Appendix D contains a description and samples of the information the local MR program provides.

Charleston NSY is also developing a similar MR program that will maintain an automated data base containing historical JMLs and material order/usage data from previous ship availabilities as well as ordering data for current and future availabilities. This system could also be modified and incorporate the historical data on piece parts used to repair DLRs. A functional description of the capabilities of this new program is available at Charleston NSY (Code 229).

Several of the shipyards have complained that the requisition and receipt procedure that must be followed to requisition and receive piece parts takes too long [Ref. 12, 13]. Requisition and receipt process time is the time from the original identification of the requirement (written JML) until the part is actually received by the shop mechanic.

One shippard performed an analysis of requisition and receipt process time. The sample consisted of 26 requisitions for NSN material used to repair a DLR. The shippard measured the following times:

- 1. The time required for the requisition to be prepared and processed through the shippard's requisition process to the supplier of the material. All requisitions were for NSN material. The average time was 30 days.
- 2. The time required by the stock point to process the requisition and ship the material to the DOP. The average time was 9 days.
- 3. The time required for the DOP to process the receipt and notify the shop the material was available for pick up. The average time was 31 days.

Figure 3.10 and 3.11 are flow charts of the steps involved in ordering and receiving material at this DOP. Similar steps must be performed at other DOP. Figure 3.12 is a summary of the times involved to complete each step.

It includes the shortest, longest and average times. Under the most optimistic circumstances the minimum requisition and receipt time is 28 days. It should be noted that this DOP orders material using a "D" usage code¹⁰


The sample verifies that a problem exist with the methods employed to process requisitions and receive repair parts. Interviews with supply department personnel indicated that during the period of time the sample was taken the SYMIS computer was experiencing considerable down time and may have contributed to the excessive times reported. When SYMIS is down material can not be ordered or received. SYMIS generates the documentation, such as material movement orders, that must accompany the material as it moves from location to location. Only in emergencies will material be ordered, received or moved without paper work. [Ref. 20]

The study offered several possible solutions [Ref. 21].

- Order piece parts for DLRs with an "E" use code.
 This would eliminate the time required to stow material in DMI.
- Increase staffing in both order processing and receipt areas.
- 3. Develop a program to modify critical coding. 11
- 4. Restrict the use of critical coding to priority 1 or 2 and "G" condition material.

^{10&}quot; D" usage codes indicate the material should be placed in Direct Material Inventory (DMI) for use on a specific job. "E" coded requisitions, which the majority of the shippards use for DLR repair parts, indicates the material should be sent directly to the shop that initiated the requisition.

¹¹ For requisitions that are critical coded an automatic notification is sent via CRT to the shop that originated the requisition when the item is received.

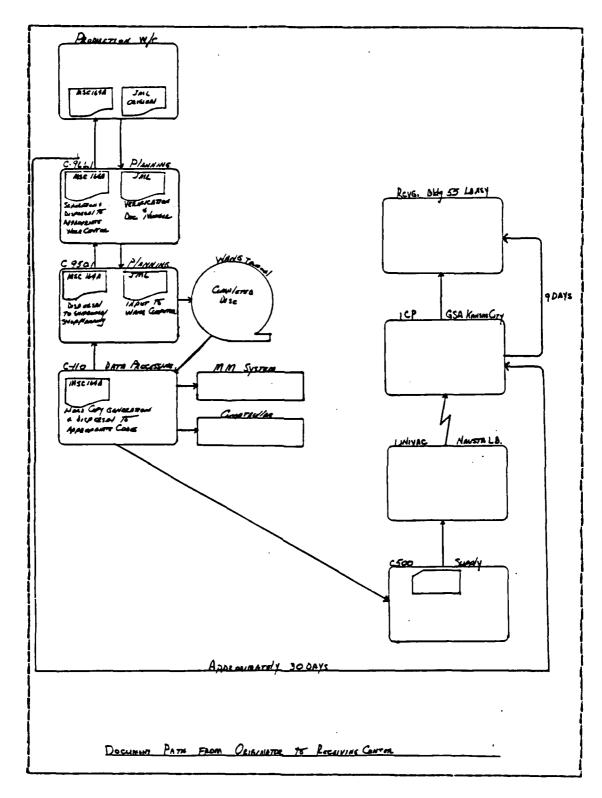

Pigure 3.10 DOP Requisition Process.

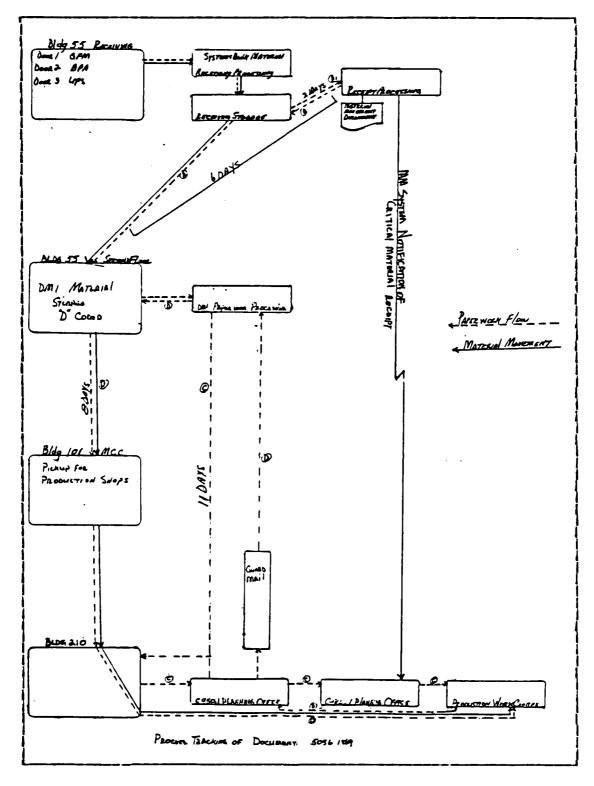


Figure 3.11 DOP Receipt Process.

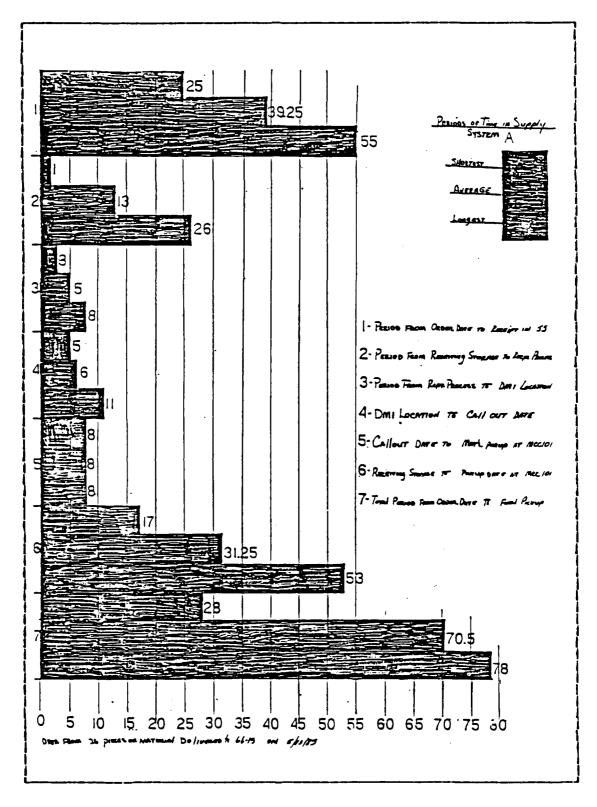


Figure 3.12 Requisition and Receipt Times.

- 5. Develop minimum time frames for non-receipt of material and automatically upgrade the requisition to critical and begin expediting action as soon as these minimums have been exceeded.
- 6. Update the material requirements list of P&E personnel and pre-order material when funding is received.

These solutions may reduce the time it takes to order and receive material at this DOP. However, several of the shippards visited use the "E" usage codes and still complain that order and receipt times are excessive.

[Ref. 14, 7]

A more effective solution would be to modify or streamline the procedures employed to order and receive material. This would require modifying portions of the SYMIS as well as shippard procedures and is beyond the scope of this thesis.

G. PRESERVATION, PACKAGING AND STORAGE

SPCC's position concerning P&P is that because the repair funds that are provided to repair a DLR includes P&P, it is the DOP's responsibility to monitor and take actions to reduce P&P time [Ref. 22]. With the exception of one DOP visited, P&P is accomplished by the DSP. Normally, each shippard will issue a funding document to the DSP to perform the P&P function. P&P involves protecting and boxing the DLR for storage and eventual shipment to the end user.

Currently there is no uniform way to accurately measure how long a DLR spends in P&P at either a DSP or DOP. It is possible to measure the P&P and storage times at those activities that use the UR-17 program and where the DSP performs both functions. If P&P is accomplished by the DOP this time is pooled with the repair-in-process time. If it is done by the DSP the time is included with the stow time. The ARMIS is capable of monitoring this time but doesn't

because the DSP performs the P&P function where ARMIS is used. Storage under both definitions is still counted as part of the DOP's RTAT even though the DOP has no control over this segment.

By measuring the difference in the time the ZUB (report of receipt of an "A" condition DLR) and the ZUD (report of storage) transactions are processed, storage time could be calculated. At two of the DSPs, the repairables clerk maintains manual records on PSP and storage times. According to these individuals, PSP and storage times average six to seven days [Ref. 23, 24]. One DSP is currently in the process of developing a UADPS-SP program to capture this time. When developed, it should provide both SPCC and the DSPs with information on what the actual times are. SPCC does not currently monitor this time [Ref. 9].

SPCC's definition of RTAT includes P&P and storage times even though the DOP has little or no control over these segments. When these times are combined with the induction time, the total represents a significant portion of RTAT that a DOP has no control over.

H. AUTOMATED REPAIRABLES MANAGEMENT SYSTEM (ARMIS)

One of the major problems faced by all concerned in trying to reduce RTAT is the problem of converting the data in SYMIS and the UICP computer systems into meaningful management information.

As previously discussed in this chapter the ARMIS system has been in use at one DOP for over three years and has proven to be an efficient and cost effective method of reducing RTAT. The system has also proven to be an effective management information system. The system is very flexible and has the potential to reduce RTAT even further.

The ARMIS system was develop and implemented at Long Beach NSY in 1983 to support the growing repairables program. When Long Beach was designated the DOP for over two hundred DLRs to be used on "LO-MIX" PFG-7 Class ships in the Class Maintenance Plan, it was anticipated that the repairable effort would grow from approximately five percent to as large as twenty percent of the shipyard workload [Ref. 17].

ARMIS uses a relational data base 2 computer system to store and manipulate data into meaningful information as well as to generate many of the forms and reports needed to manage the program. The system is extremely "user friendly" and requires very little training or programing knowledge to use effectively. The system manager was previously a shop planner and only required two weeks of training to perform effectively in the system manager role. In addition, with only two weeks training a manager or technician can also learn to write programs and extract information tailored to his or her needs.

The primary objectives of ARMIS are:


- 1. Accurate and expeditious generation of monthly reports supplied to customers and for in-house management functions. Information is updated daily using magnetic tape interfaces between SYMIS and ARMIS. Monthly reports are up-to-date and contain all the information required by NAVMAI'S Navy Repairables Management Manual.
- 2. Automated control and monitoring of the life cycle of DLRs from the receipt of a funding document through the final billing process. Appendix E contains a description of the information and data flow within ARMIS from receipt of a funding document to final billing.

¹²A relational data based computer systems allows the user to retrieve, sort and manipulate data from several files at one time.

- 3. Provide a catalog of all DLRs overhauled by the shipyard in a central file with easy access.
- 4. Automatically generate work estimate sheets, log sheets, induction sheets as well as management reports and listings. Appendix F contains samples of these sheets reports and listings.
- 5. Interface with the Customer Order Documentation System (CODS) and SYMIS. CODS generates a COAR for each DLR using standard information about the DLR, such as NSN, nomenclature, man-hours authorized, repair price, customer, and stabilized rates.
- 6. Retain a history of completed DLRs at the COAk and NSN level.
- 7. Monitor repair performance at the shop, work center and foreman level.
- 8. Automated forecasting of quarterly workloading requirements at the shop and work center level.

The standard information is maintained in ARMIS and updates CODS on a weekly basis via magnetic tape. ARMIS receives cost data from SYMIS, also via magnetic tape. This allows real time information retrieval. For example, much of the statistical information used in this thesis was generated by ARMIS. Data can be sorted and a report generated in a matter of minutes. Figure 3.13 shows the relationship and interfaces of the RMO, RRC, CODS and SYMIS.

To assist in workloading ARMIS uses the hours required to repair a DLR. By matching the workloaded hours with the man-hours available in the shops and work centers, shop planners can determine if the forecasted workload is adequate to support the number of personnel assigned to that shop. If not, ARMIS can generate a list of DLRs that will give the required workload. This list is passed to the IM for review and action.

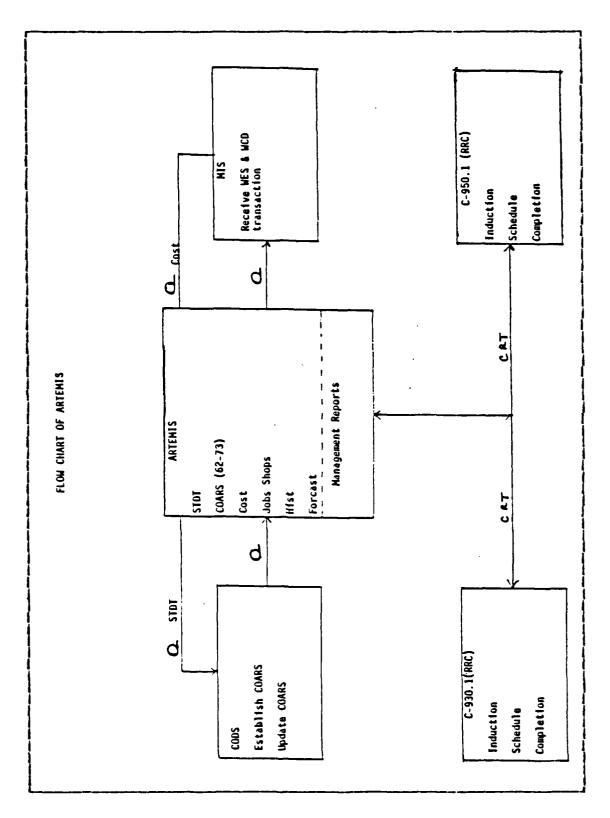

Pigure 3.13 RMO, RRC, CODS and SYMIS Interface.

As noted in references used throughout this thesis many of the problems associated with excessively long RTATs can be attributed to the lack of an automated repairables system that provides information and meets the needs of the managers. The ARMIS currently in use at Long Beach has eliminated many of these problems for one DOP. The system is owned by the Navy and can be exported with only minor changes to the software.

THE RESERVE AND THE PROPERTY OF

On a larger scale, ARMIS could be used in a network composed of organic DOPs, NAVSEA and SPCC. By allowing the customers inquiry access into the files at the various DOPs the need for monthly reports could be eliminated. As mentioned in the forecasting section, ARMIS could also be used to automate the workload by interfacing with the SPCC DATAPOINT system.

ARMIS could be modified to receive weekly tapes from SPCC and automate the workload in much the same manner as ASO and the NARFs have done [Ref. 6]. Long Beach NSY has requested a quarterly workload tape in the past, but has not receive one to date. A tape interface between ARMIS and the BOB on a bi-weekly or monthly basis would eliminate the need to rely on due-in quantities to set up DOP workload. As carcasses are received at the DSP they could be workloaded to the appropriate DOP.

From a telephone conversation with Metier Management Systems, Inc. (the developers of ARTEMIS)¹³ they estimate ARMIS could be implemented at other DOPs at a cost of \$230,225.00 per DOP. The necessary training is estimated to be \$40,000.00 for all DOPs. Metier is also willing to develop a "custom" course designed to specifically meet the needs of ARMIS users. Appendix G is a copy of the Metier's

¹³ARTEMIS is the trade name for a scheduling system develop by Metier, Inc.. The scheduling application of ARTEMIS is currently being installed at all shipyards. ARMIS uses the same system with the scheduling function disconnected.

response to a request for estimates on hardware and training cost.

Many of the recommendations made in this section are ambitious but they are also realistic and can be accomplished with NAVSEA's support and financial backing. A major factor in reducing RTAT is to provide the DOP with a computer system that is flexible and meets the user's needs.

I. SUMMARY

This chapter has attempted to provide a detailed look at the key issues that affect RTAT. Forecasting and the DOP repair process have been examined to identify problems and develop alternatives that, if implemented, may reduce RTAT. These alternatives will form the basis for the recommendation and conclusions outlined in the next chapter. The problems outlined in this chapter should not be viewed as all inclusive but as significant issues that must be addressed if RTAT is to be reduced.

IV. SUMMARY, CONCLUSIONS AND RECOMMENDATIONS

A. SUMMARY

The DOP repair cycle is a complicated process that requires numerous interfaces between various organizations, computer systems and people. As a carcass is moved through the repairables cycle these organizations, computer systems and people must coordinate their actions and ideas if they are to significantly reduce repair turn around time (RTAT).

At present, lost shippards are not organized to support the Naval Supply Systems Command's (NAVSUP) RTAT new goal of 60 days. In fact, the analysis contained in this thesis indicates that more than fifty percent of the DLRs repaired at naval shippards exceeds 60 days and that only approximately 65 percent of the DLRs completed meet the old NAVSUP goal of 90 days. If RTAT for all DLRs can be reduced to 60 days the Navy may realize savings amounting to more than 180 million dollars.

The thesis has examined each step in the DOP repair cycle to determine if the RTAT of DLRs managed by SPCC can be reduced.

Chapter II provides the reader with a general overview of the repair cycle as well as a feel for the complexities involved in managing the repair of DLRs. It provided a brief description of how SPCC determines the quarterly repair requirements and workloads the shipyards. A detailed description of the steps and procedures the shipyard must follow to complete the repair of a DLR was also provided.

Chapter III attempted to provide a detailed look at the key issues in each segment of the depot repair cycle that has increased RTAT and explored possible alternatives that can reduce RTAT. The impact of workload forecasting on the DOPs' repairables policies and procedures was also examined. The specific areas examined in Chapter III included:

- Institutional Issues
- Depot Organization
- Workload Forecasting
- Administrative Time
- Induction Time and Process
- Effects of Piece Parts on Repair in Process Time
- Preservation, Packaging and Storage

B. CONCLUSIONS AND RECOMMEND IONS

These conclusions and recommendations are based on the analyses in Chapter III of current practices and procedures associated with the DLR repair cycle. Recommendations are offered of possible actions to take to reduce RTAT for DLRs repaired at naval shipyards to achieve the new SPCC goal of 60 days.

1. <u>Institutional Issues</u>

Before any progress can be made to reduce RTAT to 60 days several institutional issues must be resolved.

a. Filler Work

To date NAVSEA and the shippard commanders have viewed the repair of DLRs as "filler work". Thus, the single most important action that can be taken to reduce RTAT is for both to support the repairables efforts, by insuring dedicated personnel are hired and trained specifically for repairing DLRs.

b. RTAT Subdivision

Based on conversations with personnel directly involved in the repairables programs at the shipyards there seems to be a great deal of confusion on the definition of the repair time SPCC is trying to reduce to 00 days. The confusion arises from the various definitions promulgated by SPCC and CNM.

For example, currently, SPCC measures RTAT at the DOP level as the time from when the DOP receives a

funding document and a carcass is available, to the time the carcass has completed the repair process and is stored at the DSP. This SPCC definition assumes the DOP is responsible for induction, preservation, packaging and storage times. CNM's definition of depot RTAT included induction time but did not include preservation, packaging and storage time. Even so, both definitions include functions normally performed by the DSP. Most DOPs have no control over how long it takes the DSP to perform these functions.

Therefore, RTAT should be divided into well defined segments with responsibilities and goals assigned to each by agreement between NAVSEA and SPCC. The DOPs should be responsible for:

- Administrative time. This is the time from receipt of a funding document to the time an induction request is submitted to the DSP or the Work Control Document / Job Order is delivered to the shop, which ever is later.
- Repair in Process Time. This is the time from when the shop receives a carcass in "F" condition until the carcass is returned to the DSP in "A" condition, exclusive of "G" condition time. Carcasses which are surveyed or mis-identified should not be counted.

The DSP should be responsible for the induction time, which occurs after the administrative activities and before the repair-in-process can begin. The DSP should also be responsible for the time associated with preservation, packaging and storage because these functions occur after the DOP has returned the repaired DLR to the DSP.

By dividing RTAT into these segments the managers at SPCC, the DSP and the DOP can concentrate on those segments for which they have control.

c. "G" Condition Delays

NAVSUP's policy of having carcasses returned to the DSP for storage and the cancelling of outstanding requisitions for repair parts when a carcass is placed in "G" condition has caused many of the DOPs not to use "G" condition for larger DLRs. Consequently, RTAT appears longer than it should be.

DOPs and DSPs should be allowed and encouraged to make local arrangements for the storage of the larger DLRs at the DOP when repair of the item is delayed due to the lack of repair parts. It is not normally cost effective to gather all the removed components, reassemble the item, and transport it to the DSP. The policy requiring the DOP to cancel outstanding requisitions and have the DSP reorder the material is inefficient and time consuming, leading to larger RTATs.

2. DOP ORGANIZATION

The primary mission of naval shippards has been to provide logistic support for the construction, conversion, overhaul, repair, alteration and drydocking of U. S. Navy ships and service craft. Consequently, shippards tend not to be organized to support a repairables program.

To provide such support requires a centralized authority and responsibility to effectively and efficiently manage the regainables program. NAVSEA has already authorized and approved a Repainables Management Organization (RMO) at Long Beach NSY. NAVSEA has also approved the Repainables Rework Centers at two shippards (Long Beach and Norfolk NSYs). The RMO and RRC concepts have proven they can reduce RTAT. These concepts should be expanded to all shippards that perform a DOP function.

3. Worklcad Forecasting

SPCC's workload forecasting drives many of the policies and procedures used by the shipyards. Based on forecasted workloads, DOPs plan manning and repair parts requirements to support the repairs of DLRs. Due to the inaccuracies of these workload forecasts the DOPs have been hesitant to dedicate personnel and facilities to support the repairables programs. In addition, the DOPs are hesitant to order piece parts in advance using the NIF corpus funds because they are concerned the parts will not be used.

SPCC should attempt to improve the accuracy consistency of the workload forecasts. Efforts should also be made to automate the workload scheduling. DATAPOINT computer system is used to generate the quarterly workload for each DOP. The Automated Repairables Management Information System (ARMIS), currently in use at Long Beach NSY, is capable of accepting a magnetic tape from DATAPOINT with only minor program changes. An interface between the Shipyard's Management Information System (SYMIS) and DATAPOINT is possible but would be difficult to program and do very little to reduce RTAT. The shipyard MIS is designed to manage the overhaul of ships where ARMIS is designed to support a repairables program.

4. ADMINISTRATIVE TIME

Administrative time is the time required to process funding documents at the shipyard. This time includes preparation of all the documents necessary to induct a carcass for repair. This time tends to be excessive at most DOPs. In some cases, the time to manually prepare the documentation necessary to repair a carcass exceeds 60 days.

As a consequence of developing ARMIS Long Beach NSY has been able to reduce administrative time to less than one week because ARMIS automatically generates many of the forms and reports needed to manage the program efficiently. Interfaces between ARMIS, SYMIS and the Customer Order Documentation System (CODS) have also been developed. Additionally, ARMIS provides meaningful management information upon request. This system is extremely flexible and should be exported to other DOPs. Only minor programing changes would be needed. It is also "user friendly" and most changes could be made with as little as two weeks training.

ARMIS can also compute the times for each segment of the DOP repair cycle.

5. Induction Time and Processes

Induction time is the time it takes the DSP to deliver a carcass to the DOP. The process by which the DOP makes inductions as well as the time it takes for the DSP to move the carcass to the DOP typically adds at least one week and often two weeks to RTAT.

The recently developed automated induction program (UR-22), which is part of the Stock Point's Uniform Automated Data Processing System (UADPS-SP), is in use at Mare Island NSY. This program has reduced inductions times at that DOP and could do the same at other DOPs. The UR-22 program should be made available to all DOPs. However, because the UR-22 program is part of UADPS-SP, the DSP must initiate a request to Fleet Material Support Office, Mechanicsburg, Pa. to have it installed [Ref. 16]. NAVSUP should encourage the DSPs to use the UR-22 program to reduce RTAT as well as speed the induction process for the DOP.

At some DOPs and DSPs, losing carcasses after an induction reguest has been made has delayed repairs. Signature control should be used to monitor the movement of carcasses between the DOP and DSP.

All DSPs should also send representatives to the bi-annual workload conferences. This would foster good working relationships between the DOP and DSP as well as allow the DSP personnel to take an active role with SPCC in solving the problems associated with inductions, preservation, packaging and storage. By obtaining advance copies of the workload forecast, DSPs should pre-stage carcasses at or near the DOP and communicate with SPCC about shortages.

6. Piece Parts and Repair-in-Process Time (RIPT)

The lack of required repair parts from both the Navy's supply system and the shippard's supply departments and, in some cases, the poor quality of the parts that are supplied have resulted in excessive RIPT. Historically, the


lack of initial provisioning of piece parts for new major weapons systems to the depot level has caused many of these problems. Today, the Department of Defense is requiring that more emphasis be placed on logistics support of new weapons system procurements. This should improve the availability of piece parts in the long run.


Quality control of repair parts purchased by the Navy's supply system has also been a recurring problem. For example, the repairs of some Main Feed Pump rotating assemblies have been delayed over two years waiting for the supply system to procure acceptable repair parts. For parts that have Defective Material Reports submitted, the Inventory Control Points should impose quality standards in the procurement contracts and ensure the vendor meets those standards prior to accepting the parts. Accepting repair parts based on form, fit and function criteria is unacceptable when quality problems have been identified.

Several of the DOPs complained that their requisitioning and receipt processing times take too long. At one shippard, a sample of 26 requisitions for repair parts stocked in the Supply System revealed that it took an average of 69 days for a technician to order and receive the part. To correct this problem, the procedures used to order and receive material at the DOPs needs to be streamlined.

Additionally, DOPs' shop stores do not carry many of the repair parts needed in the repairables programs. When lists of material are provided to shop store managers by production workers, an effort should be made to carry those repair parts that meet shop stores criteria.

Two shipyards, Long Beach and Charleston, have expanded the Material Requirements (MR) programs in the SYMIS to capture piece parts usage on past ships availabilities. Long Beach has modified this program to also include piece parts usage history on DLRs. Using this information a

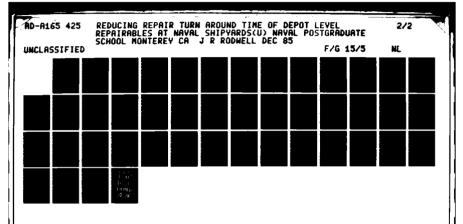

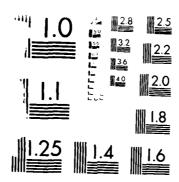

AND THE PROPERTY OF THE PROPER

MICROCOPY RESOLUTION TEST CHART

NATIONAL BUREAU OF STANDARDS-1963 A

DOP can more accurately determine which repair parts and in what quantity are needed to repair a carcass. A crossfertilization of ideas between Charleston and Long Beach NSYs should be encouraged on this effort and when de-bugged, these programs should be made available to all DOPs.

7. Preservation, Packaging and Storage

SPCC's position is that preservation and packaging is the DOPs' responsibility because they are funded to accomplish these functions. Usually, however, the DSP performs these activities. As a consequence, preservation, packaging and storage should not be included as part of the DOP repair time because the DOP has no control over how long the DSP takes to perform these functions. In addition, although the DOP is funded to provide the preservation and packaging function it is not cost effective to duplicate the facilities that exist at the DSP.

Preservation, packaging and storage should be assigned to the DSP and should be measured separately. SPCC, in particular, should develop a method to monitor this segment of the repair cycle to quantify the impact on RTAT. Finally, efforts to reduce the time required to perform these functions should be directed to the appropriate DSP.

APPENDIX A SPCC WORKLOAD FORMS

DCP, N68884A				41	QUARTERLY WORKLOAD FORECAST		, ,				PAGE:		
CCQ RSN TILWARM PARTICE WIND NO.	83	- 40	IA. WANHOURS IS. MIAI S. MIAI S. MUNICAL BEIS IA. MEPAIR COST		ALFAIR DUES	710	FORCAST COTA 1 OF	T T T T T T T	4 610 6 8	4 101AL		030000	1
702C 6625-98-0041142 1021 561 60-0041142 1021 561 60-0041142 1021 561 60-0041142	2							9	i	1	9	0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0	
		· – – ! -	- ****				HR FORCE	7	TEM-	-	•		:-
10 000-00-00-00-00-00-00-00-00-00-00-00-0	ā 			1655				-	9		•		
		- -				-	2	-	-	-		54,246	
CHCCUT CARC ASSEMB				000			DEMARK B						
10 CICO				700									
7010 1800-8888188	2		- ال			-		-	ر	-	•	\$2.694	
132-216 132-216 1-23-210 (V-272/U, CONVENTER (V-271/U, CONVERTER (V-271/U, CONVERTER			• •	050 40			2 2 2 2 2 2 2 2 2 2						
	- -	- -		230		•	۲۲ پر	•	•		•	814.618	
CUPCULT CAND ASSEMB			\ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \	200			REMARKS						
C-ssstucelly, corr			 	300								1 1 1 1	1
764A 5968-96-8682831	ž	-	۔ ع		NATIONAL STREET	=:	=	=			: 0	913.010	
61828683-21-11 61828683-21-11 1 84-38678/031 6888 68		-	- 00.	125		!	= 1	Keck	Sees	Chack class on to	9		
AM-UBB7/URT BER F1-F		- -	- 30.0										
-	_	:			-								

CONSOLIDATED STOCK STATUS REPORT (UADPS-ICP)

Г	Ţ	Т	7	٦	П	T	П	T		٦	49	ĺ.	-	I	╗	Ī			Ī	Π		П		_		Т	$\overline{\cdot}$ T	T	T	_	Ţ	Т	T			Т	\neg		Т	T
1	1	5				8 8	Ę	000		26 3	Transfer Pro-	5	8	2						7	7																			1
		90	OF ASONS	3	STANDANG UNIT PRICE	1140.00	P		3	- 1		7		\dashv	ļ					1	E		ļ				-				l								-	١
	STOCK MUNICER	po po62031	8	99CKEPW		12	LANET DARK	6	BEPAND.		NEPARABLE NO CODE			-	ĺ	1		_			$^{+}$	+	-			\dagger	+	1		_	 	\dagger	┪	_	۲	+	_	\vdash	 	t
		5885	-	-	SNIC	BANK	LANTE	7		32.	20			┥			Ŧ				1	ł				١							ĺ							
-	1	됩	£	5	-	+		,	PROC SAF	93	2 8 5	2	MOd	-					<u> </u>	100	+	-61	_			+	+	_		_	-	~	\dashv		-	+		-	-	+
-	<u>.</u>	4	_	6	3 4	_	ă,	_	0		100 P		RHAUL	\dashv			906 18					- 1						ļ			1	-			Ì	ł				
PANA P	1/0 1/16	=	MISC	. 135	1 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0	٦	WAINT DVIE			33.	_	•	DESIGNATED DVERHALL POINTS				6				1	4			L	1	_				ļ	\perp	4		Ł	4	_	_	!	1
֓֞֞֞֓֓֓֓֓֓֓֓֓֓֓֓֓֓֓֓֟֓֓֓֓֓֓֓֓֓֓֓֓֓֓֓֟֝֓֓֓֓֓֓	130	PHI AAVB	PACKAGE	-	PROC	}	-	—	END OF 17		123	2	IGNAT	┥		-	I.									1		- 1				İ	1			1		ļ		١
2	2	=	90	į	0 ,		OWK	000	Ž,	_	- 5	315.00	S		IE.	0	200										_ }								L					1
<u>}</u>			2 = 1	8	PROGRAM VALUE ROCKAM VALUE IND I MAINT PROGRAM VALUE	1	: 1	12	DUMING IT KEES/DEFIG		MEPAIR URIT COST	3.5			100 Call		2			İ											Π		PC(TO			T				1
SIAIUS REPORT (CAC) SICI		3	CIME		3 5		WANT.	02	<u> </u>	-	3				**		ž	L	L		\perp	╛			Ļ		_	_		_		\downarrow	!		L	_		_	_	1
5	7	R COUP	~ =	8	MOCA	_	25	38.87.0542	100	172.1	NEPAIR ORDER	2	MEPANA AISK	. 135		0	HAND			-		1				Ĩ				-		١	PC (FR	-	-	4	< <	4	4	-
	IIEM MAIM	10	CAOSS WEIGHT	8	3 2		END OF LT	Ē		L	P. O. P.	Į.			A CALLAND		8															}								
<u> </u>	-	PPC, DIR	_	Q	DAM VALU				MI ASSETS		8 2	13	147	. 67		2	•••	4		44	₩.	4 4	•	<	4.	- 3	<u> </u>	4		-	A	4	٠		<u> </u>	ښو		دست		\exists
2		DQV	7	00g.	FACC		1 201	:	į	L	REPAIR		SUMVINAL	8		99365	is E									}				}			DATE	1380	11348	99670	9	0.52	84052	ļ
	_		1 SC#		P. P.		3.5	0	E P					Ċ	_	=	L		\perp		\perp	- 4		_		4			_	_	1		۵	Ľ	1			1	-	
ا د	UNIT PRICE	1254.84			MEXI BUT DATE		DEMAND IT NOT ALLOW BATT	197.9	DUE MEDICALCY				140	Š.	100 100		MESUPPLY POINT			1	1		ı		Ī		-			ľ	Ī		414	ĺ					1	ļ
SIOCK	įŝ	=	# 3000 # 5000	۵ ا	_	-	_	-	5	-	=	2.1	AVG	9		2 2 2 3 2 3	_	_	+	+	_		_	 -	ļ	4	_		L	_	1	_		1	120	-	F F	- 6	<u> </u>	4
		2	\vdash	5	58.		VARIANCE	1542		i	BCD# OADER OTV		<u>. </u>			>	100			=	•	-			1		•			'	6		DELY	15009	1525	05277	527	300	85179 85179	١
ξ.	T		WOWN DATA		EÌE	3	* 3	+	H	+		H	ij	6	1	L		╀	┿	+	+		_	╄	╀	4	_		-	┞	+		8	-	+	4	_	+	+	╣
CONSOLIDATED		2	NOW 2	00 QH	323	3	- 5	8	S E		SEPAN NAR'ANCE	100				-	2									ĺ					1	ľ	>	E -	╌┝	- ~	- «		40	Í
2	#				10 CT X X X X X X X X X X X X X X X X X X	7142	DENAMO FORCASI	33.000	DIMER CONDITIONS	1	-				20 2 C 3 C		H	╀	╀	+	+			╁	+	-		_	-	╁	+	-{	5	┼-	+	-	_	+	+	-
- 4	F	10	\$ 10.00 0.00 0.00 0.00 0.00 0.00 0.00 0.0	٠	J R		ON N	_		2	ROUDEN	.65		6.5604	20	22	3	<	4 <	9 4	•	0 4	۹.	4 -	4	<	٠ .	(()	4 <	4.	1	۱ ح		4	3 10	<u>+ N</u>	2 :	712 712	<u> </u>	_
	06 V 6 V 30	72152	in a	8	7.5	6	BURNIER	ē	°	5	2=		-	-	Ni ing	15	1	8	98	88	3	8		2 0	Î	Ì	3.025	8	1.203	1	36	2.313			ŽŽ	Ź	Ź	Z Z	ZZ	
	_	-		0	2 . 2	-		•		3	11.11			İ	L	1_	9		1	:	:	Ċ		[]	•		6	·	-	'	-	~	FROM					84	74	
}	ADD DATE	72091 P	3	ē	MESENTION WOLLDES	32	A STORE		AEGENERACY	Š	35		35	=		X .	BANDON DEVAND	÷	十	+	,		-	+	+	_	-		\vdash	╁	†		<u>۲</u>	_	†		-		88	
		1 10	-				3	-	200	2	1		CANCASS	Ì	_		MOON								1								Ū		1		ļ	ð	00	,
	•	4 9	100			0	A STATE	2		5	BCHED PPR		Ť	Ì	0		2	1	\dagger	•	,	_		+	4		-		1	\dagger	7			1	1	_		\perp	\top	_
	201	0000	A ATICH		100		13	╄	-	+	28	=			١	1399		5					1								1		CALL	9772	0781 7333	586C	0660	716 718 718	759	;
	⊢		15	1	7	1	SAVA F		4	2	MATERIALS OBLIGATIONS		30	1	Š	1		. 1	35	١	١	 8		9 9	ě	•	5		88		2 5	2 2	ENT	1777	200	340	43490990	217	84V4759	_
	9	5007	ACTIVE POPULATION		ACON WAS		DEMAND COSERVATION - COMPLETE TO THE PERSON OF THE PERSON	1	COMDITION CODE A	9	. 1	5	CANCASS BETURN 085		51		\vdash	Ť	7.0	Ť	+			70	1		"			+	1	, <u>uz</u>	DOCUM	FENGEN.	NOO40643320781	65.0	NO065	N6264943490440 N0010484V4759	00 00N	-
	3 2	2	ıl T	1	_		1777	2	1000	DNA HAND	010	-	12 1	-	NCV.	٥	2						_		1					_			8							_
	PAGE	20152			PR:OR			\$	1	5	1		CANCAS		SACE BOVY	5	┛.	2	77	ZWN	Z Z	ZNZ	NR Z	M82	9	2	202	2 2	MAN XX	NX.	2 2	72N	10	851	9 5 9 5	źš	Š	ŞiS	200	,
!	_	<u> </u>	1		-	ـــ	<u>: :</u>	1	-1	-	<u>-</u> -	<u>. </u>		<u>.</u>	127	:	<u>:</u>	_	÷	_		_		<u> </u>		_				_	_				_		<u>. </u>			_

CONSOLIDATED STOCK STATUS REPORT (UADPS-ICP)

PARASTA BERKERA TOTALIS BERKERA BERKER

	i	ī	\exists		TH	T	1.01	11	T	7	_	T -	Τ-	_	_	1	T]	-	_	_	Т	-	_	T	1		·	_	1	
	1	5 00 0062031	-	2 2	AVO	1	Thursday of the same of the sa	E 8	_		2					28						}				}					
		2062	EASON S	STANDANG UNIT PRICE	MANGOU DEMAND AND	0 - E		$\dashv \Pi$	$\exists \mid$	'	RJ ADV	1987	198	2	DE L	3 2				•			87	8							
Clock in post		8	2-		200	RANDOM	NEPANANE ID CODE			-		Z					+			_	E		9		╁	+	_	-	╁	+	-
3		2882	-	2	NA W		120	2	\dashv	7	CODE	MAAAM	NA A A	NAAA	MNYYN	NAME OF THE PROPERTY OF THE PR			OT NO		26.05	26.00	72 06	SEC							
		3	\$			PROC 147	185	- 0		\vdash							+	-	5 8	5	776		-		+	4			+	+	_
-	2/1	-	25.00	A A	8	- E	2 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0		-	2	TY REGO		55556	6666	0521	86.15	ļ	1					-	ך	}						
A Person A		_	•	HOGERAL VALUE PROCREM VALUE PROC 14 REPART AND PROC 141 REPART AND	STAINT DUT	25	ix i	DESIGNATED OVERHALL POINTS		ļ.	Ē	•	101	9-1		1-	_	Ž	7.7		5	1	_	L	Ļ					_	
	2		PACKAGE	PROC		By Media	225	TIGHT	18	200									CLS	1	0007.5	2 6	0	E D		1			1	ŀ	
	2		20		WAS DVH		اءِ	ă	• 5	- ^{3°}	9	9	95			2 2	ļ		3000				RD880943494102	* 46 X							
			CUBE	3 8	3	NET 5751	NEFAIR UNIT COST		TITLE BY	3	S	GEOSUP	GEOSUP			22 R	Γ	REF	ם ום		MOGES 143	36.83	943	743	Ī					Ī	
			ğ 3	3 2	DANNE		┧╣	411	FRE	ğ	ه د	بحو بحد	44.	1	ł	1		<u> </u>	1	<u> </u>	٥	Š	98	<u> </u>	1		_			1	_
			* ž	100		Mr. NEGEN DURING LT	REPAIR DADER	REPAIR		OH HAND	ACT.	ž	2 ≥	3	Ž	NG558032623985 NNZ		*	4							Ì					
			640\$\$ WEIGHT	3 2	DEWAND END OF 11		128		AND BYAN	8	=	١.		10010441112879		98		Ž					8		2					1	
	-		+			A1 A5SE18		REPAIR		_===	3		Ž_	=	r os	2 5 5 5 5 5 5 5 5 5 5 5 5 5 5 5 5 5 5 5	Ţ			_	7	, ,		D (†	_			+	\downarrow	_
,	Ì		4	1000	100-104 BAN	2	REPAIR LEVEL	7 3	1 5 5 5 5 5 5 5 5 5 5 5 5 5 5 5 5 5 5 5	250	00CU	DLR OSI	DLR OSE	000	SAUDI FDS	580			2	02 001	770 26 OF	26 02	90 97 158	88		ļ					
-		-	4.8CM	NAME OF TAXABLE PROPERTY.			7-	SURVIVAL		۳.	1	36	22	ğ				4	5	ğ	70.00	2	- F	9					1		
MEN ACCIMENT	Ž.			BUT GATE	DEGLAND DUMMO 11	DUE IN THE CENTERALLY		PROC	40001 (W	RESUPPLY POINT	ADV DI	8		200	ē	9 0				l			_	-	-		÷	Ŀ		1	
MENACE	Ē		CODE				1	PE V	105		è						8	‡ <u>‡</u>	à		5	1	_	L	1	핓	_	Ĺ		1	
-			30	- [1]	VARIANCE	N F	ECON ONDER GIV	=		- is is	CODE PRJ	19	1 99999 ANYYYN 798	2 99999 NNYYN PLO	9122 NAVIVAN CLS	BGOOL MINKYN UA4 BTOOL MINYYN UA4	Į		כרצ	;	5:		2	5 8	3	8					
	-		4 P	-	- 5		8	- E E		35	3	Z.	2 Z 2 Z	Ž	ž	X X X X	<u> </u>	_			8	5 8	80	72004320AZOT	3			_			_
8	티	-	MCMI DATA	Ş		2 5	REPAIR			111	2	Ź	ŹŹ.	ŹŹ	Ź	Ź Ź	\$	1 = =	COO	0			240	2010		ō					
i la la la la la la la la la la la la la	F WATER FAST			TOPCHASE	120	200	# S	121	Parkette	-	000	16	666 666	666	2 2	GOOT MAYE'S UA	8274 - MILIN	┷-	AFPL	3300101	BACKORDEN DOC/S	W0005143450989	PTKB4240480454	22		Ĕ		L	ļ	1	
1_	•		1 E	15 6	CHUAND TORCAST BUANTER NEON	CIPE CONDITIONS DE HAND DUE BUT	# z	97.6 111.6 12.4 12.4 13.4 13.4 13.4 13.4 13.4 13.4 13.4 13	285	1	Y R	40	1 99999 MNYYN 798		-	- -	Ŧ	111	4	P	ā 3 	۽ 	à,	ĕ 3	2	•					
-	DEMAND			Practice term	ON T	2 2	REGADER	27.			10	T	1.	T	\vdash	†	Ť	000784717		i		0 0	8	2		₽ >		\dagger	\dagger	\dagger	_
		_	-		+		1.	7	Main.	NONECAST	١.							8		İ	PR-28					푱					
140	REASON		S VC	4 and 4		EUF BUT	247E1			5 <u>-</u>	SUPAD	<u> </u>	NRZ A GEGSUP	<u> </u>	SA	0003 M2-6-801951	15 2	<u> </u>		N		31	_			4	•	-	- -	1	_
	_	L		None Maria	T T	ON HANG COE		CARCASS FORECASS	1 1 1	- NOON	P SU	3	8	9	6 CL3	9 2	A - 22A	15E	PCT	8 T	PRUPU	Z.			LKS	98 04			- -	4	
	1 4		0111		-EP	A A S	SCHED SEA	25	2 8	200	2	12	22	2 2	¥ 2	77	- 7	_ ur	_		٠,	2	-	<u>.</u>	3	RON OB		<u> </u>	1	4	_
- t-	_	_		J 20 0 0 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1						CUMP OBS	70	ZZ	ZZ	2 Z	jz Į	2 2 2	¥	NE IN 1889	5		Ē					9 P				1	
2	40	<u> </u>	NATIO VAN		_[1	_ a	A PIOUS	 	1			L	<u> </u>	8	È	_		7 3		-	5	ا				S10P	_	<u> </u>	1	4	_
905	40	200	ACTIVE POPLAATION	ACON VAN	DESERVATION - EURAENI DUANTE BUNE SCRED NEON	CCD! A	MATERIALS OBLIGATIONS	EARCASS RETURN OBS	E 25 M		DOCUMEN	Z	DUR OST	NO0104020V011 NNZ A GEO	PSRKAGEOUTTY	MOD FISTP	N655863363	 	ਰ		2000	M624/84324/060	90440	1159	3	2	9 9	¥	O A	0	1
1	_	4	1 2 2		-191+	1010		101	528	- 25	8	N ON O	2 2	2 Q	N A	9 9	999	ANA TE	900	6	100	700	34.	1435		T da	84225	84226	84225	94225	84225
PAGE	M.CAMBE R	20152 A	11	Dis-05AL	UAME	DENTE NO	BACE ORDERS	MAINT	#CV4	—		<u>5€</u>	= = <u>함호</u>					₩ ± ± €	1 2	92300710	BACHORDER	N624/84324	2649	#20025435	No. 14433			160	210 210	910	
	ž	12		2 2		l le	1	2	3000	¥Ç.	0	200	888 898	8 P B B B B B B B B B B B B B B B B B B	9 5	90	9	#	APPL	5	5	2	2	#22	Ž	ACT	R52	100	2 18 2 18 18	BIE	2 2

A. 17 P. A. 7GH 5985 DO DO62031 Ä DESIGNATED OVERHALL POINTS BUT GATE MAME DOWN WALUE FROCHAM VALUE END THUMH PROCHAM VALUE
OUT GATE MAME DOWN PROCHAM VALUE MAINT DOOL WATHER DOOL 3 11 F JGF DURING LE KCES/DEPIG END OF LT 3 5 5 STATUS REPORT (UADPS-ICP) 200 200 38 ÿ MEPAIR Unit COST מתב סתנ GUSS -REPAIR ONDER NY DUE IN PLEASETS REPAIR LEVEL MESON IN CAR STR. SE DEMAND OURING LT CONSOLIDATED STOCK AVO AVO i · i BCOK DADER GIV Ĭ 1 1 3 THE DIE DEUTAND FONCAST BUTANTER WEEN 123 1 to 1 ng Caben 114 con 23.6 STOP RON OB OH A OH W O ю DE PARIO DE BUY METERICA POLICE \$4.21v DEDAND DESTENDING TOTAL OUTSIER 20,00 CARCASS FORECAST 20 SCHED PPR 900 0 416 100 HON CODE A Ì EARCASS RETURN OSS BACK ORDERS ONTH MO SACE RCVV


1 2


•
•
Ç
•
œ
0
-
•
0
-
×
Œ
ā
£
œ
=
•
٠
=
ã
_
Ü
ŏ
×
-

Andread Beneares and the second benear the second of the s

;		į				į							9	•		
903		ASN	SMIC	<u>د</u> :	ည္ : မ	<u>ا</u>	EXTR	EXTRACT DATE: 84353	84353		STAN	STANDARD PRICE:	: 35	•	81,140.00	
7044	3985	5985-00-0062031		PE		•	CURR	CURRENT DATE: 84357	64357		REPLA	REPLACEMENT PRICE:	PRICE:		\$1,254.84	
	ITEM	ITEM NAME: APC, PPC, DIR COUPL	PPC.	DIR CO	JOPL	EQUIP	MENT NAM	EQUIPMENT NAME: AM-3007B/URT, AMPLIF S2300709 EP UUT	AM-3007B/URT, AMPLIF S2300709 EP UJ7	7116	NET P	NET PRICE:			\$501.00	
	PLT: RIAT:	5. 10 62	REO DEM	REG. FREG.: DEMAND:	:: ~	800	32.000	REORDER LEVEL:	/ON! SEN LEVEL: EVEL:	2.5		0.0		CRF: 35.9		
						8 2	OPENING POSI 7 1 ON	0	8	90	•			9	5	. 3
REQUIREM	ENTS:	REQUIREMENTS: 10 1 BOB, DOB 		- CASREPIS - DOS			7 8	▼ 8	1 2				:	6	• • • •	·
		DEMAND X RTAT DEMAND	141	ģ	22:	22:	9.6 9.6	e '	80	80	n	90	8.	38	8	ê
		ALL UINEN FFMS - FWKS REPAIR SAFETY LEVEL ECONOMIC REPAIR QUANTITY	ETY LEVER	VEL		=	86	386	7 8 8	8 8		9.00	* 6 6	66 6	8 8	6. 6.
		TOTAL REQUIREMENTS	EQUIREN	TENTS				158	178	=	-	: •	201	214	=======================================	117
ASSETS:	204	ON HAND DUE IN (DOS/A2) BY QTR FUNDED REPAIR (BSI/DDS+)	S/A2) 11R (BS	BY 01	# •		400	408	8	32	G	32	33	163	32	320
		TOTAL ASSETS	SSETS				:	52	23	32		32	32	163	80	82
	i	REPAIR REQUIREMENT	REQUIRE	MENT			,	133	152	159		,	175	ē	8	63
	e U	CARCASS RETURN FORECAST PRODUCTION QUANTITY	TURN FC	DRECAS			- 9 8	23	= 1	$\vec{\chi}_{3}$	_	Ī,	£ =	78	#\vec{k} =	** =
	# U W	REPAIR COST CARCASS CONSTRAINT ESTIMATED BUY OTY	VSTRAIN TUY OTY	ξ.				\$5,670 \$126 126	\$ 10,080 \$1	\$10.080	\$ 10.080 148 22		\$ 10,080	\$10.080	\$10,080 28 21	\$ 10,080
	UNITS	1ST QUARTER TS M/H		DOLLARS		UNITS	2ND QUARTER M/H	TER DOLLARS	S UN118		3RD QUARTER M/H	DOLLARS		41 UNITS	4TH QUARTER M/H	R DOLLARS
1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1		0990		\$2.835 \$2.835 \$2.835	0 10 10 0	0200		\$10,080 080 08				\$ 10,080 \$ 50 \$ 50 \$ 50	2222	0200		\$ 10,080 080,018
TOTALS	:		:	\$5.670	:	32	• • • •	\$10.080	:	-		\$10,080	. 0	32		\$ 10.080
	UNITS	15 M/H		DOLLARS	s,		900	2ND QUARTER:	TER: M/H		QUANTITY		3RD QUARTER:	TER: M/H		QUANTITY
IST VEAR 2ND YEAR 3RD YEAR 4TH YEAR STH YEAR				\$35.910 \$40.320 \$40.320 \$40.320	000010	`	Nossar A Level	=- -8	=		¥ =	•				32
IMS	IMS SIGNATURE,	TURE,		SEC	SECTION HEAD	EAD		BRANCH HEAD	AD.	5	DIVISION HEAD	HEAD	•	GROUP HEAD - CO	00 - C0	


APPENDIX B
RRC PUNCTIONAL FLOW CHARTS

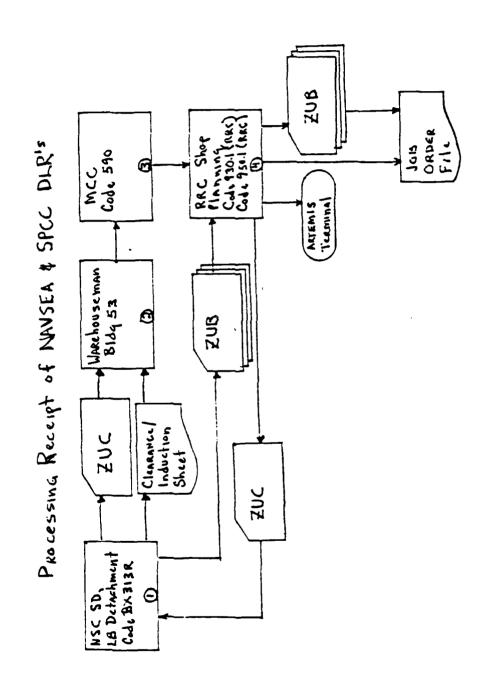


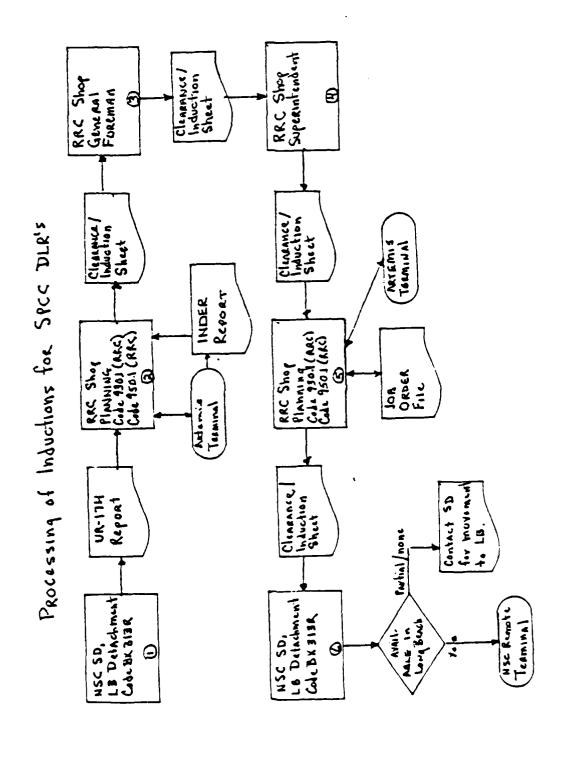

THE RESIDENCE OF THE PROPERTY

PROCESSING OF INFORMATION WORK CONTROL DOCUMENT (WCD)

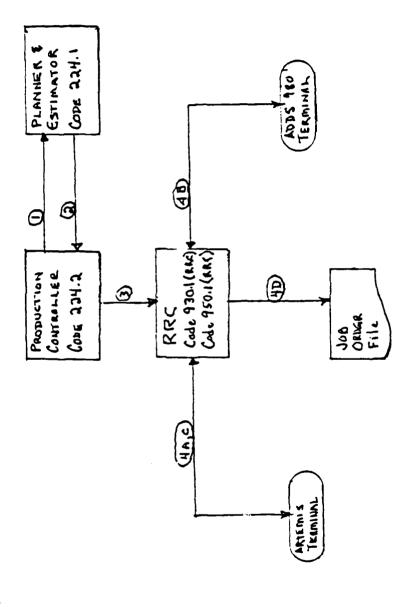

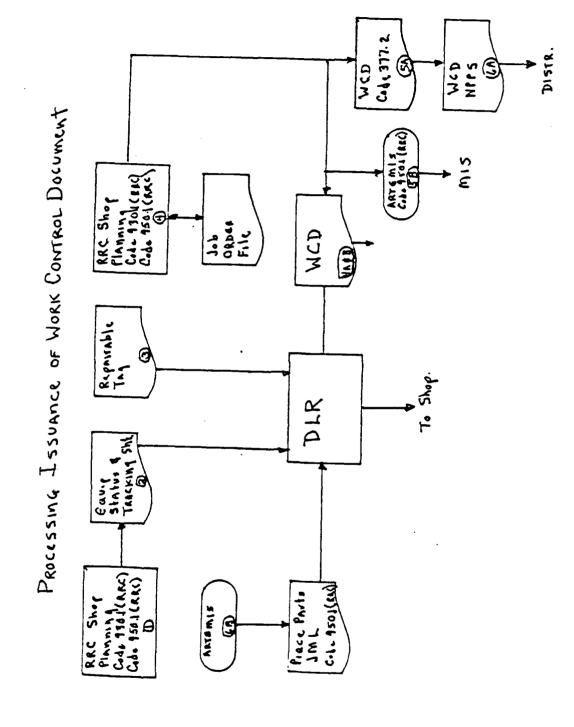

APPENDIX C LONG BEACH MSY MRP SYSTEM DESCRIPTION

USER PROCEDURE MANUAL

DATE 04/18/83

THE REPORT OF THE PARTY OF THE

SECTION NAME

SECTION PAGE

Objective:

The objective of Manufacturing Requirements Planning (MRP) is to plan and control material for the repairables program. The system is a timely, accurate, easy to use, shop-oriented tool for managing material used in the overhaul of major repairable components.

Closed Loop Concept:

The Closed-Loop Manufacturing Resource Planning (MRP) system is a proven, comprehensive planning and control system for resources (material, labor, and facilities) required to meet the overall business objectives of the Shipyard. This closed-loop system for the Long Beach Naval Shipyard (LBNS) begins with the planning activity. This includes determining which components are to be overhauled at LBNS, by quarter, and then developing a more detailed Master Production Schedule of when each overhaul is to be performed for the overhaul's within the nearest quarter. The term "Closed-Loop" means that there is timely feedback between the execution and planning functions, which will ensure proper actions are taken when changes in the Master Production Schedule occur. For example, if a job order cannot be completed on time, this information is fed back to the Master Production Schedule so that adjustments to scheduled due dates of other overhauls can be made and the proper management action taken.

Once the planning phase is complete and the Master Production Schedule has been tested and is attainable, the execution activities begin. The execution activities include detailed planning, ordering, and monitoring of each job order and its material requirements.

System Functions:

The MRP system performs a broad range of important material planning and control functions. These functions have been logically grouped into different application modules. The material-related MAC-PAC modules, which are implemented at the Shipyard, are briefly described below:

(1) Design Engineering - This module maintains the Part Master File and the Product Structure (Bill of Material) File. The Part Master File identifies each part number in the system and describes how it is controlled in the storeroom. The Product Structure File defines the bill of material for each major repairable component. This product structure lists the materials, by part number and quantity, required to perform each class of overhaul on each major repairable component.

DATE 04/18/83

SECTION NAME

SECTION PAGE 1.1 2 of 2

Name:

MRP OVERVIEW (continued)

- (2) Inventory Control This module monitors the status of each part number in the system. It tracks not only the quantity on-hand in the storeroom, but also the quantity on-order (requisition or manufacturing order) and when the on-order quantity is due from the vendor or the producing shop. This module also tracks the detailed issue status of each job order, by part.
- (3) Requirements Planning This module has two primary functions. First, it maintains a Master Production Schedule of Shippard repairs for the next year or two. This Master Production Schedule shows the anticipated repair schedule for each class of overhaul on each type of component, by day. Second, this module processes the Master Schedule against the bills of material to determine the materials needed to satisfy the Master Production Schedule. Using material requirements planning techniques, it reserves materials already on-hand and on-order. The module then identifies any additional materials required to complete the scheduled work and determines when to order, how much to order, and when the materials ordered should be received in the storeroom.

Other MRP modules, which maintain operation routings and plan and monitor labor and material on the shop floor and develop standard costs and monitor actual versus standard costs, are also available.

DATE SECTION NAME SECTION PAGE 4/18/83 DESIGN ENGINEERING OVERVIEW 1.2 1 of 3

The Design Engineering module is used to develop and maintain the material specifications required to support MRP. This module maintains the Part Master File and the Product Structure File. The Part Master File identifies each stock number in the system and describes how it is processed within MRP. The Product Structure File defines the bill of material for each major repairable component controlled by MRP by stock number and the quantity required to perform each class of overhaul on each type of component. The main objectives of Design Engineering are:

- To develop and maintain accurate product structure information for repairable items.
- (2) To develop and maintain part information.
- (3) To minimize production costs through effective control of product engineering changes and part-related data.

The Design Engineering module supports these objectives by:

- (1) Providing organization and maintenance of product structure data for each overhaul (the Product Structure File is a structured list of materials and the quantities of each part required to perform a given class of overhaul).
- (2) Maintaining, for each item, the part master data pertaining to planning, purchasing, inventory, and production control. All part order policies, including lead times, and pert usage policies are maintained on the Part Master File through the use of the Design Engineering module.

PART MASTER FILE

The MRP Part Master File is a list of all parts processed by MRP within a shop. This includes all DMI and shop store material. A part cannot be ordered, received, issued, or overhauled unless it exists in the MRP Part Master File.

The stock number is used to uniquely define each part on the Part Master File. The following key information is maintained in addition to the stock number of the part.

- (1) Reference. Reference information identifies the type of part and includes a description of the part for identification purposes.
- (2) Order Policy. Order Policy information specifies how shop store's requisitions and JML order quantities will be calculated by Requirements Planning. Examples of order policy information are the safety stock quantity, a minimum order quantity, and a maximum order quantity.

CONTRACTOR OF CONTRACTOR CONTRACT

DATE SECTION NAME SECTION PAGE 4/18/83 DESIGN ENGINEERING OVERVIEW 1.2 2 of 3

PART MASTER FILE (continued)

- (3) Lead-Time. Lead-time information specifies when the component parts analyzed by Requirements Planning should be ordered. The leadtime of some parts at the Shipyard is highly variable. The leadtime can be effected by how, where, and from whom the part will be acquired. Because of this, management attention should be directed at maintaining realistic lead-times to ensure that within a reasonable probability, material is received on time.
- (4) Inventory. Inventory quantity balances provide planners, supply clerks, and shop personnel with the quantity on-hand and the quantity on-order for all parts. This includes inventory balances for shop stores and DMI material.

PRODUCT STRUCTURE FILE

The Product Structure File contains a list of material required for each overhaul class. These product structures are used by the Requirements Planning application module to determine material requirements. For planning purposes, the quantity required is calculated by multiplying the quantity of the part required for each parent times the usage frequency. For example, if two valves are components of one sealed hydraulic transmission, but they are replaced in only 50 percent of the overhauls, only one valve could be ordered for each scheduled overhaul. The quantity per parent and the usage frequency are defined for each part on the Product Structure File.

Each product structure reflects the way a major repairable component is overhauled. This is done by defining the parts belonging to each sub-assembly. This allows mechanics and planners to easily identify each part while performing an overhaul.

ENGINEERING CHANGE FILE

MRP provides control over the addition of a new product structure. The Engineering Change File provides this control.

An Engineering Change Order transaction must be submitted for each new parent being input into the Product Structure File. On this transaction, the date at which Requirements Planning will begin using the product structure is specified. This date is called an effectivity date. To ensure that inaccurate data will not be used to plan material requirements, the effectivity date should first be specified as several years in the future. Doing this is termed opening an Engineering Change Order.

CROSS REFERENCE FILE

The Cross Reference File provides MRP users with a list of manufacturer's part numbers for each stock number. This file supports the needs of the shop personnel who use the manufacturer's part number (obtained from technical manuals) to identify a part.

DATE SECTION NAME SECTION PAGE 4/18/83 DESIGN ENGINEERING 1.2 3 of 3

CROSS-REFERENCE FILE (continued)

The cross reference of stock numbers allows MRP to print the manufacturer's part number on all documents used by shop personnel. Cross reference reports are available by stock number, by manufacturer's part number, and by part description. Also, cross-reference information can be obtained through on-line inquiry conversations using either the stock number or the manufacturer's part number.

JML DETAIL FILE

The JML Detail File is a list of all purchased parts processed by MRP within a shop. This includes all DML and shop stores material. The stock mamber is used to uniquely define each part on the JML Detail File. Information on the JML Detail File is used by shop personnel for writing JML's.

SYSTEM CONTROLS

The MRP system provides procedural and system controls that assist users in maintaining accurate and up-to-date information. Although MRP will automatically recognize many user errors and data inconsistencies, the ultimate responsibility of accurate data rests with the users.

Following is a brief description of the controls provided by MRP.

- (1) Manual Procedures. Manual procedures require the approval of input cocuments by key personnel before they are entered into MRP.
- (2) <u>Batching Controls</u>. Batching controls verify that all transactions were processed.
- (3) Terminal Sign-on Procedures. Terminal sign-on procedures control access to the MRP system at the transaction level to prevent unauthorized entry of data.
- (4) Imput Validation. Input validation verifies that invalid data does not corrupt the MRP data base. For example, if a field has predefined values, MRP will allow only the correct values of the field to be entered.
- (5) Detailed Audit Trails. Detailed audit trails document all changes to the MRP Master Files for user verifications.
- (6) Error Recycling. Error recycling ensures that all transactions that are rejected by MRF are corrected and processed properly.
- (7) Master File and Run-to-Run Control. Master File and run-to-run controls notify system operators when program errors occur and when system errors occur.
- (8) <u>Data Base Audit Reporting</u>. Data Base Audit Reporting verifies that existing data on the Part Master File is complete.

DATE 4/18/83

SECTION NAME
INVENTORY PLANNING AND CONTROL

SECTION PAGE 1.3 1 of 8

The Inventory Planning and Control Module monitors the status of each part in MRP. Ensuring accurate inventory balances by controlling the movement and usage of material within the Shipyard is critical to MRP. The primary objectives are:

- (1) Reduce the amount of working capital tied up in inventories.
- (2) Increase overhaul efficiency, through improved control over material availability.
- (3) Minimize costly write-offs due to inventory obsolescence.

The Inventory Control module supports these objectives by defining and processing all the transactions necessary for control of on-hand and on-order balances. Stock status and repair and requisition order status reports highlight shortage, surplus, past-due, and obsolete inventory conditions.

Within the Inventory Control application, shop paperwork is also prepared. This paperwork identifies the status of component requirements maintained for each job order. The reporting provides an indication of component availability and a measure of part substitution and part usage variances.

IP&C Functions

Master Production Schedule:

Planners use various quarterly schedules to develop a Master Production Schedule which identifies the week in which the components will be overhauled. A preliminary Master Production Schedule is determined by weighing available labor and machine resources against the workload. Once this Master Production Schedule has been approved, the components to be overhauled by period are input to the Requirements Planning function. The Master Production Schedule is the driving force for the planning activity. The Master Production Schedule for a major repairable component reflects anticipated overhauls needed, by time period, as projected by NSWSES, NAVSEA, SPCC, etc.

The forecasted quantities are entered as "advance planned" orders into the Master Production Schedule. These "advance planned" orders are exploded by MRP through the Product Structure File to calculate the gross part requirements (i.e., the total quantity of parts which are likely to be needed to perform the scheduled overhauls). The MRP system reviews the on-hand and on-order positions of each part, applies the acquisition lead times for each part, and produces time-phased net material requirements. The MRP system creates planned requisitions for parts with suggested order placement dates. When the placement date is reached, the MRP system will produce a report requesting the planner to firm the requisition in MRP and submit a JML into the MIS system. When updated forecast information is

DATE 4/18/83 SECTION NAME

INVENTORY PLANNING AND CONTROL

SECTION PAGE 1.3

2 of 8

Master Production Schedule: (continued)

received. The Master Production Schedule will be changed to reflect the revised information. MRP will then examine the affected part requirements and determine whether new supply orders are required.

Plan Material

Material planning consists of identifying parts needed, projecting the need for parts over time, and ordering parts to meet these needs.

The definition of the part is the foundation upon which material planming and control is built. Critical information is maintained about the part; such as stock number, description, part type, material planning information, on-hand and on-order quantities and part cost. Without all this information, the MRP system cannot function properly and interface with the Shipyard MIS system.

One of the most critical factors to be identified is accurate lead times. MRP uses the lead-time information to determine when to order a part to insure that it arrives at the Shipyard when it is needed. Lead times for many parts are highly variable. A lead-time reporting system will use data developed by the MRP system to compare actual lead times to current lead times on the Part Master File and suggest appropriate changes.

After a part has been defined, planning bills of material will be input into the MRP system. The planning bills of material itemize the materials that make up a major repairable component. The total quantity of each part likely to be needed in an overhaul is the total quantity in the component adjusted for the usage frequency of each part. "Usage frequency is simply the probability, expressed as a percentage, of a part's being replaced during a repair. Usage frequency is the key to material planning since, for a given overhaul, part requirements cannot be determined with precision until the disassembly, inspection and testing are completed. Usage frequencies for each part will be based on historical usage, namufacturer's engineering estimates and estimates supplied by production work center personnel. The MRP system will maintain its own historical usage data to be used to update these initial estimates of usage frequencies.

The MRP system will capture all receipts for outstanding requisitions, of both DMI and Shop Stores material. DMI parts will be tracked into and out of Building 55 to Building 129, while Shop Stores parts will appear as being received directly by Building 129.

DATE 04/18/93 SECTION NAME
INVENTORY PLANNING AND CONTROL

SECTION PAGE

1.3 3 of 8

Process Overhaul

After a major repairable component arrives in the shop, it is first disassembled and inspected. At this time, the parts required are listed on a system created inspection report (Material Requirements/Pick List) which will be used for picking the parts in the MCC and as the source document for entering issue transactions into the MRP system. Using the quantities written on this document by the mechanic, the MRP system's planned part requirements for this component will be changed to the actual parts required for the overhaul. As the job order is completed, all issue information will be entered into the MRP system and will be retained for use in usage history analysis. Unplanned but required parts, which are not on-hand after a component is inspected, will be ordered immediately.

Usage Tracking

Usage frequency is one of the primary differences between using MRP in the ship overhaul environment versus a manufacturing environment. Unlike manufacturing, in performing overhauls, parts' requirements typically cannot be determined with precision until a component is disassembled, inspected and tested. Usage frequency provides a method for planning material in this uncertain environment.

The term "usage frequency" means the probability, expressed as a percentage, that a part within a component will be replaced during an overhaul. It does not relate to the probability that the component itself will fail or be missing.

Material planning in MRP is accomplished by developing planning bills of material for each component to be repaired. Planning bills of material contain the usage frequency of the parts in a component. Only parts that have a predictable usage frequency should be listed in the planning bills. Other parts are managed by maintaining a safety stock for the part. Planning bills are used to determine the quantity of each part in a component that will probably be needed to complete an overhaul. When components are placed in the Master Production Schedule, the Requirements Planning module of MRP uses the planning bill of material to calculate the gross material requirements. The gross requirements area netted against on-hand and on-order quantities to determine whether additional orders are necessary. This occurs months in advance of receiving the major repairable component. Suggested material orders are then offset, based on anticipated acquisition lead time. Suggested orders are reported to the appropriate planner for confirmation or denial of the placement of the order.

DA TE 04/18/83 SECTION NAME

INVENTORY PLANNING AND CONTROL

SECTION PAGE 4 of 8

1.3

Usage Tracking (continued)

Once the repairable is disassembled and inspected, the actual part requirements will be determined. When these parts are issued to the job order, the part usage will be captured by the MRP system. A reason code associated with each issue will be indicated. The usage reason code will be: (1) replacement, (2) failure, or (3) missing. By tracking the usage reason, the classification will allow shop personnel to report trends for specific parts. This will be especially useful in overhauls of new components from new classes of ships.

MRP will provide a maintenance process to allow planners to adjust the usage frequency. Planners will receive information from MRP suggesting that the usage frequency of certain parts be changed (exception information based on usage history). The planners will review this information and decide which parts to update and what usage frequency value to enter. This review process will allow the planner to apply judgment and experience to override computer suggested actions when appropriate.

The usage frequency maintenance system will:

- (1) Capture and retain in a historical usage file issue and job order data that accounts for all actual overhauls. This data will be detailed enough to account for actual usage by stock number, overhaul class, and model.
- (2) Provide the ability to scan the historical usage file to select those items warranting special analysis because historical usage rates deviate significantly from the established (actual) usage rate.
- (3) Provide the planner with "computer recommended" usage frequency based on statistical computation of historical average.
- (4) Provide summary or detail information about individual part usage.
- (5) Provide a reason code for usage history updates to prevent inaccurate updates to nonactive parts or to parts whose usage frequency has been overridden by planners independent of computer suggested usage values.
- (6) Provide assistance in determining appropriate safety stock levels for individual or selected parts.

DATE 4/18/83 SECTION NAME INVENTORY PLANNING AND CONTROL SECTION PAGE 1.3 5 of 8

Order Tracking:

Montioring of part requirements is continuous throughout the cycle of an order. From the time an order is entered into the Master Production Schedule until its completion any changes (such as an increase in scheduled quantity of a major repairable component or a change in the requirements reported on the Material Requirements/Pick List document) are analyzed by MRP. MRP will produce action reports when: (1) shortage conditions occur, (2) suggested requisition status changes are not initiated on time, (3) material receipts are past due, or (4) other situations occur that require corrective action. These action reports are directed to the appropriate planner responsible for ordering the part identified on the report.

The status of parts on order is continually monitored by the MRP system. As each requisition is processed arrival dates are calculated, based on the purchase lead time of the part involved. If the part has not been received as of the calculated arrival date the system notifies the appropriate planner that immediate action needs to be taken. In addition, the effect of the delayed receipt on the related job orders is highlighted.

Unrecorded Assets

All material existing in the shop but not recorded by the MIS system will be collected, recorded and controlled by MRP. These goldpile parts will be segregated in physical locations separate from identical recorded asset parts and these locations will be referred to as "UA" (unrecorded asset) locations by the MRP system. The Shipyard MIS system will be able to monitor only the balances of recorded assets.

The MRP system will treat unrecorded asset parts similar to recorded asset parts, but will distinguish between the two in two basic ways:

- (1) Goldpile locations and quantities will appear first on MRP generated picking documents and the Shop Stores clerk will have instructions to issue from exisiting UA locations first. As unrecorded assets are depleted, they will not be replenished. The Shipyard MIS system's visibility to actual balances will become more realistic over time as unrecorded assets diminish.
- (2) During physical cycle counts unrecorded assets will be counted separately and will not be reconciled when comparing the MRP and MIS system balances (so no artificial out-of-balance situations will occur).

DATE 4/18/83

TO THE PROPERTY OF THE PARTY OF

SECTION NAME INVENTORY PLANNING AND CONTROL SECTION PAGE 1.3 6 of 8

Message File

System messages are used to trigger analysis and reports through communication between system programs. A message relationship exists when exception conditions are detected by one application to be examined or resolved by another application. This is done through the use of communication messages between programs of the two applications.

The relationships between Inventory Control and the other MRP applications are summarized below:

INVENTORY CONTROL MESSAGE RELATIONSHIPS

APPLICATION	IC REQUIRES BUSINESS DATA	REQUIRES IC BUSINESS DATA	MESSAGE RELATIONSHIP
Design Engineering	x		
Requirements Planning		x	x
On-Line Inquiry		x	

The relationships between Requirements Planning and the other MRP applications are summarized below:

REQUIREMENTS PLANNING MESSAGE RELATIONSHIPS

APPLICATION	RP REQUIRES BUSINESS DATA	REQUIRES RP BUSINESS DATA	MESSAGE RELATIONSHIP
Design Engineering	x		x
Inventory Control	x	x	x
On-Line Inquiry		x	

The Part Master File and Product Structure File are created by Design Engineering and either maintained or used by Inventory Control. The Part Master File is maintained by Inventory Control, and is used by Requirements Planning, Inventory Accounting and On-Line Inquiry.

The Order Data Base, created and maintained by Inventory Control, is used by Requirements Planning and On-Line Inquiry.

The Inventory Control application sends messages to Requirements Planning on potential shortage or excess inventory conditions for parts requiring replanning. Following is a brief description of those messages passed between Inventory Control, Requirements Planning and Design Engineering.

USER	NGINEE	RING	MANULA
DATE 9/19/8	32		SECTION NAME INVENTORY PLANNING AND CONTROL 1.3 7 of 8
Me	essag e	File	(continued)
From	To	No.	Brief Description
RP	IC	200	Order Analysis. Sent when either an order add or change is processed.
ЯP	IC	21.0	Sent if either of the following exception conditions occur on orders with a status other than planned:
			- Reschedule earlier - Increase quantity
RP	IC	220	Sent if an effectivity exception is encountered when exploding component requirements for an order change transaction.
IC	RP	310	Requirements Planning Analysis. Sent whenever a transaction is processed which could cause excess supply. Also whenever a shortage condition is detected.
DE	RP	310	Requirements Planning Analysis. Sent whenever there is a change in any factor that could change the order policy or order lot size.
IC	RP	310	Requirements Planning Analysis. Sent whenever a transaction is processed which could cause excess supply or whenever a shortage condition is detected.
DE	RP	320	Requirements Planning Replanning. Sent whenever changes are made to the Part Master File and Product Structure File data that could effect the calculation of planned order or component demand (e.g., make/buy code, change effectivity date, delete component, etc.).
DE	RP	330	Requirements Planning Reschedule. Sent whenever lead times are changed on the Part Master File.
IC	RP	340	Master Schedule Report Request. Sent to request master schedule reports for selected parts.
IC	RP	350	Master Schedule Change. Sent to print all master scheduled parts that have had a change.
IC	RP	360	Order Requirement/Planning Action Consolidation. Sent so that parts with exception conditions (on the day Requirements Planning is run) are printed only on the Planning Action report rather than on two different exception reports on the same day.

TOTAL PROPERTY OF THE

DATE SECTION NAME SECTION PAGE INVENTORY PLANNING AND CONTROL 1.3 8 of 8

Message File (continued)

From To NO. Brief Description

F SF 510 Order Delete. Sent when Requirments Planning needs to have an order deleted by Shop Floor Control.

INVENTORY PLANNING AND CONTROL MASTER FILES

Order Header File

The Order Header File contains information regarding the status of each job order and requisition order. The following data is included in the file: (1) the date the order was input into the system; (2) the order type, e.g., purchase order; and (3) the order status, e.g., planned, firm, cut, pick.

Requirement Detail File

The Requirement Detail File contains specific information on the supply and demand status of material for each job order. Information from this file is used to detect shortage conditions. The planned, firm, cut and pick dates for all parts are maintained in this file.

Order History File

The Order History File contains order information for each job order number. The file includes all parts in the overhaul of a carcass and shows the actual usage frequency of the parts.

APPENDIX D LOCAL MR PUNCTIONAL DESCRIPTION

11MO-HSYLE-5220/172 (5-24)

LONG BEACH HAVAL SHIPYARD

PROGRAM DESCRIPTION FORM

**************************************			REVISION INCIDE	-	SOUPCE CAMPUAGE
MRC551		· · · · · · · · · · · · · · · · · · ·	<u> </u>	01	COBOL
			•		SU amo FT 40 GV
	COMP	LETE HISTORY FILE	(MRC5514	or MRC4521)	LBNS
iata and	othe	lete History File r Material require		for extraction	of Material usage history
INPUT:	-	na taaludaa			
TWE GT:	1np	ut includes	eter Per	#11- WDC//57	l or MRC5514 in Job Order
	1.	sequence (186 chi			I OI MCCCCIT IN TOD OFGET
*	2.	Card input, MR To			containing.
	4.	a. Coar cards	ansac CLU	r tire, www.	Containing
		b. Job order car	-1-		
		D. JOB GEGGE CAL	.u.		
OUTPUT:	Qut	put includes			
	1.	The incomplete H:	istory fil	le, MRC5514, wi	11 be the same as the input
		record format (1)	36 charac	ter record), in	job order sequence.
_	2.	The complete His	tory file	, MRCS511 is a	156 character record, in
ì		Job Order sequence	e (compr	essed).	
•	3.	The Job Order fil	Le, MRCSS	13, is in card	format (80 characters) is in
		Job Order sequence	e.		
	4.	The Reject file,	MRC5512,	is in card for	mat (80 character record).
PROCESSI	NG:				COAR cards are coded with "1" in the first position or
		•			osition of the sort-key and
		-			ld, cc 73-80, for greater
					AR cards are loaded into a
					d against the incomplete
		History file.			_
					en to the reject file and
		coded with an "R			
					A "D" in cc 12 in the COAR
				re COAR History	y record or records from the
		incomplete Maste			
				to update, char	ige or delete records on the
		incomplete Maste			
_					s in the mandatory fields. The collowing fields (with the
		exception of rec			•
~		1. Mandays		Cols. 31-36	
		2. Number o	f Units	Cols. 27-29	
^		3. SA,OR,OF	, APL	Cols. 43-57	
		4. Inst, Pl	an. Stk	Cols. 58-72	

MINIMUM HARDWARE CONFIGURATION REQUIRED BY SLAVE PROGRAM

	REQUI	RED BY SLAVE PROGRAM		
				7
	CARD FUNCH		24 E CORE MEMORY	
	CARD READER	•	LIMES DISC STORAGE	
	PRINTER		6_ TAPE HANGLERS	
	-		eld can have data in either	
	not necessarily both field record is found to be in		tten to the reject file and	
coded with	an "R" in card column 11.	nvalid it is wil	ccen w the reject fire and	
	ards with a "C" in cc 12 ' Master file records.	will change the	Job Order field only, of the	•
Job Order o	ards with a "D" in cc 12		entire History record or	
	m the incomplete Master f			
			written to the incomplete cter indicating which field	
	re missing in order to be			
(MRC5511),		permed as and o	ompleted Hijory Lile	
Codes are a				
1. H	= Hull field missing	cc 37		
2. 0	= Number of units field m	issing cc 38		
3. M	= Mandays field missing	cc 39		
4. A	- APL field missing	cc 40		
5. P	- Plan field missing	cc 41		
Both A	PL and PLAN field must be	blank to be cod	ed.	
The comple	ted History file (MRC5511) is created fro	m the Incomplete Master	
file. It i	s a compressed file.			
The transac	tion date is converted fr	om Gregorian to	Julian.	
The complet	ed History File is then s	ent to Program N	R. MRC560 to update the	
Job Order E	ile.			
A record co	ount is provided for all i	nput and output	files.	
		•		
		•		
SPECIAL INS				
	RC551 IS PROCESSED MORE TO PUT FILE WILL BE USED AS I		O PROCESSING MRC452, MRC551 MRC4521.	4
PACS	TIME MRC551 IS PROCESSED	. THUE MIRCS 514 OF	PTPUT FILE MUST BE USED IN	
	558 TO PRODUCE AN INCOMPLE			

11HQ-HSYLB-5230/172 (S-J4) (BACK)

11H9-HSYL 8-3238/172 (5-74)

LONG BEACH NAVAL SHIPYARD

PROGRAM DESCRIPTION FORM

MRC988	SEALTH MODER	COBOL COBOL
PRODUCE SUMMARY EXTRACT AND DATA	PILE (MR REPORT GENERATOR)	LBNS

TO PROVIDE SCRATCH SHEETS FOR ORDERING MATERIAL IN ADVANCE OF A SHIPS ARRIVAL FOR REPAIR AND TO PRODUCE EXTRACT FILE TO UPDATE WANG DATA FILE.

INDUT: 1. SORTED EXTRACT FILE MRC9851

2. SORTED JOB ORDER FILE MRC5601

. SORTED EXTRACT TRANS MRC9751

OUTPUT: 1. WANGFILE MRC9881
2. RPTFILE MRC9882

PROCESSING: SORTED EXTRACT TRANSACTION FILE IS LOADED INTO A TABLE (TABLE LIMIT IS 500 MAX).

DESIGNATOR \$57 CONTROLS THE PROCESSING OF MRC988.

THE SORTED JOB ORDER FILE IS READ AND MATCHED BY EXTRACT TYPE TO THE EXTRACT TRANSACTIONS INPUT TABLE. WHEN A MATCH OCCURS "PART I" OF THE SCRATCH SHEET IS PRINTED WITH THE CARD IMAGE FROM THE TABLE AND THE MATCHING JOB ORDER RECORD OR RECORDS. THE COMPONENT AND MANDAY AVERAGE TOTALS ARE CALCULATED PER JOB ORDER AND PRINTED ON "PART I" OF THE SCRATCH SHEET. THESE TOTALS ARE USED IN CALCULATING THE AVERAGE QUANTITY FOR ITEMS WHICH MATCH THE CARD IMPOT AND ARE EXTRACTED FROM MRC9851. ITEMS EXTRACTED FROM MRC9851 ARE PRINTED ON "PART II" OF THE SCRATCH SHEET IN "NIIN SEQ" AND IN NUMERICAL ORDER. THE WANGFILE IN CODE SEQUENCE IS CREATED FROM THE DATA EXTRACTED.

- THE WANG FILE HAS 3 RECORD TYPES:

 1. HEADER RECORD (WANG-RECL) CONTAINS THE EXTRACT DATA

 MATCHED BY THE COMPLETED HISTORY FILE. WANG ITEM NUMBERS
 FOR HEADER RECORDS WILL ALWAYS SHOW ZERO (00000) WITH
 THE ADDITIONAL ELEMENTS, HULL NR., EXTRACT DATA TYPE ETC.
- DATA ITEMS-(WANG-REC2) ALL ITEMS EXTRACTED FROM MRC 9851 IN "NIIN SEQ" AND IN CORRESPONDING NUMERICAL ORDER TO THE ITEMS PRINTED ON "PART II" OF THE SCRATCH SHEET.
 - TOTAL RECORD' (WANG-REC3) INCLUDES THE TOTAL NUMBER OF RECORDS EXTRACTED PER CODE, HULL NR. AND THE FILE IDENTIFICATION.

· · · · · · · · · · · · · · · · · · ·				_
	MINIMUM HARDWARE CONFIGURATION REQUIRED BY SLAVE PROGRAM		•	ذ
	CARD PUNCH	25	K CORE MEMORY	
	CARD READER		LINKS DISC STORAGE	
<u> </u>	PRINTER	5	TAPE HANGLERS	

A TOTAL PAGE IS PRINTED AS THE NEXT TO LAST PAGE OF THE SCRATCH SHEETS, A LIST OF THE CODES (231, 232, 233, 234, 235, 236, 237, 238) AND THE NUMBER OF ITEMS EXTRACTED PER CODE.
THESE TOTALS ARE ALSO DISPLAYED ON THE EXECUTION REPORT.

A LIST OF UNMATCHED EXTRACT TRANSACTION RECORDS, MRC 9751, ARE PRINTED ON THE LAST PAGE OF THE SCRATCH SHEETS.

ALL EXTRACT TRANSACTION RECORDS ARE PRINTED ON THE EXECUTION REPORT AND UNMATCHED ONES ARE PLAGGED WITH AN ASTERISK.

11HO-PSYLB-5230/172 (5-74) (BACK)

 The first record on the Sorted Extract Transaction file, MRC9751 is read. The file identification of the input Extract Master file is determined by the value in positions 30-31 of this first record:

POS. 30-31	Extract Label ID	Extract Name
AP	MRCS671	APL Master
ST	MRC5681	ST Master
All Others	MRC5691	OT Master

- 2. The MRC9751, Transaction file, is matched to the Extract Master on field "Extract-1". If positions 106-107 of the master do not equal positions 30-31 of MRC9751, the Job Stream is aborted, the message "MRC980 Extract Field DISAGREES" is displayed on Sysout, and "MRC980 JOB ABORTED" on the console.
- Any MRC9751 records that do not have a matching record on the Master file are displayed on the sysour.
- 4. Each selected (matched) master record that has an FSC matching the values from 10 designators (sorted in an internal array) and that has position 2 of the NIIN not equal to "A" through "Z" is deleted. All other selected Master records are written to the Extract File, MRC9801.

APPENDIX B FUNCTIONAL DESCRIPTION OF ARMIS

ARTEMIS SYSTEM OVERVIEW

This document describes the total information flow within the ARTEMIS REPAIRABLES MANAGEMENT SYSTEM from the receipt of a funding document (the equivalent of a purchase order) to final billing of all items on that funding document.

STEP 1 - Planning Department, Code 224, annotates funding document with schedule induction number (BSS) and the priority.

STEP 2 ~ Comptroller Officer, Code 620, receives a new Funding Document and enters all data that is consistent for all attached line items in the PRIME (CODS) computer system. The line items known as "COARS" (Customer Order Acceptance Record) are also entered in PRIME(CODS). All revisions or corrections to Funding Documents for COARS are made in PRIME(CODS).

STEP 3 - NITE 1 BATCH PROGRAM

This program is performed once a day, in the evening, a magnetic tape from PRIME(CODS) is passed to ARTEMIS containing three files.

CODS: - Number of records contained in file CODS: This is needed to create a "header" record on the file ARTEMIS passes to MIS each night.

CODS2 - MIS/COST transactions originating on the PRIME computer.

CODS3 - Entire live COAR file - as PRIME(CODS) sees it.

NITE1 does the following:

- * Purges the three files from the put/get cartridge.
- * Reads the current three files from the tape to the put/get cartridge (and translates them from EBCDIC to ASC11).
- * Signs onto ARTEMIS with batch file CODAR (CODS TO ARTEMIS)
- 1. 0. 600, PRO CODS.
- * Delets dataset COARS from library.
- * Erases CODS3 (from 1. D.)
- * Get the new CODS3 and executes the file to bring the new "live" COARS into the dataset COARS.

STEP 4 - TAPE 1 BATCH PROGRAM

This program is performed once a day, in the evening. TAPE1 creates a file which will be passed to MIS via magnetic tape.

TAPE1 does the following:

- * Signs onto i. D. 622 PRO TAPER to check that it has not already been run, by comparting the Last Run Date (LRD) to today's date, and to erase files WCD1 and WCD2.
- * Signs onto I. D. 950, PRO RMS and executes file WCDER, which creates four different records which are passed to MIS, These records are: WCD Creation, WCD Rescedule, WCD Close, and WCD Open

These records are copied to file WCD2, file WCD1 contains a count of these records. Files WCD1 and WCD2 are moved to 1. D. 622.

* Signs back onto 1.D. 622, PRO TAPER and executes file CODCK, which looks for COARS that should get WES'S but are missing important field. File WESER is then executed, which merges CODS 1 (number of records passed to MIS from CODS), CODS 2 (records from CODS to be passed to MIS), WCD 2 (WCD transactions from Code 950), and WES records (generated by file WESER) into on file called TOPUN and sent to put/get area. LDR (Last Run Date) is now set to today.

STEP 5- TAPE 2 BATCH PROGRAM

This program is performed once a day, in the evening. TAPE 2 puts the file created by TAPE 1 onto magnetic tape. A printout is made of what is on the tape for filing in binder. The magnetic tape is sent to the MIS System.

STEP 6- This is the first step that is part of the "Job Status Tracking" module. Almost all steps in this module may be performed off-line via a series of programs written for the 2649 terminal as a stand alone processer or on line. We will deal only with the on-line methods.

Code 930 or 950 (Repairables Rework Center) selects option "A" on their Menu to create a Keyop (short for key operation). They enter the COAR number, the Keyop number they are creating, the date of induction (if no date is input, the default date is the actual date), and the number of units inducted. "Inducted" in this application means the RRC has requested a number of carcasses to be overhauled. A record is created in the dataset KOPS for each keyop.

STEP 7- The RRC's use option "B" on their Menus to report receipt of carcasses (the date carcasses are received and the number of carcasses). The record created in option "A" is reviewed and these two fields are entered. The receipt date marks the beginning of Repairable Turn Around Time (RTAT).

STEP 8— The RRC's use option "C" to report that carcasses have either been completed, surveyed, found to be wrong, etc. To accomplish this, they must enter the COAR, Keyop, transaction quantity, transaction date (this marks the end of RTAT) and the transaction flag (how did it leave? complete, scrapped, etc.).

STEP 9- This step and the next one are only performed when repair work on a carcass is interrupted due to a lack of parts (referred to as "G" condition). The user (RRC) will use option "D" to put a carcass in "G" condition). This creates a record in the "GITMS" dataset.

STEP 10— When the parts which held up the repair effort arrive, the user uses option "E" to report to the system the date the carcass returned to "M" condition.

STEP 11- option "H" on the RRC Menu will A (proof carcass transactions and B) "roll up" transactions to Keyop level. Among the checks made are A) the Keyop has been established, B) no more carcasses are being reported leaving the shop floor than were received against that Keyop, C) the transaction flag is either "A", "B", "F", "H", "J", "K", "P", "W", or D) the date the carcass was reported

leaving is after the date the carcass was reported received.

STEP 12- NITE2 or TUESD or FRIDY BATCH PROGRAM
This step is performed once a day, in the evening, On Tuesday the TUESD batch
program is performed instead if NITE2. On Friday the FRIDY batch program is
performed instead of NITE2.

NITE2 does the following:

- * Enters new COARS from PRIME (CODS) in to the correct i.D. (930 or 950) JOBS dataset.
- * performs all RRC roll up transactions to the COAR level and RTAT calculations in each 1.D. (930 & 950).
- * Replaces JOBS dataset in 1.D. 900 with updated JOBS dataset from 1.D. 930 and 1.D. 950.
- * Enters new COARS from PRIME (CODS) Into I.D. 600, PRO CODS dataset COST.

TUESD does the following:

- Performs the functions listed under NITE2.
- * Performs six checks and any errors found are spooled on six error reports.

FRIDY does the following:

- * performs the functions listed under NITE2.
- * Enters I.D. 622, PRO TAPER and prepares depot report for Code 630.21 and spools report.

STEP 13 - XOVER BATCH PROGRAM

This program is run once a week on Friday after all NITE programs have been run.

XOVER does the following:

- * Enters i.D. 224, PRO RMS and executes current STBR file, which enters current stabilized rates in STDT dataset.
- * Saves the following 1.D.'s 100,110,224,621,622,900 on disk.
- * Enters I.D. 100 PRO RMS overlays datasets STDT and SHOPS with current STDT and SHOPS datasets from I.D. 224.
- * Executes file ARCOD, which copies out standards data to a file and sends file to put/get area. File TPCOD puts this data on magnetic tape. This tape is sent to the PRIME (CODS) system to update their standards database.

STEP 14 - COST PROGRAM

This program is run once a week on Monday morning.

COST does the following:

- * A magnetic tape is received from MIS with current cost information. File: TOUS enters this data into put/get area.
- * File COST gets data from put/get area and enters data into dataset COST In 1.D. 600, PRO CODS.
- * Executes file FDRPT which prints the Funding Document Report.

STEP 15 - EOMER PROGRAM This program is run once a month.

EOMER does the following:

- * Enters 1.D. 930 and 1.D. 950 and executes file HISTR.
- * File HISTR creates historical file which contains records from JOBS dataset where COR has a charge code of Z in COARS dataset.
- * These historical files are moved from respective 1.0.'s to 1.0. 600, which are then entered into dataset HIST.
- * Enters I.D. 224 PRO RMS and executes file PCRPT then spools report. * Enters I.D. 900 PRO RMS and prepares reports CLOS2, CLS2A, and OYREX.
- * Enters 1.0. 930 and 1.0. 950 to execute file CL9KO.
- * File CL9XO prints report of records which will be deleted in datasets JOBS, KOPS, TRNS, and GITMS. These records are then deleted.

APPENDIX F SAMPLE ARMIS REPORTS AND FORMS

2S CINCLA REFIT REPORT

								œ	DRT SYNBO	REPORT SYMBOL: MHVSEA 4440/	_
1. TO: COMMAN 20162	.TD. Commander, mayal bea sybtemb command, washington DC 20162 attm. codes sif/52f/33f/34f/0413/62yG/62kl	COMMAND, WASHINGTON DC	2.REPURTING ACTIVITY LONG BEACH MAYAL SHIPYARD CODE 224/620/930/950	2.REPURTING ACTIVITY LONG BEACH HAVAL SHIP CODE 224/620/930/950	SHIPVARD 1		J.REPORT PERIOD 1-31 JANUARY 63 PREPARED 31-JAN-65	·	- 4.SIGNATURE	1 4.SICHATURE 883 65	•
FUND THE DOCUMENT	MOMENCLATURE BSS MR.	MATIONAL , LOCAL JOB 18TOCK HO. ; URDER MO.	START :	GUANT IT	START : QUANTITY : K : CONP :	COMP .	FULLES .		FUNDS .	CS . REHARKS	:
02-PU 4A111 2023	PACKARD 20850R3 185 HUPH232063X15200	29 2015- 6478P-32837 80-5801047 A	,	-	•	• • • • • • • • • • • • • • • • • • •	59,600	on cc	31867	BSR- 0 URONG MATL- 0 SURVEY- 0	
	COMMENTS, NO CRAMK		Z Z	IN MORK IN SHOP - 1	_					0 -QNO3 . 5.	
02-PU 4A111 2040	PACKARD 20050R3 125 Huph23-2132-x154	25 2015- 6408Y-3253Y 60-5001067 A))) 1 1 1 1	8	9	=	116,000	on ex	08086	BSR 0 URUNG MATC 0	! _
	COMMENTS: COMPLETED 8	COMPLETED 8/H 208-R3 6/3/84	IN WORK	IN WIRK IN SHOP-	_	•				0 =QHOD . D.	
63-PU 4A111 2002	PROF SHAFT MS0421 HUPN23-2355-K153	25 2010- 64FCJ-32537 930512 00-8235052 A	630512	-	9		44,200	on ec	35515	BSR 0 UROHG MATE 0	1 _
	COMMENTS		IN WORK IN SHOP.	H SHOP-	_					0 =QNO3 .5.	
83:P0 4A111	NSO421CL PROP SHAFT NUPN23-2355-X150	25 2010- 64FCK-32537 60-6885075 A	} 	-	9	0 850121 4	44,200	ωŒ	6108	BSR 1 WFOHG MAIL = 0 SURVEY = 1	1
	COMMENTS:		IN WOFK IN SHOP. 0	H SHOP-	•					0 - QNO3 . 5.	
63-PU 4A111 2002	PROP SHAFT MS0421 NUFH23-3215-X151	25 2010- 64FCZ-32537 00-8235052 A	840210	-	9	100 850130 44,200	4,200	ωŒ	41601	BSR 6 UFONG MATE 6	i _
	COMMENTS		IN WHEN IN SHOP" O	- 8HOP-	•					0 "QNO" . T.	
83-PU 48211 2011	PACKARD IDITOO MAIN NUPN23-3130-X150	25 2015- 640DI-32537 00-5801299 A	830622	-	9	9	107,053	vo €	51868	BER 0 UPONG MATE 0	!
	COMMENTS: NO CRANK		IN WOEK IN SHOP-	N SHOP						6 comp. 0	

SI 500	
ON N00024-85-WR03318	EXPIRED 30-SEP-85
COAR LISTING - ALL COARS	RUN ON 20-MAY-85

SORTED IN YR FD COAR SEQUENCE

2F

	E E E E E E E E E E E E E E E E E E E					
	MAN HRS ALLOW	244	1.3	20	•	•
	STAB EXP	13,060	3,432	1,249	806	*:
	ACTUAL EXP	9,480	4,526	873	622	700
	MATL EXP	429	2,668	32	23	430
	LABOR EXP	8, 651	1,858	80	909	270
:	AUTH.	11,000	6,500	1,500	200	200
111111111111	COMP	•	•	-	-	-
	CNIT PEUTH URD	-	-	-	-	-
! ! ! !	111	0255831	3462139	4611506	0640194	0640194
-	901	=	9	8	5	5
i	NO. ITA	1001	1002	3003	3004	1005
	0100	A 674HD 3001 01 0255831	A 67WNE 3002 00 3462139	C 67XJG 3003 00 4611506	A 67XJH 3004 01 0640194	C 67XJJ 3005 01 0640194
	- 1 E 1	•	**	J	⋖	ر.

7 7

TOTAL FUNDS AUTHORIZED TOTAL FUNDS COMMITTED TOTAL FUNDS EXPENDED (ACTUAL) TOTAL FUNDS EXPENDED (ACTUAL) TOTAL FUNDS EXPENDED (ACTUAL) TOTAL FUNDS EXPENDED (STABALIZED) TOTAL FUNDS EXPENDED (STABALIZED) 19,201 101AL FUNDS REPROGRAMABLE

ACTUAL NUMBER OF LINE ITEMS ON FUNDING DOCUMENT

CODE 966 REPAIRABLES CLEARANCE/INDUCTION SHEET

MANHOURS= 32

ORIGNATOR=FREY

START= 9-16-85

PHONE= 6289

COMPL= 10-18-85

PREPARED=18-JUL-85

INDUCTION DATE

 INDUSTRIAL CONTROL NO. ******* *** ***** ***
67KWH77H66

*** 420

9 Sep 85

CDG FSC CC NIN

7H 5840 00 5739940

INDUCTION GTY

LEAD SHOP

DOCUMENT NUMBER ******* ***** NWPN35-5181-9883

5291

FOREMAN *>**** PEARSON

HFR. **** 21877

REPAIRABLE LOG SHEET (100104 6% PO03144 76 EXP)

				•			i						4		
BEFORTI LOCAP	LOCAP											F 16CA	PISCAL TEAR/WUARIEN	DAK IEK	
# # # # # # # # # # # # # # # # # # #	NOMENCLATURE ANIH TUTAL HM POLLAK JIHI URBIK 1894E KEY DP CHIED ANIE	ALIM	וחושו		₹.	HH POLLAK Jim URDER 189UE KEY DP		A DU R.	159UE	κĒγ	90	DA16		1. 化四层水平层 化二层层层层层层层层层层层层层层层层层层层层层层层层层层层层层层层层层层层	
1 <u>7</u> 1	HSH HSS NO.	-	REPAIR UUST	GIY MEPAIR JOB ORDER LBI. EBI. GIY MA BAIR BIY DATE COM! CLUST			7	₹	BAIE	710	DATE.	COM!	350 13	***************************************	
3001	3001 AUSTRINGMIC BLUNDER 1733 66DXL77166 37 1733 3 36 751 (2015)		17.53	660XL.771:66	3	1733	`	۶	12/2	\	4118	\ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \			
	6625 80 8182184 HWPH.55-5181-9449											•			

1902 SRC-16 SUITCH CONIROL 2 636 66EAN77666 16 839 2 14 7/5/5 2 3/20 1/20/3
NWP 135-5181-9456

3983 OSCILLATOR
66.12 09 UB96697
NUPN35-5181-9451

3004 AC.7D: HEIR CAID 1955 66DXH77666 44 1955 / 4.3 7/5/5 / 7.3 7/

		1803
4179	FUEL RATIO	MOGEL
100 00	핕	LATOR
7H 6685 00 0014179	CONTROL, FL	GEN REGULATOR
3R 2H	3	e E
HISTORY FOR		
REPAIRABLES HISTORY		

ENTERED HISTORY	7-0EC-81	7-DEC-81	-0EC-81	- JHN-82	-SEF-82	3-JUH-83	3-JUN-83	8-VEC-83	8-050-83	2-MAY-85	7-FEB-85	4-APR-85	4-APR-85
			_	36	ζ. W								
DATE COMPLETED	8-SEF-80	3-MAR-81	2 10-APR-81 1-DEC-81	2 19-UCT-81 30-JAN-82	1 17-4PR-82 3-5EP-82	27-JUL-62	29- JUL-82	22-HPR-83	22-AUG-83	18-JAN-84	1-0CT-84	17-001-84	2 12-DEC-84
N 00 W	-	-	(N	N	-	Ø	-	-		-	•	-	C)
COND	0.0	0.0	0.0	0.0	ů.	9.0	0.0	0.0	0.0	0.0	0.0	Ü.	0.0
RTAT	3.0	127.0	45.0	45	1.05.0	70.0	0.0	o. o	169.0	313.0	0.0	ů.ů	177.4
TAT	3.0	127.0	45.0	* 	1 05 . 0	70.0	0.0	0.0	189.0	313.0	0.0	0.0	177.4 177.4
RT2	0.0	0.0	0.0	8.5	0.0	0.0	0.0	0.0	0.0	69.0	9.0	0.0	•
RT	9.	0.0	3.5	8.5	9.9	₹.	10.0	0.0	7.0	•	0.0	0.0	12.0
BSR	9	٥	œ	•	ው	-	*	v	-	ın	SO.	m	•
ACT EXPD	1307.00	7622,00	4465.77	4638.25	537.75	6172.65	0.15	0.15	3112.15	985.95	0.15	0.15	2093.95
ST#8 EXPD	1759.23	7195.76	4766.80	5577.01	942.01	5985.63	0.01	0.01	3692.29	1130.49	0.01	0.01	5583.48
AUTH FUND	961.00	7584.00	4740.00	5577.00	1102.00	6612.00	0.00	00.00	3306.00	1192.00	0.00	0.00	5960.00
AVE	50.0	25.6	45.3	26.0	24.0	25.4	0.0	0.0	29.0	26.0	0.0	0.0	24.6
EST	8	2	2.7	22	23	22	22	22	23	22	•	27	22
UCP	-	3	m	۰	-	ø	•	•	M	-	•	•	w
	ž	ž	¥.	£	¥	H2	¥	¥	¥	₹	¥	¥	¥
CUAR COG	7 UN .JV	62CAH	62083	620CP	e-thre	64NB3	64MCJ	64NFT	64NDL	64NEU	94NLX	64MKH	9HN+9

> DAYS MANHOURS 6.3 20.2 HISTORY SUMMARY
>
> 34.0 UNITS COMPLETED IN 13.0 JUBS
>
> HVERAGE RIAT IS 108.7 DAYS. AVERAGE TAT IS 108.7 DAYS
>
> HYERAGE TIME TO INDUCT IS 6.5 DAYS.) TIME TO START WORK IS
>
> ESTIMATE IS 27 HAMHOURS. AVERAGE MANHKS PER COMPLETION IS
>
> GAIN/LUSS PER UNIT COMPLETION HAS BEEN \$ 11.80
>
> HVERAGE GAIN/LUSS PER JUB HAS BEEN \$ 30.87

APPENDIX G ARMIS HARDWARE AND TRAINING COST ESTIMATES



August 23, 1985

Lt. Cmdr. Bob Rodwell 7 Mervine Street Monterrey, California 93940

Dear Mr. Rodwell:

Per our recent conversation, I have developed the attached "Minimum Configuration" to meet the needs of a Repairables Program. This configuration would in my estimation allow a D.O.P. such as Long Beach to adequately meet the throughput and data storage requirements for the first one to two years. The minimum configuration could easily be upgraded both in throughput and storage as these requirements grow over time.

There are, of course, other items that you should consider if you were to implement this system at all Designated Overhaul Points. A "custom" class, designed to specifically meet the needs of the Repairables users, could be developed. This would greatly expedite implementation time at each site. Also, you may want to budget some consulting to optimize all the new features that have been built into the ARTEMIS application since the Long Beach system was implemented four years ago. I would suggest setting aside at least \$40,000 for this. (This is not absolutely necessary but would definitely be worthwhile.)

Note that the prices shown on the Minimum System Budgetary Estimate are current commercial prices; I'm sure the Navy would be able to negotiate some discount if they were to buy several of them. You should also include annual System Support costs in your Cost/Benefit study. A very rough rule-of-thumb is to take 1% of the list purchase price per month. (One year of System Support is included with the initial purchase).

Please do not hesitate to contact me should you have any questions or concerns.

Sincerely,

Robert M. Lambert Account Manager

Low Jambers

RML:ls

METIER MANAGEMENT SYSTEMS, INC. 17780 FITCH AVENUE, SUITE 140 IRVINE, CALIFORNIA 92714

(714) 660-7100



REPAIRABLES MANAGEMENT PROGRAM BUDGETARY ESTIMATE - MINIMUM CONFIGURATION

Model Number	Qty.	Description	List Price
6401	1	ARTEMIS System, including: 6401 Processor Scheduling and Relational DBMS Software 65 MByte Disc Drive Basic Terminal Basic Printer	\$230,000
(4502)	(1)	DELETE Scheduling DBMS	(30,000)
3233	1	800/1600 BPI Tape Drive	18,000
3425	1	300 LPM Printer/Plotter	7,500
3401	3	Basic Terminal	4,725
			\$230,225

LIST OF REPERENCES

- 1. Naval Audit Service Western Region, Repairables Management Audit Report C13549, 15 Apr 1985.
- 2. Naval Audit Service Western Region, Repairables Program Audit Report C13759, 29 Jan 1985.
- 3. Chief of Naval Material Instruction 4440.14B, Navy Repairable Management Manual, 17 Feb 1982.
- 4. Miss Amie Burrison, NAVSUP Code 063, interview 23 Sep 1985.
- 5. Naval Supply System Command Publication 553, <u>Inventory Management</u>, <u>A Guide to Requirements Determination in the Navy.</u>, Sep 1984
- 6. Mr. Mike Beliveau, SPCC Code 0503E, interview 23 Sep 1985.
- 7. Mr. Ray MacDaniels, NSY Charleston Code 212, interview 26-27 Sep 1985.
- 8. Mrs. Cathy Schieber, NSY Mare Island Code 215, interview 9 Aug 1985.
- 9. Mr. Jan Sipe, SPCC Code 035, interview 23 Sep 1985
- 10. Mr. Eddie Belcher, NSY Norfolk Code 214, interview 25 Sep 1985.
- 11. Naval Sea Systems Command, Naval Electronic Systems Command, Repairables Rework Study, Phase 1 Report, Description of Repairables Workload and Repair Facilities, June 1976.
- 12. Mr. Leroy Brinson, NSY Norfolk Code 966, interview 25 Sep 1985.
- 13. Mr. Ed Fry, NSY Long Beach Code 950.1 RRC, interview 23 Aug 1985.
- 14. Mr. Steve Myers, NSY Norfolk Code 214, interview 25 Sep 1985.

- 15. CDR. Mike Jenkins U.S. N., SPCC Code 0503, interview 23 Sep 1985
- 16. Mr. Russ Mayes, FMSO, telephone interview 23 Sep 1985.
- 17. Mr. Art Green, NSY Long Beach Code 224, interview 23 Aug 1985.
- 18. Mrs Trudy Gasque, NSY Charleston Code 521, interview 27 Sep 1985.
- 19. Mr. Bob Sabol, NSY Long Beach Code 224, telephone interview, 14 Nov 1985.
- 20. CAPT. H. Rice, U.S. N., NSY Long Beach Code 500, interview 22 Aug 1985.
- 21. Mr. Vic Gray, NSY Long Beach Code 966, interview 23 Aug 1985.
- 22. Mr. Carlos Crespo, SPCC Code 035, interview 23 Sep 1985.
- 23. Mrs. M. Ramierez, NSC Annex Long Beach, telephone interview, 14 Nov 1985.
- 24. Mrs. C. Mahn, NSC Annex Mare Island, telephone interview, 14 Nov 1985.

INITIAL DISTRIBUTION LIST

		No.	Copies
1.	Defense Technical Information Center Cameron Station Alexandria, Virginia 22304-6145		2
2.	Library, Code 0142 Naval Postgraduate School Monterey, Calirornia 93943-5100		2
3.	Commander (Code 071B) Attn: Mr. David Greemore Naval Sea Systems Command Washington, D. C. 20632-5101		2
4-	Commanding Officer (Code 035) Attn: Mr. Jan Sipe Navy Ships Parts Control Center P. O. Box 2020 Mechanicsburg, Pennsylvania 17055		1
5.	Commanding Officer (Code 0503) Attn: Commander Mike Jenkins, SC, USN Navy Ships Parts Control Center P. O. Box 2020 Mechanicsburg, Pennsylvania 17055		1
6.	Commanding Officer (Code 224) Attn: Mr. Art Green Long Beach Naval Shipyard Long Beach, California 90822		2
7.	Commanding Officer (Code 212) Attn: Mr. Ray MacDaniels Charleston Naval Shipyard Charleston, South Carolina 29408		1
8.	Commanding Officer (Code 510) Attn: LCDR J. R. Rodwell, SC, USN Charleston Naval Shipyard Charleston, South Carolina 29408		3
9.	Commanding Officer (Code 215) Attn: Mr. Dave Rich Mare Island Naval Shipyard Vallejo, California 94592-5100		1
10.	Commanding Officer (Code 214) Attn: Mr. Eddie Belcher Norfolk Naval Shipyard Portsmouth, Virginia 23709-5000		1
11.	Commanding Officer (Code 0503) Attn: LCER Dick Gormly, SC, USN Navy Ships Parts Control Center P. O. Box 2020 Mechanicsburg, Pennsylvania 17055		1
12.	Professor Allan W. McMasters Department of Administrative Sciences (Co Naval Postgraduate School Monterey, California 93943-5100	de 54MG) 3

13.	Professor P. M. Carrick Department of Administrative Sciences (Code 54CA Naval Postgraduate School Monterey, California 93943-5100) 2
14.	Mr. Ed Lovelace 2330 Golden Avenue Long Beach, California 90806	1
15.	Curricular Office (Code 36) Naval Postgraduate School Monterey, California 93943-5000	1
16.	Defense Logistics Studies Information Exchange US Army Logistics Management Center Fort Lee, Virginia 23801	1

FILMED 4-86